

Site Investigation Report

Auger Ref:

114239.1.TSI



Job Information

Client	Sedgwick
Client ref	9083781
Visit date	19/11/2020
Report date	19/11/2020

Job Summary

✓ 1 trial hole undertaken. [Read more.](#)



Job Information

Overview

Brief Auger were commissioned by Sedgwick to undertake a site investigation within the area of concern at the property.

Photographs

Trial Hole 1

Fig 1.1: Trial Hole 1 Location



Fig 1.2: Trial Hole 1 Footing



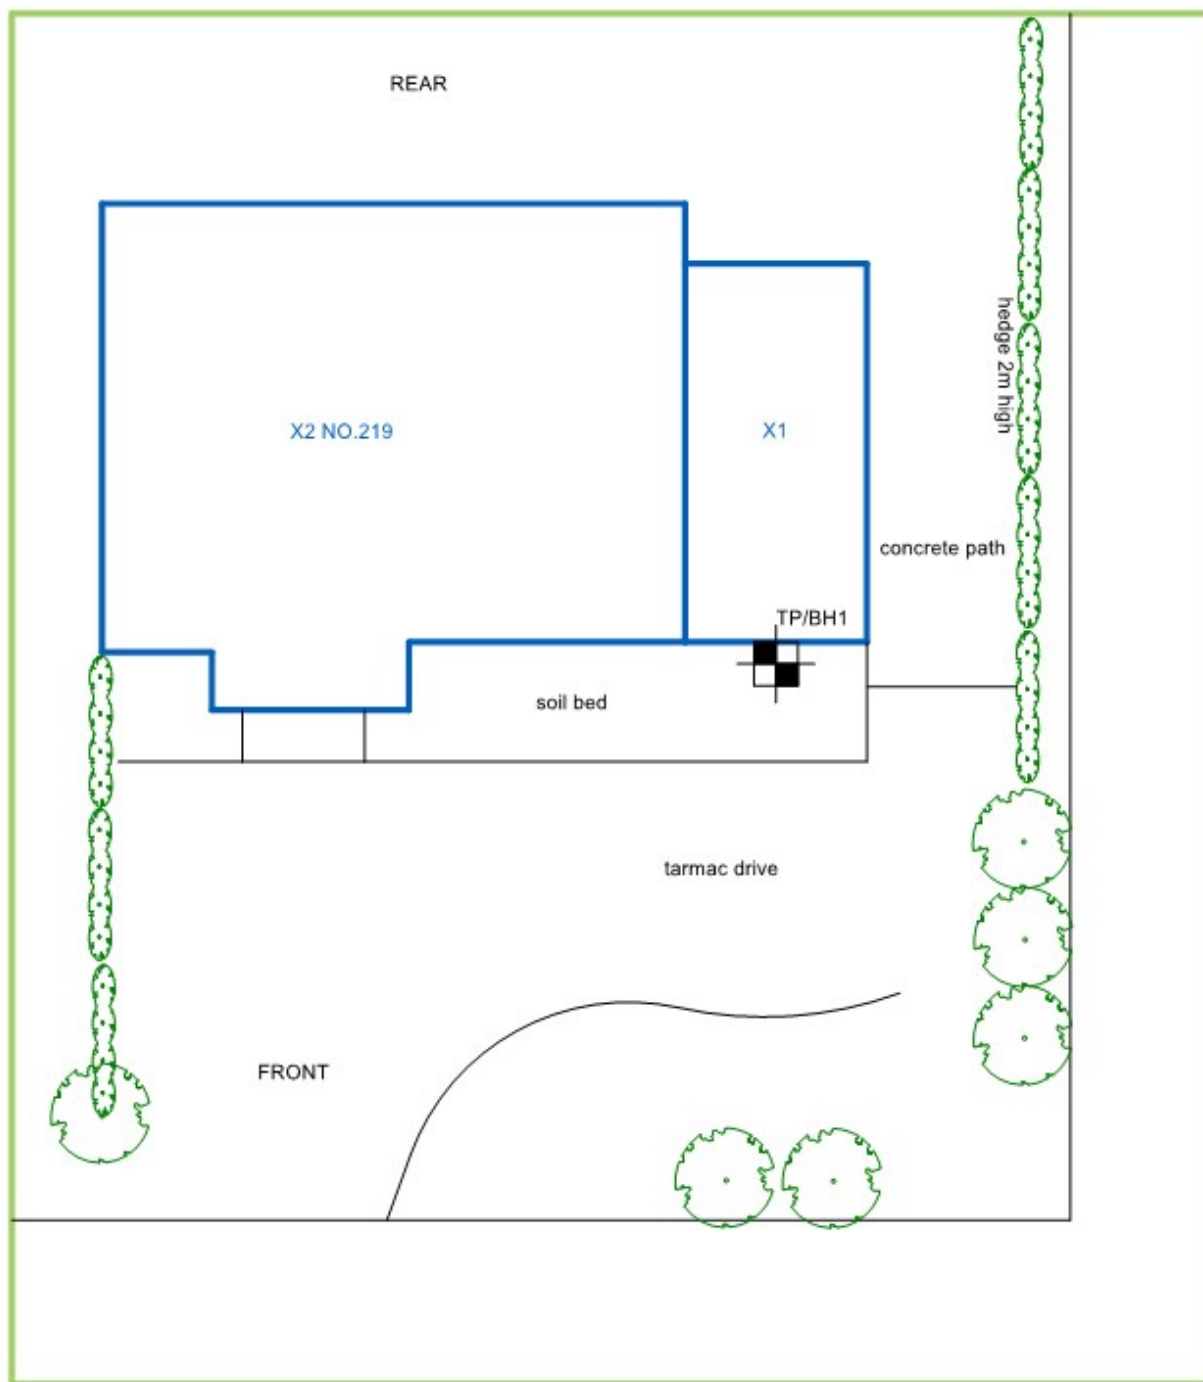
Other Photos

Fig 2.1: Soil samples collected



Fig 2.2: Root samples collected





FRONT OF PROPERTY

This drawing should be used for diagrammatic purposes only. Auger are not responsible or liable for any 3rd party works undertaken using the details outlined in this drawing. Confirmation of the drainage configuration can only be confirmed by excavation or detailed technical survey.

LEGEND

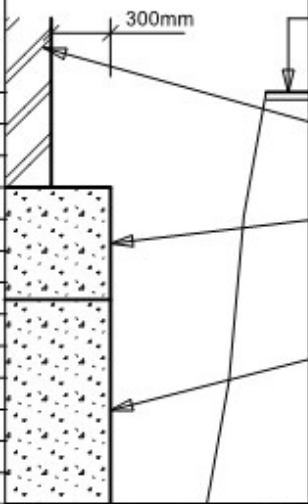
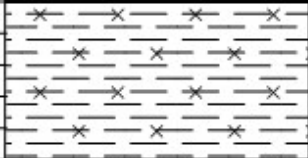
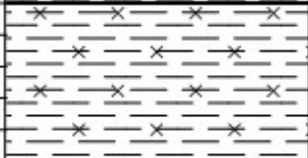
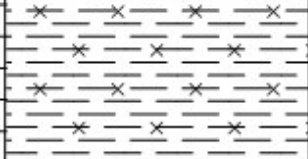
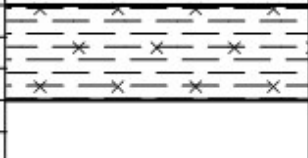
	= Manhole		= Blockage		= Lines not camera surveyed		= Steps		= Trial hole		= Shrubs/bush
	= Inspection Chamber		= syp/w/c		= Lines camera surveyed		= Borehole		= Hedge		= Tree
	= Inspection Pot		= wg/fwg		= Assumed water mains feed		= gate / door		= Direction of flow		
			= rwg		= Walls						
			= rwp		= Fences						
					= Building Outline						



Trial Hole Log No.1

Location: Front right

Job Ref:
114239.1.TSI

Depth (m)	Symbolic Log	Strata Description	Insitu Tests		Soil Sample	Root Sample
			SV(19)			
0.0		Ground Level				
		Soil (Border)				
		Brickwork				
		Original Concrete				
0.5		Concrete underpinning				
1.0						
1.5		Dry very stiff Brown fine gravelly sandy silty CLAY	120kpa		Soil @ 1.3m	Root @ 1.3m
2.0			128kpa		Soil @ 1.8m	Root @ 1.8m
2.5		Brown fine to medium gravelly sandy silty CLAY	140kpa		Soil @ 2.3m	
3.0		Brown sandy silty CLAY	140kpa		Soil @ 2.8m	
3.5		TRIAL HOLE TERMINATED	140kpa			