

Your ref LIV-SN-22-005467

Our ref 09303GLOB

Geo-Serv Limited
17 Hoveden Road
London NW2 3XE

tel: 020 8208 0343

email: mon@geo-serv.com

**Subsidence
Monitoring
Services**



GEO-SERV

360Globalnet Ltd
Regus House, Herald Way,
Pegasus Business Park,
Castle Donnington, Leicestershire,
DE74 2TZ

Issue date: 14/12/2023

Monitoring visit 3 of 5

Monitoring Plus Report


Owners name	Ms S Berrett	Suspected cause	to be advised	Monitoring type	levels & cracks
Address	27 The Foxgloves Hedge End Southampton SO30 0UG	Principal area of damage	to be advised	Installed	09/06/2023
		Damage category	to be advised	Frequency (weeks)	8.7
		Surface geology	to be advised	Completion date	Feb 24
Comment				Status	open
Max movement	5.4 mm	Feedback from last visit	no feedback for this visit		
Focal area	Pts 2r, 3cill, 4r, 5r, 6r, 8,				
Attached photos of the cracks	Sketch showing location of monitoring points				

Level Monitoring Results

Survey:	1		2		3		4		5	
By:	VV		VV		VV					
Date:	09/06/2023		08/08/2023		14/12/2023		#N/A		#N/A	
Point ID	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
1	1000.00	0.0	1000.00	0.0	1000.00	0.0		#N/A		#N/A
2r	1491.79	0.0	1487.72	-4.1	1490.52	-1.3		#N/A		#N/A
3cill	873.34	0.0	869.80	-3.5	872.45	-0.9		#N/A		#N/A
4r	1483.37	0.0	1477.99	-5.4	1482.38	-1.0		#N/A		#N/A
5r	1483.47	0.0	1478.42	-5.1	1482.26	-1.2		#N/A		#N/A
6r	1484.56	0.0	1481.22	-3.3	1483.65	-0.9		#N/A		#N/A
7r	1486.75	0.0	1483.82	-2.9	1486.22	-0.5		#N/A		#N/A
8	936.23	0.0	933.62	-2.6	936.92	0.7		#N/A		#N/A

closing error (mm)	0.00	0.00	0.00	#REF!	#REF!
--------------------	------	------	------	-------	-------

Precise level monitoring related to Point 1

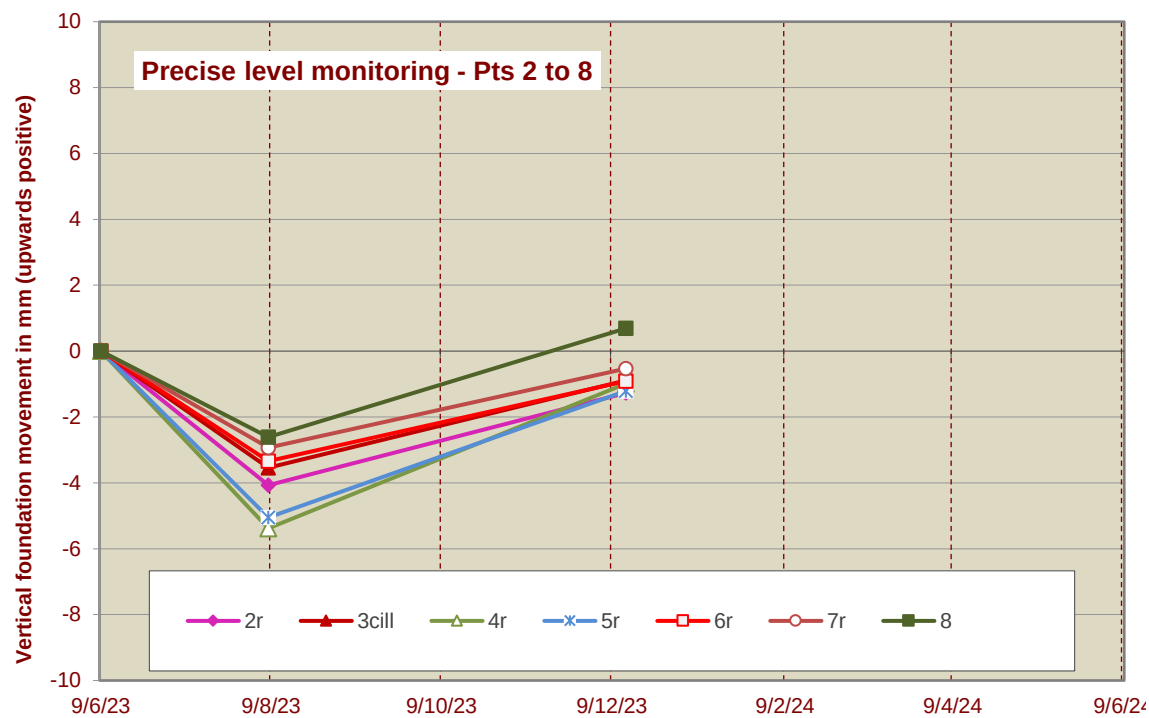

Crack monitoring results


Survey: By: Date:		1 VV 09/06/2023		2 VV 08/08/2023		3 VV 14/12/2023		4 #N/A		5 #N/A	
Crack ID	initial width mm	sprtn mm	chngs mm	sprtn mm	chngs mm	sprtn mm	chngs mm	sprtn mm	chngs mm	levels mm	chngs mm
A (horiz)	3.20	74.65	0.0	77.21	2.6	75.86	1.2		#N/A		#N/A
A (diag)		151.90	0.0	148.88	-3.0	150.91	-1.0		#N/A		#N/A
A (check)		135.51	0.0	135.46	0.0	135.46	0.0		#N/A		#N/A

all measurements made with internal jaws unless marked with asterisk, ^ = angle bracket, \$ = measurement with butt end of calipers

crack descriptions

A (horiz) Demec triplet, internal, conservatory.

Crack monitoring

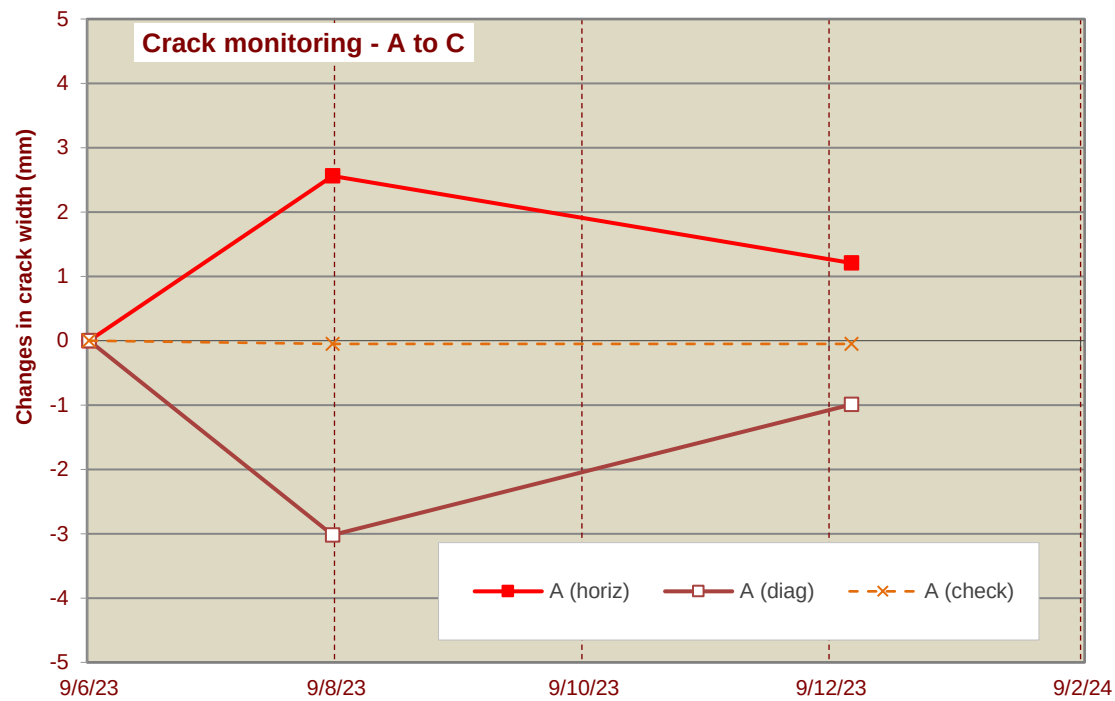

Photos for report

