



Our Ref: J273458 FI: 26
Your Ref: TBC
Date: 03/10/2023

ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227



260

Tel: (01329) 287777
Fax: (01329) 287755
www.envirochem.co.uk
office@envirochem.co.uk

DEMOLITION ASBESTOS SURVEY
TO
BISHOPSTOKE MEMORIAL HALL,
17 RIVERSIDE,
BISHOPSTOKE,
EASTLEIGH,
HAMPSHIRE
SO50 6LQ
ON BEHALF OF
EASTLEIGH BOROUGH COUNCIL



DISCLAIMER

Envirochem completed this survey on the basis of a specified program of work and terms and conditions agreed with the Client. All reasonable skill and care, bearing in mind the project objectives and the agreed scope of work, have been exercised during the preparation of this survey report.

Following the issue of this survey report, responsibility to any parties for any matters arising, which may be considered outside of the agreed scope of work, will not be accepted by Envirochem.

This survey report is confidential. Envirochem will accept liability to no parties with the exception of the Client. Without the written agreement of Envirochem, no one with the exception of the Client, may rely upon or have the benefit of this survey report.

Envirochem asserts and retains all copyright, and other intellectual property rights, in and over the survey report and its contents unless these rights were specifically assigned or transferred within the terms of the agreement.

Any questions or matters arising from this survey report should be addressed to Envirochem.

CONTENTS

SECTION	Title	
	Title Page	Page 1
	Disclaimer	Page 2
	Contents	Page 3
1	Executive Summary	Page 4
2	Introduction	Page 6
3	Initial Observations	Page 8
4	Areas of No Access	Page 9
5	Method Statement	Page 10
6	Asbestos Removal and Disposal	Page 11

APPENDIX	Title	
1	Asbestos Fibre Identification Report	Page 12
2	List Of Asbestos Containing Materials	Page 19
3	List of Negative Samples	Page 20
4	Photographs	Page 22
5	Marked Plans	Page 24

	Name	Signed	Dated
Report Authorised By	Paul Gould (Lead Surveyor)		3 Oct 2023

SECTION 1 - Executive Summary

This report is based on the findings of a demolition asbestos survey (as defined by Health and Safety Executive (HSE) Guidance Note HSG264: Asbestos: The Survey Guide) carried out by Envirochem at Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ. The purpose of the survey was to determine the location, extent and product type of all reasonably accessible asbestos containing materials (ACMs) within the building.

Scope of work

A demolition asbestos survey was carried out to Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Asbestos identified

SAMPLE NUMBER	SAMPLE DESCRIPTION	PRODUCT TYPE
Sample 21	Mezzanine Storage Area, Cement panels to front and rear gable ends	Asbestos Cement
Sample 22	External Exterior, Profile cement roof sheets sampled internally.	Asbestos Cement
Ref. Sample 22	External Exterior, Cement roof edging boards	Asbestos Cement
Sample 23	External Exterior, Cement downpipes around perimeter	Asbestos Cement
Sample 24	External Exterior, Cement gutterings around perimeter	Asbestos Cement
Sample 25	External Exterior, Cement soffit boards around perimeter	Asbestos Cement

Areas of no access

The following areas were not accessed at the time of the survey:

AREA	REASON FOR NON-ACCESS
There were no areas of no access in the survey.	

Until the above locations are accessed, as stated within HSE Guidance Note HSG 264, it should be presumed that these areas contain ACMs.

Asbestos containing materials and actions required

SAMPLE NUMBER	SAMPLE DESCRIPTION	PRODUCT TYPE	ACTION REQUIRED
Sample 21	Mezzanine Storage Area, Cement panels to front and rear gable ends	Asbestos Cement	Removal of non-licensed ACMs (Remove (non-licensed))
Sample 22	External Exterior, Profile cement roof sheets sampled internally.	Asbestos Cement	Removal of non-licensed ACMs (Remove (non-licensed))
Ref. Sample 22	External Exterior, Cement roof edging boards	Asbestos Cement	Removal of non-licensed ACMs (Remove (non-licensed))
Sample 23	External Exterior, Cement downpipes around perimeter	Asbestos Cement	Removal of non-licensed ACMs (Remove (non-licensed))
Sample 24	External Exterior, Cement gutterings around perimeter	Asbestos Cement	Removal of non-licensed ACMs (Remove (non-licensed))
Sample 25	External Exterior, Cement soffit boards around perimeter	Asbestos Cement	Removal of non-licensed ACMs (Remove (non-licensed))

The purpose of this survey is to identify the asbestos containing materials that are present, with the assumption that during demolition, all ACMs discovered are to be removed.

SECTION 2 – Introduction

Envirochem Analytical Laboratories Ltd is a well established, independent organisation. We are United Kingdom Accreditation Service (UKAS) accredited as a testing laboratory (Number: 1227) and as an inspection body (Number: 260). This accreditation covers fibre identification of asbestos bulk samples, air monitoring for asbestos and asbestos building surveys. All asbestos lead surveyors hold, as a minimum qualification, the British Occupational Hygiene Society (BOHS) proficiency certificate in Building surveys and bulk sampling for asbestos (P402). Likewise, those employed in the other fields mentioned hold, as a minimum qualification, the relevant BOHS proficiency certificate.

We also have expertise and experience in setting up and monitoring asbestos management plans.

This report is based on the findings of a demolition (as defined by Health and Safety Executive (HSE) Guidance Note HSG264: Asbestos: The Survey Guide) survey carried out by Envirochem at Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ.

The survey was carried out on the 19th September 2023 by Paul Gould and Tom Butler on behalf of Envirochem Analytical Laboratories Ltd, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS, as instructed by Pearl Tee of Eastleigh Borough Council, Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN.

The purpose of the survey was to determine the location, extent and product type of all asbestos containing materials (ACMs) within the areas covered by this survey report. This information should form part of the Health and Safety plan for any proposed demolition work, as required by the CDM Regulations and/or the Control of Asbestos Regulations 2012.

For further information with respect to the survey report or to arrange asbestos removal work or to arrange a free consultation at our premises please contact Mr Matthew Hurst or Mr Stuart White on 01329 287777.

The location and description, as far as was reasonably possible, of all suspected ACMs within all areas of the building were recorded. ACMs have not been disturbed or removed during the course of this survey. There is the possibility for additional ACMs to be present behind those identified, which may only be discovered during subsequent asbestos removal work.

Samples of each different type of suspected ACM were collected in accordance with HSE Guidance Note HSG264 for laboratory analysis. The samples were then analysed in accordance with HSE Guidance Note HSG248 to identify, which suspected ACMs, actually contained asbestos.

For sampled suspected ACMs, similar homogenous materials used in the same way throughout the building have not been sampled. In this instance the referenced suspected ACM can be strongly presumed to have the same make up as the sampled suspected ACM. Where a suspected ACM cannot be sampled but visually identified only there will be a presumption as to the make up of the material.

The survey is designed to be used as a basis for costing the removal of ACMs from the building prior to demolition. Any person or people using the report in this way must satisfy themselves as to the extent of the ACMs within the designated area and thereby ensure that their tender is sufficient in every respect to remove all the ACMs within these areas, including the possibility of any that may be hidden behind identified, strongly presumed or presumed ACMs.

Due to the situation in which the survey is required the condition of the asbestos is not assessed and an asbestos material assessment is not created, instead a list of asbestos containing materials is developed. It should be noted that even when there are no ACMs identified in any particular area this is not a guarantee that ACMs are not present in this area. For instance ACMs may be located within the structure of the building and not identified until demolition of the building. Due caution must always be taken when dealing with building materials and suspected ACMs must be reported and left undisturbed until further investigation proves it safe to proceed.

Each sample has been inspected by the surveyor with a visual assessment of the product type being made. In accordance

with the CAR 2012, if a conclusive answer is required for purposes of asbestos removal whether a product is either an insulation board or a cement product type, then a separate water absorption test must be performed at the request of the client.

SECTION 3 - Initial Observations

A demolition asbestos survey was carried out to Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Externally the building is constructed of brick and wooden walls, profile cement roof sheets, cement soffit boards, downpipes and gutterings, hardboard and modern bitumen felt forming entrance canopy, putty to metal windows.



SECTION 4 - Areas of No Access

During the course of this survey no ACMs have been disturbed or removed. There is the possibility that additional ACMs may be present behind those identified. These additional ACMs would only become evident during any subsequent asbestos removal work.

Specific Areas of No Access

AREA	REASON FOR NON-ACCESS
There were no areas of no access in the survey.	

As stated within HSE Guidance Note HSG264 areas where access cannot be gained must be presumed to contain ACMs until evidence can prove otherwise. All areas listed above should be revisited prior to further works.

SECTION 5 - Method Statement

Sampling of Suspected Asbestos Containing Materials (ACMs)

Samples of each different type of suspected ACM were collected in accordance with HSE Guidance Note HSG264 for laboratory analysis.

- ┆ The surveyor(s) visited each area to identify the position and number of samples. Also they assessed the health and safety requirements both for the occupiers of the adjacent areas as well as the surveyors.
- ┆ During sampling, the surveyors wore the personal protective equipment as appropriate to the risk assessment. In critical areas, warning signs were posted to restrict access during sampling.
- ┆ Sampling locations were damped down to reduce the risk of fibre release and samples were collected with shadow vacuuming where necessary. Upon completion of the sampling any debris created was cleaned by either H-type vacuums or wet wiping.
- ┆ The sample was placed in a labelled plastic bag, sealed and then placed in a second bag. Where required the sampling position was made good to minimise fibre release and labelled.
- ┆ Details of the samples location, product type, extent were recorded to enable a list of asbestos containing materials to be prepared.

Fibre Identification of Suspected Asbestos Containing Materials (ACMs)

Each sampled suspected ACM was analysed in the laboratory in accordance with HSE Guidance Note HSG248. This analysis involved stereo microscopy and polarised light microscopy in association with dispersion staining techniques.

Using polarised light microscopy very fine asbestos fibres such as those present in some textured coatings may not always be identifiable.

SECTION 6 - Asbestos Removal and Disposal

Under the Control of Asbestos Regulations 2012, there are three categories of asbestos removal; licensed, non notifiable and notifiable non-licensed work. For licensed work, generally involving asbestos insulation, insulation board and coatings, only a HSE licensed asbestos removal specialist can carry out this work. This work would generally take place inside an enclosure incorporating a three-stage airlock and kept under negative pressure.

Licensable work can only occur once a 14-day period has passed since the HSE received notification from the HSE licensed asbestos removal specialist of the forthcoming asbestos work.

The other two categories, non notifiable and notifiable non-licensed work, trained operatives with the correct equipment should be used as a minimum, Envirochem would always recommend using a licensed contractor for this work. For the purpose of this survey report, all work that would fall into these two categories have been classified as, removal (non-licensed). If these materials are to be removed, a risk assessment should be carried out by the removal operatives on the condition of the material at the time of pre removal and the expected fibre levels from similar work to allow the material to be categorised as non notifiable or notifiable non-licensed work. If the material is classified as notifiable non-licensed work, the local authority should be informed of the removal works prior to it commencing.

All waste with an asbestos content in excess of 0.1% of the total weight is classified as hazardous waste in accordance with the Environment Agency Hazardous Waste Regulation 2005 and therefore must be deposited at a site which is licensed to accept hazardous waste.

It is the recommendation of Envirochem that all work involving ACMs is undertaken by a HSE licensed asbestos removal specialist to ensure all legislation and guidelines are adhered to.

For information regarding work with asbestos or to arrange work with asbestos please contact Mr Matthew Hurst or Mr Stuart White on 01329 287777.



ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227

Tel: (01329) 287777

Fax: (01329) 287755

www.envirochem.co.uk

office@envirochem.co.uk

Our Ref: J273458 FI: 26

Your Ref: TBC

Date: 03/10/2023

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN

Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Sampled By: Paul Gould

Date sampled/received: 19th September 2023

Date analysed: 23rd September 2023

Analyst/s: Alice Webster

Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 1	EG003086	Ground Floor Disabled Toilet inc Lobby, Insulation board panels to RHS reassessed wall.	No	
Sample 2	EG003087	Ground Floor Disabled Toilet inc Lobby, Plasterboard wall panels	No	
Sample 3	EG003088	Ground Floor Disabled Toilet inc Lobby, Insulation board panels to main walls	No	
Sample 4	EG003089	Ground Floor Disabled Toilet inc Lobby, Insulation board ceiling panels	No	

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

SIGNATURE:

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:
03/10/2023

Reg. No. 2378228 England. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.



ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227

Tel: (01329) 287777

Fax: (01329) 287755

www.envirochem.co.uk

office@envirochem.co.uk

Our Ref: J273458 FI: 26

Your Ref: TBC

Date: 03/10/2023

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN

Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Sampled By: Paul Gould

Date sampled/received: 19th September 2023

Date analysed: 23rd September 2023

Analyst/s: Alice Webster

Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 5	EG003090	Ground Floor Disabled Toilet inc Lobby, Vinyl floor tiles beneath modern vinyl lay	No	
Sample 6	EG003091	Ground Floor Store Cupboard, Wooden wall panels	No	
Sample 7	EG003092	Ground Floor Kitchen, Insulation board wall panels	No	
Sample 8	EG003094	Ground Floor Kitchen, Insulation board ceiling panels	No	

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:
03/10/2023

Reg. No. 2378228 England. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.



ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227

Tel: (01329) 287777

Fax: (01329) 287755

www.envirochem.co.uk

office@envirochem.co.uk

Our Ref: J273458 FI: 26

Your Ref: TBC

Date: 03/10/2023

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN

Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Sampled By: Paul Gould

Date sampled/received: 19th September 2023

Date analysed: 23rd September 2023

Analyst/s: Alice Webster

Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 9	EG003095	Ground Floor Kitchen, Vinyl floor tiles beneath modern vinyl lay	No	
Sample 10	EG003096	Ground Floor Kitchen, Wooden boxing panels	No	
Sample 11	EG003097	Ground Floor Kitchen, Bitumen pads to underside of sink 2x sinks	No	
Sample 12	EG003098	Ground Floor Entrance Lobby, Wooden wall panels	No	

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:
03/10/2023

Reg. No. 2378228 England. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.



Our Ref: J273458 FI: 26
Your Ref: TBC
Date: 03/10/2023

ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227
Tel: (01329) 287777
Fax: (01329) 287755
www.envirochem.co.uk
office@envirochem.co.uk

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN
Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ
Sampled By: Paul Gould
Date sampled/received: 19th September 2023
Date analysed: 23rd September 2023
Analyst/s: Alice Webster
Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 13	EG003099	Ground Floor Ladies Toilet including Cupboards, Wooden panels to main walls	No	
Sample 14	EG003100	Ground Floor Ladies Toilet including Cupboards, Insulation board ceiling panels	No	
Sample 15	EG003101	Ground Floor Ladies Toilet including Cupboards, Insulation board wall panels within cupboards	No	
Sample 16	EG003102	Ground Floor Ladies Toilet including Cupboards, Ceramic wall tile adhesive	No	

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:
03/10/2023

and. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.



ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227

Tel: (01329) 287777

Fax: (01329) 287755

www.envirochem.co.uk

office@envirochem.co.uk

Our Ref: J273458 FI: 26

Your Ref: TBC

Date: 03/10/2023

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN

Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Sampled By: Paul Gould

Date sampled/received: 19th September 2023

Date analysed: 23rd September 2023

Analyst/s: Alice Webster

Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 17	EG003103	Ground Floor Main Hall, Insulation board wall panels	No	
Sample 18	EG003104	Ground Floor Main Hall, Insulation board ceiling panels	No	
Sample 19	EG003105	Ground Floor Main Hall, Wooden wall and ceiling boxings	No	
Sample 20	EG003106	Ground Floor Main Hall, Insulation board profile wall panels above and around stage	No	

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:

03/10/2023

nd. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.



ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227

Tel: (01329) 287777

Fax: (01329) 287755

www.envirochem.co.uk

office@envirochem.co.uk

Our Ref: J273458 FI: 26

Your Ref: TBC

Date: 03/10/2023

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN

Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ

Sampled By: Paul Gould

Date sampled/received: 19th September 2023

Date analysed: 23rd September 2023

Analyst/s: Alice Webster

Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 21	EG003107	Mezzanine Storage Area, Cement panels to front and rear gable ends	Yes	Chrysotile
Sample 22	EG003108	External Exterior, Profile cement roof sheets sampled internally.	Yes	Chrysotile
Sample 23	EG003109	External Exterior, Cement downpipes around perimeter	Yes	Chrysotile
Sample 24	EG003110	External Exterior, Cement gutterings around perimeter	Yes	Chrysotile

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:
03/10/2023

England. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.



Our Ref: J273458 FI: 26
Your Ref: TBC
Date: 03/10/2023

ENVIROCHEM
Analytical Laboratories Ltd.
12 The Gardens
Broadcut, Fareham
Hampshire
PO16 8SS



1227
Tel: (01329) 287777
Fax: (01329) 287755
www.envirochem.co.uk
office@envirochem.co.uk

Asbestos Fibre Identification Report

Client: Eastleigh Borough Council
Property Services, Civic Offices, Leigh Road, Eastleigh, Hampshire, SO50 9YN
Site Address: Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ
Sampled By: Paul Gould
Date sampled/received: 19th September 2023
Date analysed: 23rd September 2023
Analyst/s: Alice Webster
Analysis Location: 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS

ANALYTICAL PROCEDURE

Fibre identification was carried out in accordance with the documented 'in-house' method (2.01) based on the HSE Guidance Note HSG 248. These employed stereo microscopy, polarized microscopy and dispersion staining techniques.

RESULTS

Sample No.	Sample Ref.	Location	Asbestos Detected	Asbestos Type
Sample 25	EG003111	External Exterior, Cement soffit boards around perimeter	Yes	Chrysotile Crocidolite
Sample 26	EG003112	External Exterior, Putty to metal windows throughout	No	

NOTES:

1. Sample(s) were examined for the presence of 6 types of asbestos fibres: crocidolite (blue), amosite (brown), chrysotile (white), anthophyllite, actinolite and tremolite.
2. The results shown in this test report specifically refer to the sample(s) tested as received unless otherwise stated and samples collected by the client are evaluated using information provided by the client. For samples collected by the client the date of receipt is deemed to be the same as the date sampled.
3. Envirochem is a UKAS accredited testing laboratory No. 1227 for sampling and identification of asbestos containing materials.
4. Comments, observations and opinions are outside the scope of UKAS accreditation.
5. The analytical method in the HSG248 does not quantify the amount of asbestos present, therefore UKAS accreditation does not permit quantification.
6. If, during fibre identification, only 1 or 2 fibres are seen and identified as asbestos, then the term 'trace asbestos identified' is used.
7. This report shall not be reproduced except in full, without written approval of Envirochem.
8. Samples are retained for 6 months, report kept for 5 years from the date of authorisation of this report.

Authorised signatory

PRINT NAME: Frances Scott

DATE AUTHORISED:
03/10/2023

gland. Registered Office: Envirochem, 12 The Gardens, Broadcut, Fareham, Hampshire, PO16 8SS.

Envirochem Analytical Laboratories Ltd.

List of Asbestos Containing Materials

Site Address Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ
Date of Survey 19th September 2023
Reference Number J273458

Sample No.	Location	Level of Identification	Product Type	Asbestos Type	Extent
Sample 21	Mezzanine Storage Area, Cement panels to front and rear gable ends	Identified	Asbestos Cement	Chrysotile	60m ²
Sample 22	External Exterior, Profile cement roof sheets sampled internally.	Identified	Asbestos Cement	Chrysotile	300m ²
Ref. Sample 22	External Exterior, Cement roof edging boards	Strongly Presumed	Asbestos Cement	Chrysotile	32lm
Sample 23	External Exterior, Cement downpipes around perimeter	Identified	Asbestos Cement	Chrysotile	8no.
Sample 24	External Exterior, Cement gutterings around perimeter	Identified	Asbestos Cement	Chrysotile	60lm
Sample 25	External Exterior, Cement soffit boards around perimeter	Identified	Asbestos Cement	Chrysotile + Crocidolite	60lm

Envirochem Analytical Laboratories Ltd.

Appendix 3 - List of Negative Samples

Page 20 of 26

Site Address Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ
Date of Survey 19th September 2023
Reference Number J273458
Surveyors Paul Gould

Sample No.	Location	Product Type
Sample 1	Ground Floor Disabled Toilet inc Lobby, Insulation board panels to RHS reassessed wall.	Non Asbestos Insulating Board
Ref. Sample 1	Ground Floor Store Cupboard, Insulation board wall panels around door	Non Asbestos Insulating Board
Sample 2	Ground Floor Disabled Toilet inc Lobby, Plasterboard wall panels	Non Asbestos Insulating Board
Sample 3	Ground Floor Disabled Toilet inc Lobby, Insulation board panels to main walls	Non Asbestos Insulating Board
Sample 4	Ground Floor Disabled Toilet inc Lobby, Insulation board ceiling panels	Non Asbestos Insulating Board
Ref. Sample 4	Ground Floor Store Cupboard, Insulation board ceiling panels	Non Asbestos Insulating Board
Ref. Sample 4	Ground Floor Gents Toilet, Insulation board ceiling panels	Non Asbestos Insulating Board
Sample 5	Ground Floor Disabled Toilet inc Lobby, Vinyl floor tiles beneath modern vinyl lay	Vinyl tile
Ref. Sample 5	Ground Floor Store Cupboard, Vinyl floor tiles	Vinyl tile
Ref. Sample 5	Ground Floor Gents Toilet, Vinyl floor tiles beneath modern vinyl lay	Vinyl tile
Sample 6	Ground Floor Store Cupboard, Wooden wall panels	Non Asbestos Insulating Board
Ref. Sample 6	Ground Floor Gents Toilet, Wooden wall panels	Non Asbestos Insulating Board
Sample 7	Ground Floor Kitchen, Insulation board wall panels	Non Asbestos Insulating Board
Sample 8	Ground Floor Kitchen, Insulation board ceiling panels	Non Asbestos Insulating Board
Ref. Sample 8	Ground Floor Entrance Lobby, Insulation board ceiling panels	Non Asbestos Insulating Board
Sample 9	Ground Floor Kitchen, Vinyl floor tiles beneath modern vinyl lay	Vinyl tile
Ref. Sample 9	Ground Floor Entrance Lobby, Vinyl floor tiles beneath carpet	Vinyl tile
Ref. Sample 9	Ground Floor Ladies Toilet including Cupboards, Vinyl floor tiles beneath modern vinyl lay	Vinyl tile
Sample 10	Ground Floor Kitchen, Wooden boxing panels	Non Asbestos Insulating Board

Envirochem Analytical Laboratories Ltd.

Appendix 3 - List of Negative Samples

Page 21 of 26

Site Address Bishopstoke Memorial Hall, 17 Riverside, Bishopstoke, Eastleigh, Hampshire, SO50 6LQ
Date of Survey 19th September 2023
Reference Number J273458
Surveyors Paul Gould

Sample 11	Ground Floor Kitchen, Bitumen pads to underside of sink 2x sinks	Bitumen
Sample 12	Ground Floor Entrance Lobby, Wooden wall panels	Non Asbestos Insulating Board
Sample 13	Ground Floor Ladies Toilet including Cupboards, Wooden panels to main walls	Non Asbestos Insulating Board
Sample 14	Ground Floor Ladies Toilet including Cupboards, Insulation board ceiling panels	Non Asbestos Insulating Board
Sample 15	Ground Floor Ladies Toilet including Cupboards, Insulation board wall panels within cupboards	Non Asbestos Insulating Board
Sample 16	Ground Floor Ladies Toilet including Cupboards, Ceramic wall tile adhesive	Composite / Resin
Sample 17	Ground Floor Main Hall, Insulation board wall panels	Non Asbestos Insulating Board
Ref. Sample 17	Ground Floor Dressing Room including Toilets, Insulation board wall panels	Non Asbestos Insulating Board
Ref. Sample 17	Ground Floor Stage, Insulation board wall panels	Non Asbestos Insulating Board
Sample 18	Ground Floor Main Hall, Insulation board ceiling panels	Non Asbestos Insulating Board
Ref. Sample 18	Ground Floor Stage, Insulation board ceiling panels	Non Asbestos Insulating Board
Ref. Sample 18	Ground Floor Dressing Room including Toilets, Insulation board ceiling panels	Non Asbestos Insulating Board
Sample 19	Ground Floor Main Hall, Wooden wall and ceiling boxings	Non Asbestos Insulating Board
Ref. Sample 19	Ground Floor Dressing Room including Toilets, Wooden wall and ceiling boxings	Non Asbestos Insulating Board
Ref. Sample 19	Ground Floor Stage, Wooden wall and ceiling boxings	Non Asbestos Insulating Board
Sample 20	Ground Floor Main Hall, Insulation board profile wall panels above and around stage	Non Asbestos Insulating Board
Sample 26	External Exterior, Putty to metal windows throughout	Putty

APPENDIX 4 - Photographs of Asbestos Containing Materials

Sample 21: Mezzanine. Storage Area. Cement panels to front and rear gable ends



Sample 22: External. Exterior. Profile cement roof sheets sampled internally.




Ref. Sample 22: External. Exterior. Cement roof edging boards



Sample 23: External. Exterior. Cement downpipes around perimeter



Sample 24: External. Exterior. Cement gutterings around perimeter

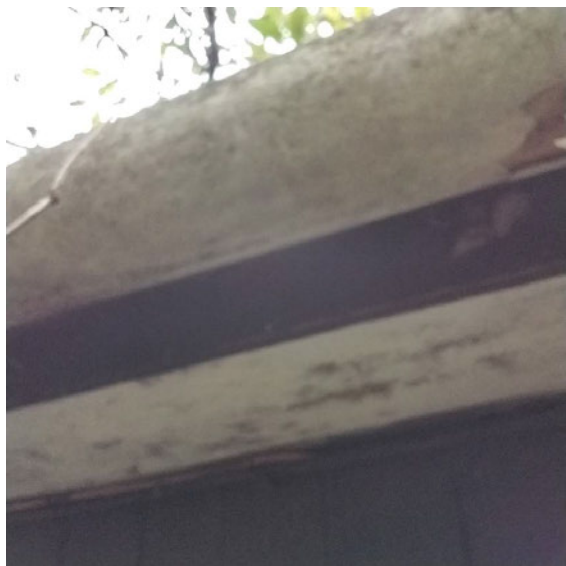


Sample 25: External. Exterior. Cement soffit boards around perimeter




APPENDIX 5 - Marked Plans


Client: Eastleigh Borough Council
Site: Bishopstoke Memorial Hall
17 Riverside
Bishopstoke
Eastleigh
Hampshire
SO50 6LQ

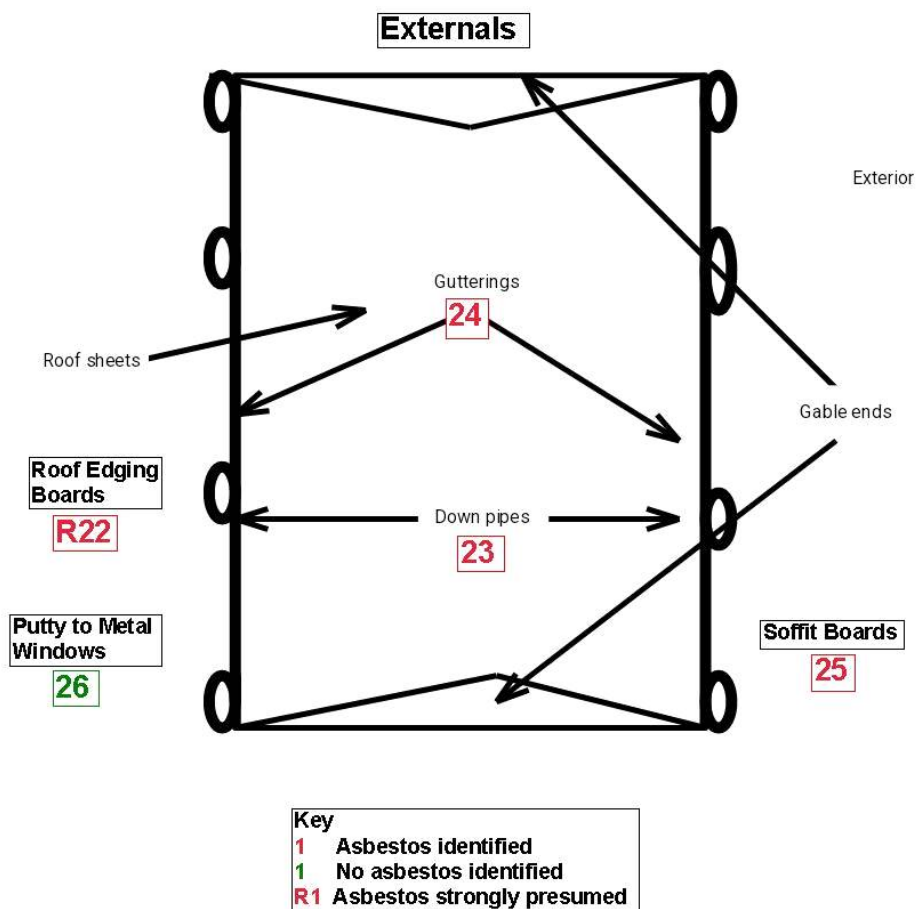

Client: Eastleigh Borough Council
Site: Bishopstoke Memorial Hall
17 Riverside
Bishopstoke
Eastleigh
Hampshire
SO50 6LQ

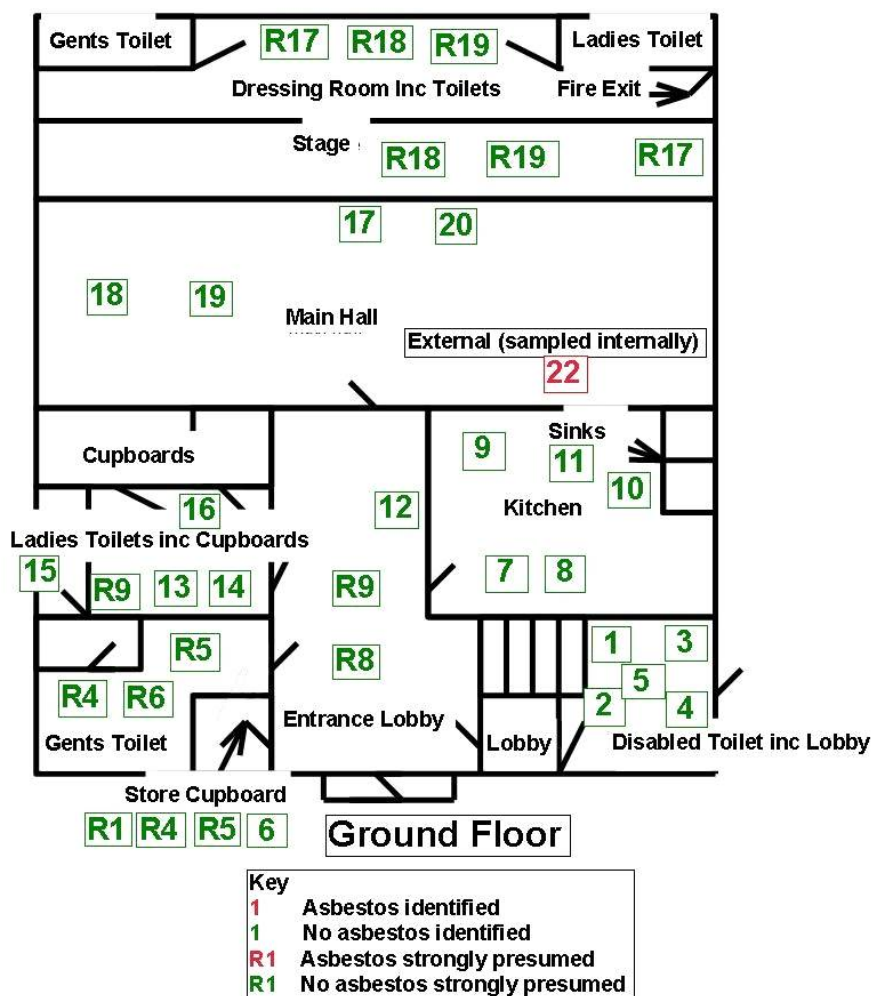

Client: Eastleigh Borough Council
Site: Bishopstoke Memorial Hall
17 Riverside
Bishopstoke
Eastleigh
Hampshire
SO50 6LQ

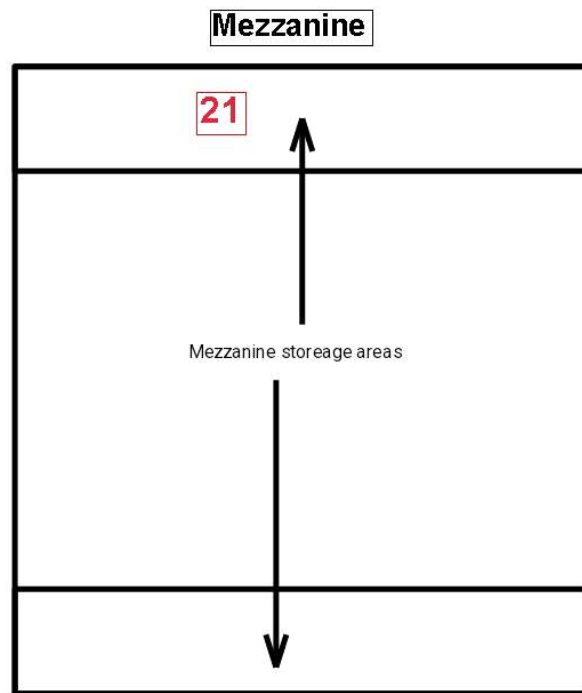

Key
1 Asbestos identified