

Arboricultural Survey to BS5837:2012

John Marchesi

**37 Randall Road,
Chandler's Ford,
Eastleigh,
Hants,
S053 5AJ**

05 January 2024

Chris Poplett MArborA

Table of Contents

If this report has been released electronically the appendices referred to herein can be found in the annexed zip folder/s as .pdf files. If this report has been released in hard copy the appendices will be bound into the back of this report. Plans are annexed separately as A0, A1, A2 or A3 as appropriate.

1. Introduction	2
2. Survey	2
3. BS5837:2012 Scope	6
4. Methodology	6
5. Definitions	8
6. Recommendations	9
7. Limitations	9
8. Appendices	10
Appendix 1: Table 1 Cascade chart for tree quality assessment	11
Appendix 2: Schedule of Trees	13
Appendix 3: Tree Constraints Plan	17
9. Document Production Record	19

1. Introduction

Arbtech Consulting Limited (Arbtech) received written instruction on 08 December 2023 from John Marchesi to attend 37 Randall Road, Chandler's Ford Eastleigh, Hants, SO53 5AJ, grid reference; SU 43908 22539 (site) to undertake an arboricultural survey to BS5837:2012 guidance to assess trees, hedges and major shrub groups growing on and within influencing distance of the site and to produce a Schedule of Trees, Tree Constraints Plan.

I am Chris Poplett, an arboricultural Consultant at Arbtech Consulting Ltd. I undertook the tree survey on 21 December 2023 and subsequently have produced this summary of my findings.

Chris Poplett has over 25 years' experience within the arboricultural industry. Qualified to Level 4 Dip [REDACTED] and has Lantra professional tree inspector certification. Chris Poplett has been awarded [REDACTED] professional membership of the Arboricultural association and is also a certified soil food web laboratory technician.

The advice below and appended is underwritten by our Professional Indemnity insurance for the business practice of Arboricultural Consultancy in the sum of one million Pounds Sterling in each and every year.

Table 1: Documents referred to.

Document	Reference No.
Survey base drawing	N/A
LPA pre-app comments	N/A
British Standard 5837:2012	"BS5837"
Tree Survey Schedule	Arbtech TS 01
Tree Constraints Plan	Arbtech TCP 01

2. Survey

Survey: An arboricultural survey to BS5837 of all trees within impacting distance of the site was undertaken by Chris Poplett on 21 December 2024.

During the survey I categorised the trees using "Table 1 – Cascade chart for tree quality assessment" of the BS5837:2012 (see Appendix 1).

A total of eleven (11) individual trees, two (2) groups of trees and two (2) hedges were surveyed. Details for each of the trees surveyed are provided in the Schedule of Trees (see Appendix 2).

Table 2: Documents upon which this tree survey has been based.

Document	Originator	Reference Number	Title
Survey Base Drawing	Andrew Johns Design	N/A	Site plan for trees

Limitations: The survey was made at ground level using visual observation only. Detailed examinations, such as climbing inspections and advanced decay detection equipment were not employed, though may form part of the survey's management recommendations. Measurements were taken using specialist tapes, laser, and GPS devices. Where this was not possible, measurements are estimated.

Scope: Pre-development tree surveys make arboricultural management recommendations based exclusively upon the individual tree or group of trees condition relative to their present context (*i.e. not in relation to the proposed development*).

Legal Status: No statutory protection check has been performed. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order ("TPO"), and those trees without. This is principally because a detailed planning consent overrides any TPO protection. Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.

* For more information on the surveyed trees please see Arbtech Consulting Ltd, Tree Survey Schedule (Appendix 1), Tree Survey Report and Tree Constraints Plan.

Site description

Split level detached private domestic property with off-street parking. Landscaped garden to the rear adjoining neighbouring properties.

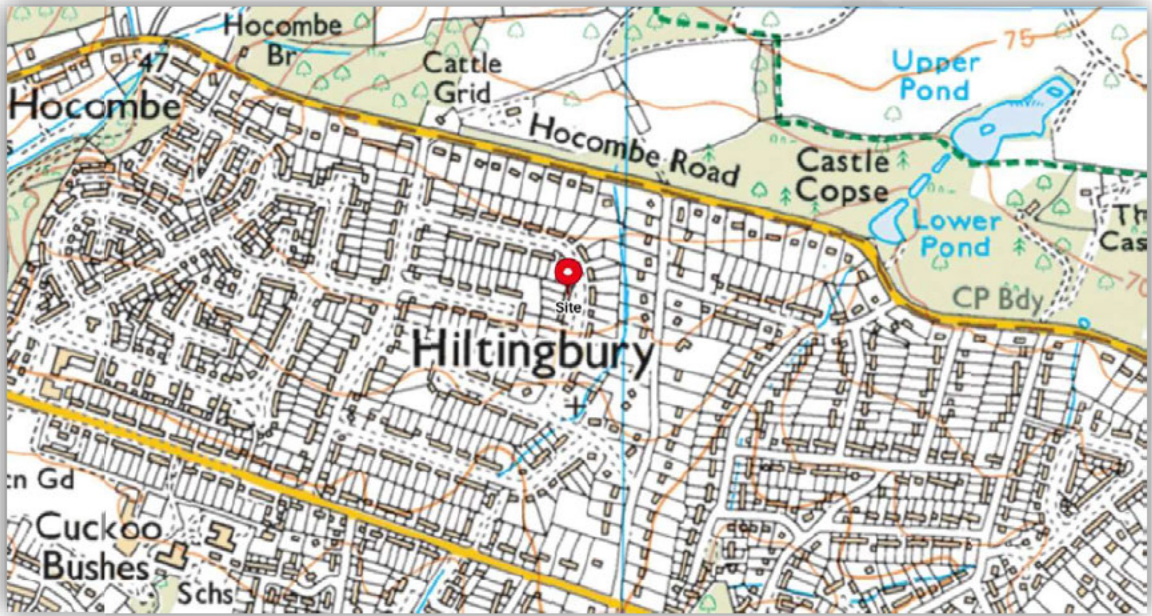


Figure 1: OS Map showing site location (Bing Maps)



Figure 2: Aerial Image of site with approximate red line boundary (Google Earth)

Proposed scheme

Single story rear extension.

The proposed scheme is to demolish the existing conservatory and replace with a single story extension.

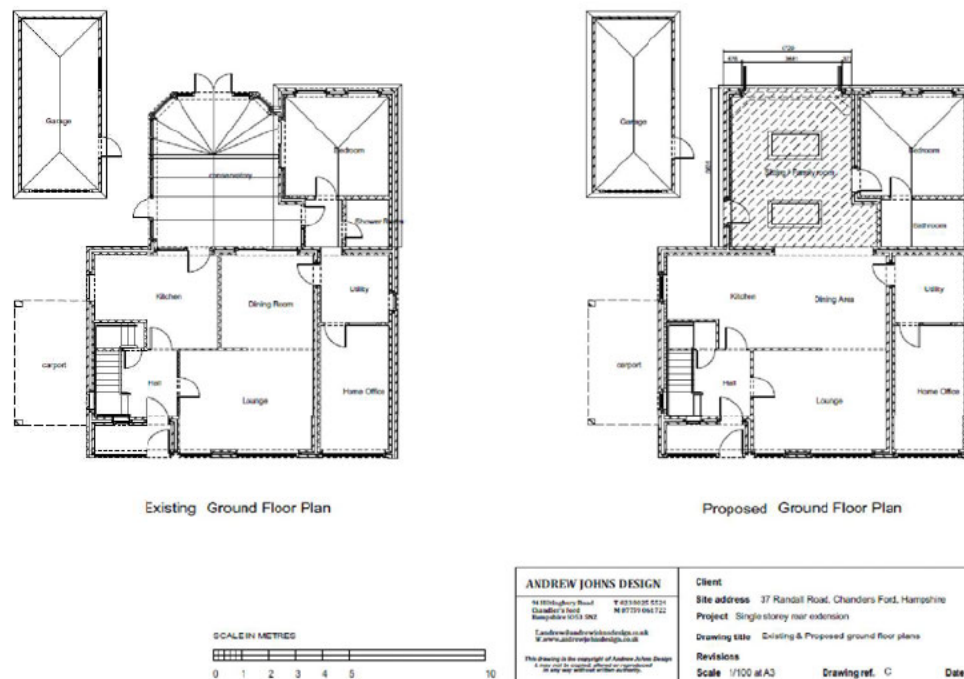


Figure 3: Existing and proposed ground floor plans. Drawing ref; C (Andrew Johns Design).

It is likely that arboricultural impacts can be addressed with arboricultural methodology or minor amendments to the proposal.

This content is for educational and informative purposes; parts of it are reproduced with the kind permission of BSI Global.

3. BS5837:2012 Scope

This standard recognises that there can be problems for development close to existing trees which are to be retained, and of planting trees close to existing structures. This standard sets out to assist those concerned with trees, in relation to construction, to form balanced judgements. It does not set out to put arguments for or against development, or for the removal or retention of trees. Where development, including demolition, is to occur, the standard provides guidance on how to decide which trees are appropriate for retention, on the means of protecting these trees during development, including demolition and construction work, and on the means of incorporating trees into the developed landscape.

4. Methodology

The methodology used to assess the trees was the British Standard 5837:2012 'Trees in Relation to Construction' tree survey method. The aim of the survey is to establish which trees are **moderate** and good quality; suitable for retention and justifying protection. And which trees are low or poor quality; either undesirable or unsuitable to retain and protect.

The tree survey includes all trees included in the land survey red line boundary plan, as well as any that may have been missed, and it should categorize trees or groups of trees, including woodlands for their quality and value within the existing context, in a transparent, understandable, and systematic way. Where the arboriculturist has deemed it appropriate, the trees have been tagged with small metal or plastic tags, placed as high as is convenient on the stem of each tree.

Whilst master plan proposals for the development of the site might be available, the trees have been surveyed without taking these into consideration. All detailed design work on site layout should take into consideration the results of the tree survey (and the TCP).

Trees forming groups and areas of woodland (including orchards, wood pasture and historic parkland) are identified and considered as groups where the arboriculturist has determined that this is appropriate, particularly where they contain a variety of species and age classes that could aid long-term management. It is often expedient to assess the quality and value of such groups of trees as a whole, rather than as individuals. However, an assessment of individuals within any group has been undertaken if they are open-grown or if there is a need to differentiate between them.

The quality and value of each tree or group of trees has been recorded by allocating it to one of the four categories: **A**, **B**, **C**, or **U** (highest to lowest quality respectively). The categories are differentiated on the tree survey plan by colour, or by suffixing the category adjacent to the tree identification number on the TCP.

The survey schedule lists all the trees or groups of trees. The following information is also provided:

- a) reference number (to be recorded on the tree survey plan);
- b) species (common or scientific names);
- c) height in meters (m);
- d) stem diameter in millimetres (mm) at 1.5m above adjacent ground level or immediately above the root flare for multi-stemmed trees;
- e) branch spread in meters taken at the four cardinal compass points;
- f) height of crown clearance above adjacent ground level in meters (m);
- g) age class (newly planted, young, semi-mature, early mature, mature, over mature);
- h) physiological condition (e.g. good, fair, poor, decline and dead);
- i) structural condition (e.g. good, fair, poor or not visible);
- j) comment about the tree, its location and preliminary management recommendations, including further investigation of suspected defects that require more detailed assessment and potential for wildlife habitat;
- k) The [REDACTED] category referring to the quality and useful contribution in years; **U** = <10yrs; **A** = >40yrs; **B** = >20yrs; **C** = >10yrs. The retention subcategory referring to the type of amenity; 1 = Arboricultural; 2 = Landscape; 3 = Cultural including conservation (see Appendix 1 Cascade chart for tree quality assessment).

5. Definitions

Arboriculturist

An arboriculturist (or arboricultural consultant) is a person who has, through relevant education, training, and experience, gained recognized qualifications and expertise in the field of trees in relation to construction.

Tree Survey

A tree survey should be undertaken by an arboriculturist and should record information about the trees on a site independently of and prior to any specific design for development. As a subsequent task, and with reference to a design or potential design, the results of the survey should be used in the preparation of a tree constraints plan, which should be used to assist with layout design.

Tree Constraints Plan

A TCP is typically delivered as an AutoCAD drawing (.DWG file format), prepared by an arboriculturist for the purposes of layout design showing the root protection area and representing the effect that the mature height and spread of retained trees will have on layouts through shade, dominance, etc.

Root Protection Area

An RPA is a layout design tool indicating the area surrounding a tree that contains sufficient rooting volume to ensure the survival of the tree, shown in plan form in m².

Construction Exclusion Zone (also termed Tree Protection Zone)

A construction exclusion or tree protection zone is an area based on the RPA (in m²), identified by an arboriculturist, to be protected during development, including demolition and construction work, by the use of barriers and/or ground protection fit for purpose to ensure the successful long-term retention of a tree.

Arboricultural Impact Assessment (AIA)

This is a study, undertaken by an arboriculturist, to identify, evaluate and possibly mitigate the extent of direct and indirect impacts on existing trees that may arise as a result of the implementation of any site layout proposal.

Tree Protection Plan (TPP)

A TPP is plan, typically delivered as an AutoCAD drawing (.DWG file format), prepared by an arboriculturist showing the finalized layout proposals, tree retention and tree and landscape protection measures detailed within the arboricultural method statement, which can be shown graphically.

Arboricultural Method Statement (AMS)

This is a methodology for the implementation of any aspect of development that has the potential to result in loss of or damage to a tree. The AMS is likely to include details of an on-site tree protection monitoring regime.

6. Recommendations

With the benefit of making an assessment of your planning proposals, I make the following recommendation to ensure that there are no irrevocable issues to the proposed retained trees and so that no conditions relating to arboriculture are attached to any planning consent secured; obtain an arboricultural report to include:

- a) An arboricultural impact assessment (AIA).
- b) An arboricultural method statement (AMS).
- c) A tree protection plan drawing (TPP).

7. Limitations

Trees were [REDACTED] from using visual observation from ground level only. Trees were not climbed or inspected below ground level. Inaccessible trees will have best estimates made about the location, physical dimensions, and characteristics. Trees have been grouped where BS5837 [REDACTED] us that it is expedient to do so. Trees have been excluded from the survey if they are found by us to be sufficiently far away from the proposed developable area or if they are outside of the red line boundary plan showing the expectations of our client for the extent of the survey. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order (“TPO”), and those trees without. This is principally because a detailed planning consent overrides any TPO protection. Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.


8. Appendices

The following documents were released to the Client as appendices to this report:

- Survey Schedule (.PDF)
- Tree Constraints Plan drawing (.DWG & .PDF)

If you require clarification of information contained herein, please do not hesitate to contact us via 01244 661170.

Yours Sincerely,



Chris Poplett MArborA
Arboricultural Consultant



chrispoplett@arbtech.co.uk



Appendix 1: Table 1 Cascade chart for tree quality assessment

BS5837:2012 Trees in relation to design, demolition and construction – Recommendations


Table 1 Cascade chart for tree quality assessment

Category and definition	Criteria (including subcategories when appropriate)	Identification on plan		
Trees unsuitable for retention (see Note)				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.	▪Trees that have serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning). ▪Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. ▪Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality. <i>NOTE Category U trees can have existing or potential conservation value which might be desirable to preserve; see 4.5.7.</i>			Dark red
1. Mainly arboricultural qualities 2. Mainly landscape qualities 3. Mainly cultural values, including conservation				
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years.	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominate and/or principal trees within an avenue).	Trees, groups, or woodlands of particular visual importance as arboricultural and/or landscape features.	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture).	Light green
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remedial defects, including unsympathetic management and storm damage), such that they are unlikely to be suitable for retention of beyond 40 years; or trees lacking the special quality necessary to merit the category 'A' designation.	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality.	Trees with material conservation or other cultural value.	Mid blue
Category C Trees of low quality with an estimated remaining expectancy of at least 10 years, or young trees with a stem diameter below 150mm.	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape value.	Trees with no material conservation or other cultural value.	Grey

This content is for educational and informative purpose and has been reproduced with the kind permission of BSI Global

Arbtech Consulting Limited is registered in England and Wales: 05678552. VAT: GB903660148

Ecology – Protected Species – Licensing – Arboriculture – Biodiversity Net Gain – Land/Topographical Survey

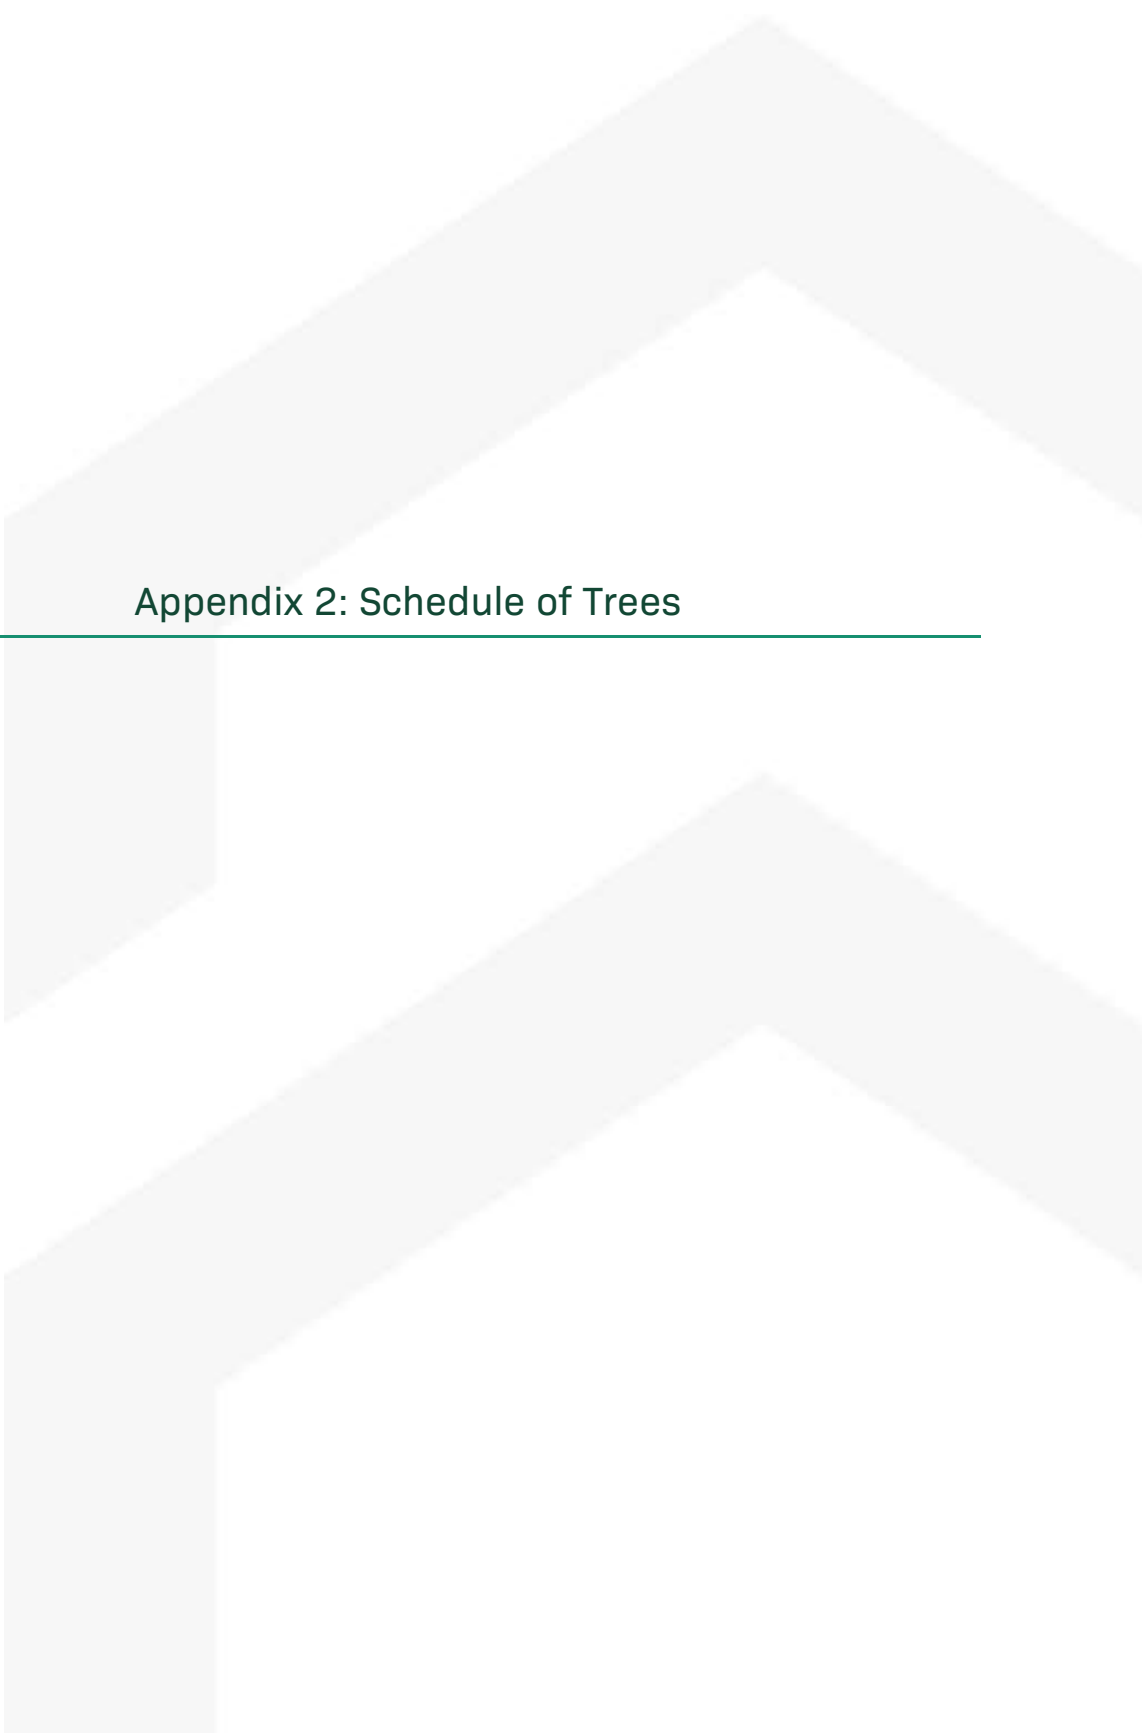
A large, light grey, stylized house icon that serves as a background for the central section of the page. It is composed of several geometric shapes forming a roof and walls.

Appendix 2: Schedule of Trees

BS5837:2012 Tree Survey										Arbtech consulting ltd		
Client: John Marchesi Project: 37 Randall Road Chandler's Ford Eastleigh Hants SO535AJ Survey Date: 21/12/2023 Surveyor: Chris Poppett										Unit 3 Well House Barns Chester Road Chester Cheshire CH4 0DH Phone: 01244661170		
												
Tree and Tag No Species	Hght (m)	Stems		Crown		RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations Survey Comment		Cat ERC	
		No	Ø (mm)	Spread (m)	Clear (m)				Age			
G01												
Silver Birch	17	1	480	N 5	5	5	EM	A: 104.2 R: 5.75	Fair	C: Fair	C.2 10+ yrs Off site group of 3 individual trees. Individual to the western aspect in decline, approximately 20% die back to canopy. Boundary fence obscuring observations of stems and base.	
Betula pendula				E 3	5	5				S: Not visible		
				S 3	5	5				B: Not visible		
				W 3	5	5						
G02												
Silver Birch	17	1	480	N 5	5	5	EM	A: 104.2 R: 5.75	Good	C: Good	B.2 20+ yrs Off site group of 4 individual trees. Boundary fence obscuring observations of stems and base.	
Betula pendula				E 3	5	5				S: Not visible		
				S 3	5	5				B: Not visible		
				W 3	5	5						
H01												
Lawson Cypress	5	1	200	N 1	1	2	EM	A: 18.1 R: 2.4	Good	C: Good	C.2 10+ yrs Off site hedge maintained to current dimensions. Boundary fence obscuring observations of stems and base. Approximately 8 individual stems to the group.	
Chamaecyparis lawsoniana				E 1	2	2				S: Not visible		
				S 1	1	1				B: Not visible		
				W 1	1	1						
H02												
Common Beech	3	1	80	N 0.5	0	0	EM	A: 2.9 R: 0.96	Good	C: Good	C.2 10+ yrs No significant features observed.	
Fagus sylvatica				E 0.5	0	0				S: Good		
				S 0.5	0	0				B: Good		
				W 0.5	0	0						
Age Classifications: N Newly planted Y Young SM Semi-mature EM Early Mature M Mature OM Over Mature												Stems: Ø Diameter (Eq) Equivalent stem diameter using BS5837:2012 definition
Condition: C Crown S Stem B Basal area												ERC: Estimated Remaining Contribution
TreeMinder												03 January 2024

Tree and Tag No		Hght (m)		Stems		Crown			Age	RP	Phys Condition	Structural Condition	Preliminary Recommendations Survey Comment		Cat ERC
Species		No	Ø (mm)	Spread (m)	Clear (m)					A (m²) R (m)					
T01															
Common Oak <i>Quercus robur</i>	19	1	660	N	7	7	M	A: 197.1 R: 7.92	Good	C: Good	No significant features observed.	C: Good S: Good B: Good		B.1	20+ yrs
			E	7	7										
			S	7	7										
			W	7	7										
T02															
Deodar Cedar <i>Cedrus deodara</i>	20	1	480	N	4	5	EM	A: 104.2 R: 5.75	Good	C: Good	Off site tree. Vegetation obscuring observations of stem and base.	S: Not visible B: Not visible		B.1	20+ yrs
			E	4	5										
			S	5	5										
			W	7	5										
T03															
Common Oak <i>Quercus robur</i>	20	1	720	N	5	7	M	A: 234.5 R: 8.63	Fair	C: Fair	Off site tree. Approximately 30% lower than expected crown density. Access to neighbouring property preventing observations of stem and base.	S: Not visible B: Not visible		C.1	10+ yrs
			E	7	7										
			S	7	7										
			W	7	7										
T04															
Common Oak <i>Quercus robur</i>	20	1	720	N	5	7	M	A: 234.5 R: 8.63	Good	C: Good	Naturally occurring dead branches in crown up to 100mm diameter X 3m length.	S: Good B: Good		B.1	20+ yrs
			E	8	7										
			S	7	7										
			W	7	7										
T05															
Common Oak <i>Quercus robur</i>	20	1	620	N	9	5	M	A: 173.9 R: 7.44	Good	C: Good	Naturally occurring dead branches in crown up to 100mm diameter X 3m length.	S: Good B: Good		B.1	20+ yrs
			E	7	5										
			S	3	5										
			W	6	5										
T06															
Silver Birch <i>Betula pendula</i>	15	1	580	N	5	4	M	A: 152.2 R: 6.96	Good	C: Good	Off site tree maintained to current dimensions. Boundary fence obscuring observations of stem and base.	S: Not visible B: Not visible		B.1	20+ yrs
			E	7	4										
			S	5	4										
			W	5	4										
Age Classifications:		N	Newly planted	EM	Early Mature	Condition:			C	Crown	Stems:		Ø	Diameter	
	Y	Young	M	Mature				S	Stem	(Eq)		Equivalent stem diameter using BS5837:2012 definition			
	SM	Semi-mature	OM	Over Mature				B	Basal area	ERC:		Estimated Remaining Contribution			

Tree and Tag No Species		Hght (m)		Stems		Crown			Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations Survey Comment	Cat ERC
No	Ø (mm)	Spread (m)	Clear (m)											
T07														
Common Oak <i>Quercus robur</i>	17	1	650	N	6	5	M	A: 191.2 R: 7.8	Fair	C: Fair	Die back to outer canopy, 1m length dead branch stubs to outer crown. Epicormic regrowth along length of branches and main stem. Hollowing detected with nylon hammer from ground level up to 1.5m to western aspect.	C: Fair S: Fair B: Good		C.1 10+ yrs
			E	4.5	5									
			S	6	5									
			W	5	5									
T08														
Silver Birch <i>Betula pendula</i>	16	1	440	N	5	4	M	A: 87.6 R: 5.28	Poor	C: Poor	Canopy showing approximately 30% depletion of crown density. Dead branches to west approximately 50mm diameter X 3m length.	S: Good B: Good		U <10 yrs
			E	9	4									
			S	9	4									
			W	4.5	4									
T09														
Silver Birch <i>Betula pendula</i>	17	1	460	N	2	4	M	A: 95.7 R: 5.51	Good	C: Good	Asymmetrical crown shape due to proximity of partner tree.	S: Good B: Good		B.1 20+ yrs
			E	7	4									
			S	6	4									
			W	5	4									
T10														
Silver Birch <i>Betula pendula</i>	17	1	460	N	7	4	M	A: 95.7 R: 5.51	Good	C: Good	Off site tree. Asymmetrical crown shape due to proximity of partner tree. Stem bleed on eastern aspect from ground level up to 300mm.	S: Fair B: Good		B.1 20+ yrs
			E	7	4									
			S	2	4									
			W	5	4									
T11														
Lawson Cypress 'Ellwoodii' <i>Chamaecyparis lawsoniana</i> 'Ellwoodii'	7	1	220	N	1	0	SM	A: 21.9 R: 2.64	Good	C: Good	Densely foliated throughout.	S: Not visible B: Not visible		B.1 20+ yrs
			E	1	0									
			S	1	0									
			W	1	0									
Age Classifications: N Newly planted EM Early Mature Y Young M Mature SM Semi-mature OM Over Mature														
Condition: C Crown S Stem B Basal area														
Stems: Ø Diameter (Eq) Equivalent stem diameter using BS5837:2012 definition ERC: Estimated Remaining Contribution														

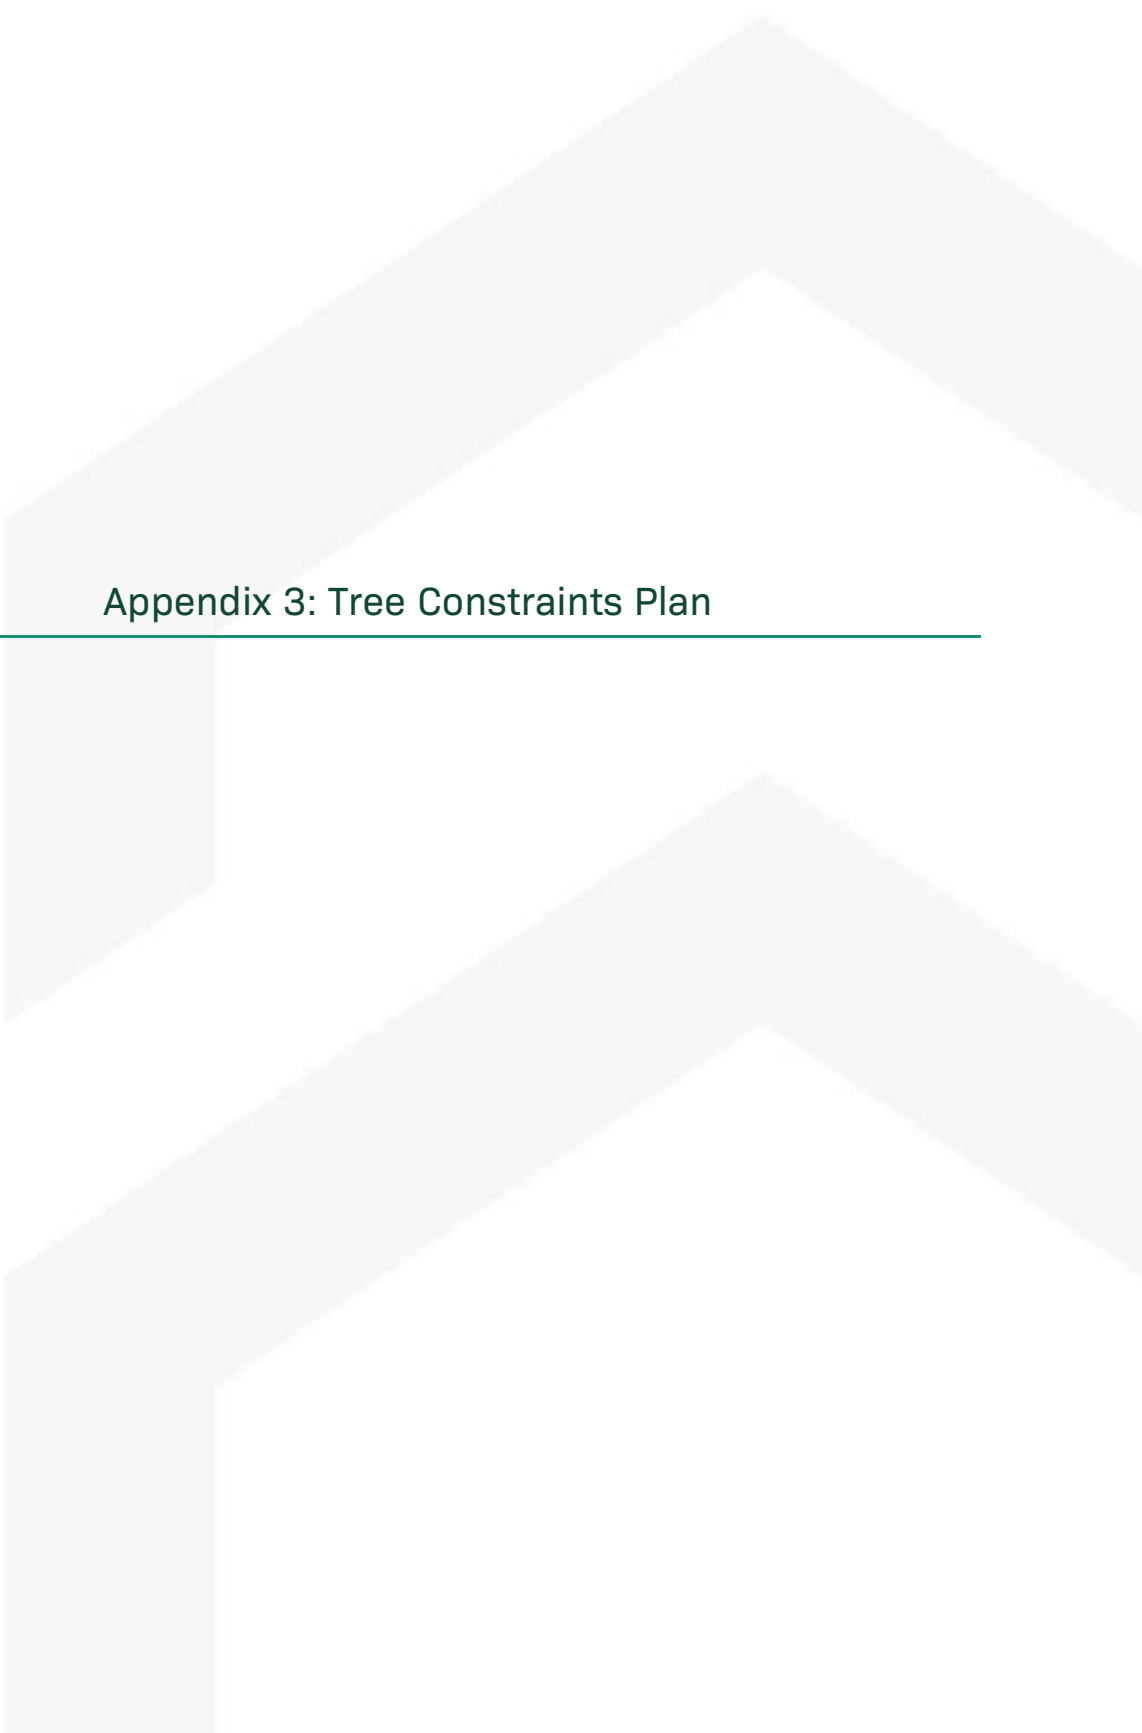A large, light grey, stylized house icon that serves as a background for the central section of the page. It is composed of several geometric shapes forming a roof and walls.

Appendix 3: Tree Constraints Plan

9. Document Production Record

Document number	Editor	Signature	Position	Issue number	Date
Arbtech TSR 01	Chris Poplett	<i>C Poplett</i>	Arboricultural Consultant	01	05/01/24

Limitations

Arbtech Consulting Ltd has prepared this report for the sole use of the above-named Client/Agent in accordance with our terms of business, under which our services were performed. No other warranty, expressed or implied, is made as to the professional advice included in this report or any other services provided by us. This report may not be relied upon by any other party without the prior and express written agreement of Arbtech Consulting Ltd. The assessments made assume that the sites and facilities will continue to be used for their current purpose without significant change. The conclusions and recommendations contained in this report are based upon information provided by others and upon the assumption that all relevant information has been provided by those parties from whom it has been requested. Information obtained from third parties has not been independently verified by Arbtech Consulting Ltd.

Copyright

© This Report is the copyright of Arbtech Consulting Ltd. Any unauthorised reproduction or usage by any person other than the addressee is strictly prohibited.