

Monitoring Details:

Crack and Level Monitoring

Provider Name: My Home Needs

Monitoring Interval: Every 6 weeks

Instruction Date: 15/01/2024

Number of Visits: 12

Reading Date: 14/01/2025

Visits Completed: 9

Date of Issue: 15/01/2025

Visits Outstanding: 3

Client Details:

Client: Sedgwick

Engineer / Handler: -

Job Reference: 9678684


Monitored Address:

Address: 6 Keble Close, Chandler's Ford, Eastleigh, Hampshire, SO53 3AN

Front Elevation



Site Plan

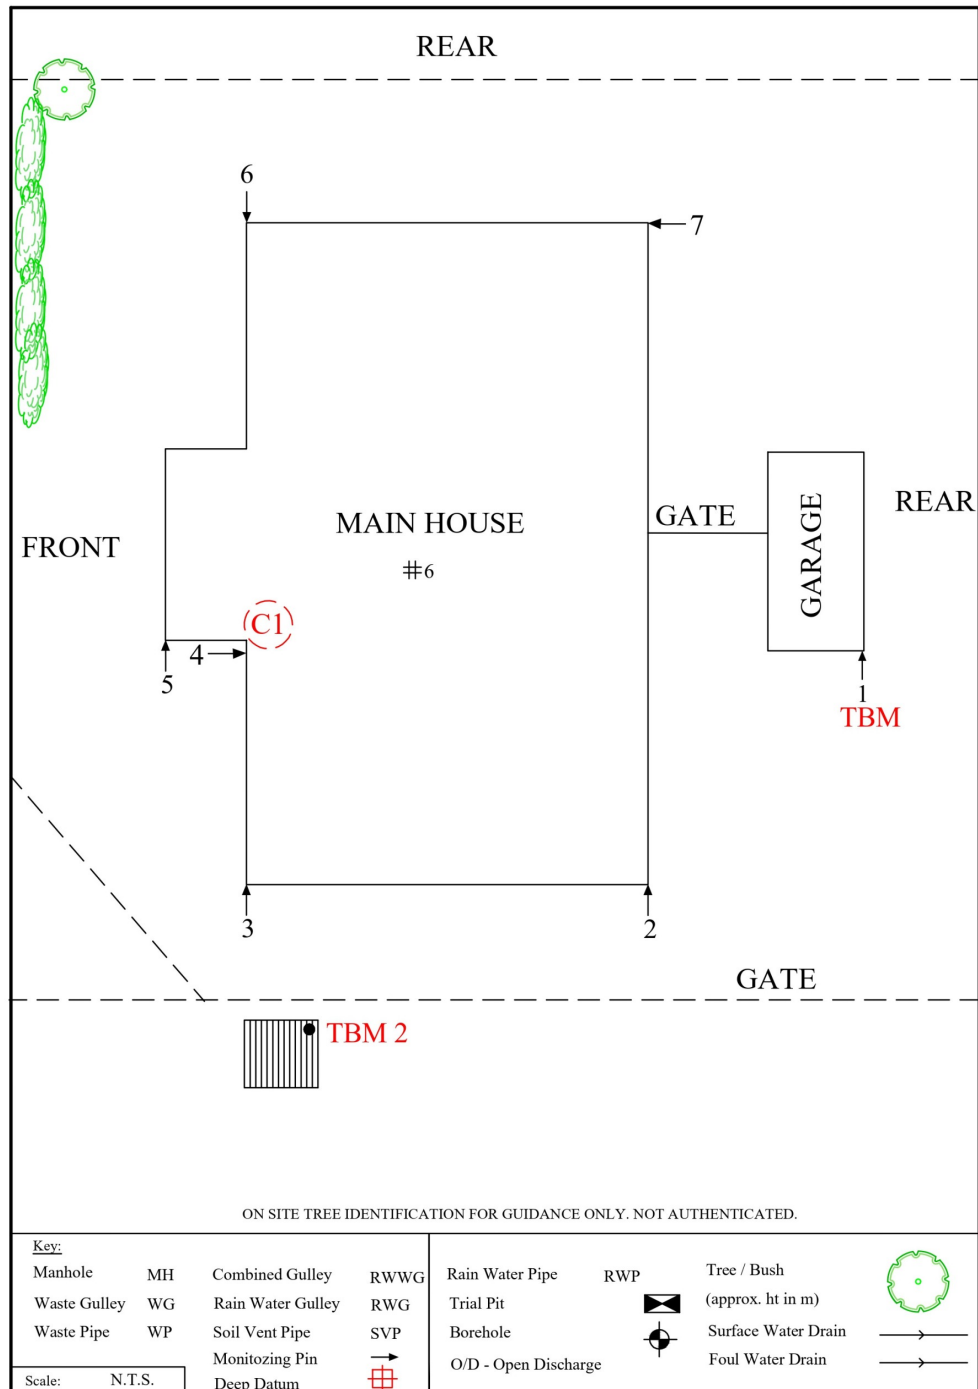

Visit Notes

Visit	Surveyors Note
Visit 5	After a full audit we noticed the C reading was inputted wrong at the previous visit and should be 78.91 not 76.91
Visit 7	D/C has not been taken due to it being unstable

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	09/02/24	19/03/24	02/05/24	10/06/24	15/07/24	27/08/24	17/10/24	25/11/24
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000
2	9.3642	9.3634	9.3632	9.3641	9.3649	9.3649	9.3634	9.3640
3	9.5533	9.5535	9.5528	9.5533	9.5532	9.5538	9.5524	9.5529
4	9.6710	9.6714	9.6709		9.6695	9.6693	9.6684	9.6706
5	9.6707	9.6714	9.6703		9.6690	9.6683	9.6685	9.6703
6	9.5367	9.5381	9.5380	9.5379	9.5361	9.5363	9.5353	9.5371
7	9.3632	9.3644	9.3643	9.3657	9.3642	9.3648	9.3623	9.3638
D/C								
Taken by	WR	WR	JM	JK	JK	JK	KC	PL
Serial number	525106	525106	1211937	524694	524694	524694	1212053	1201050

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	09/02/24	19/03/24	02/05/24	10/06/24	15/07/24	27/08/24	17/10/24	25/11/24
TBM1	0	0	0	0	0	0	0	0
2	0	-0.8	-1	-0.1	+0.7	+0.7	-0.8	-0.2
3	0	+0.2	-0.5	0	-0.1	+0.5	-0.9	-0.4
4	0	+0.4	-0.1		-1.5	-1.7	-2.6	-0.4
5	0	+0.7	-0.4		-1.7	-2.4	-2.2	-0.4
6	0	+1.4	+1.3	+1.2	-0.6	-0.4	-1.4	+0.4
7	0	+1.2	+1.1	+2.5	+1	+1.6	-0.9	+0.6
D/C								

Level Movement (Displayed in Millimeters) - Continuation of readings

Visit Notes

No visit notes have been entered for any visits

Level Readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	14/01/25							
TBM1	10.0000							
2	9.3634							
3	9.5520							
4	9.6696							
5	9.6694							
6	9.5361							
7	9.3631							
D/C								
Taken by	PL							
Serial number	1201050							

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	14/01/25							
TBM1	0							
2	-0.8							
3	-1.3							
4	-1.4							
5	-1.3							
6	-0.6							
7	-0.1							
D/C								


Level Readings - Continuation of levels

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	14/01/25							
D/C	9.6639							
Taken by	PL							
Serial number	1201050							

Level Movement (Displayed in Millimeters) - Continuation of readings

[illegible]

Level Readings Chart (Points TBM 1 - D/C)

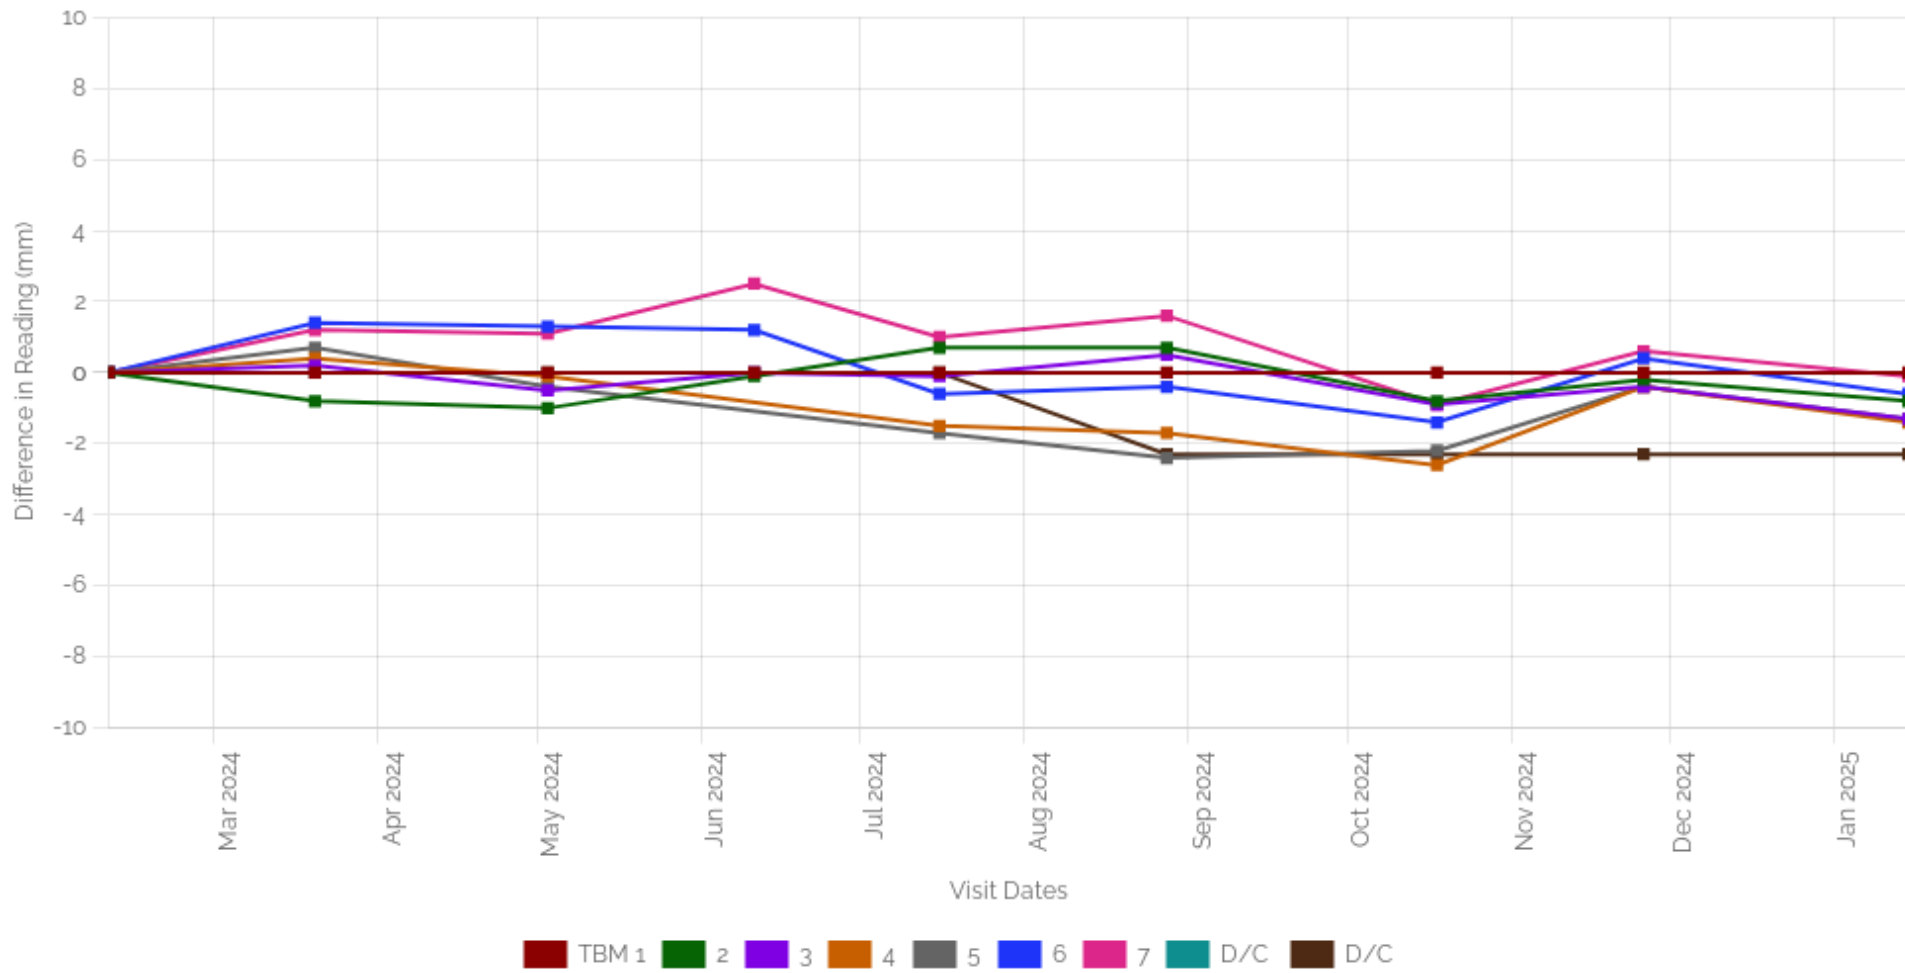

Crack Monitoring

Internal RHS of hallway, bottom of stairs

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	09/02/24	19/03/24	02/05/24	10/06/24	15/07/24	27/08/24	17/10/24	25/11/24
H	52.19	52.02	52.11	51.5	51.61	51.81	51.9	51.93
V	56.41	56.42	56.5	56.01	56.14	56.15	56.41	56.34
C	78.7	78.6	78.62	78.71	78.73	78.79	78.73	78.6
Taken by	WR	WR	JM	N/A	N/A	N/A	KC	PL
Callipers	9121	9121	148	9121	9121	9121	1	128

Internal RHS of hallway, bottom of stairs - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	09/02/24	19/03/24	02/05/24	10/06/24	15/07/24	27/08/24	17/10/24	25/11/24
H	0	-0.17	-0.08	-0.69	-0.58	-0.38	-0.29	-0.26
V	0	0.01	0.09	-0.4	-0.27	-0.26	0.01	-0.07
C	0	-0.1	-0.08	0.01	0.03	0.09	0.03	-0.11


Crack Monitoring

Internal RHS of hallway, bottom of stairs

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	14/01/25							
H	51.93							
V	55.44							
C	78.59							
Taken by	PL							
Callipers	128							

Internal RHS of hallway, bottom of stairs - Crack Readings Differences (Displayed in Millimetres)

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	14/01/25							
H	-0.26							
V	-0.97							
C	-0.12							

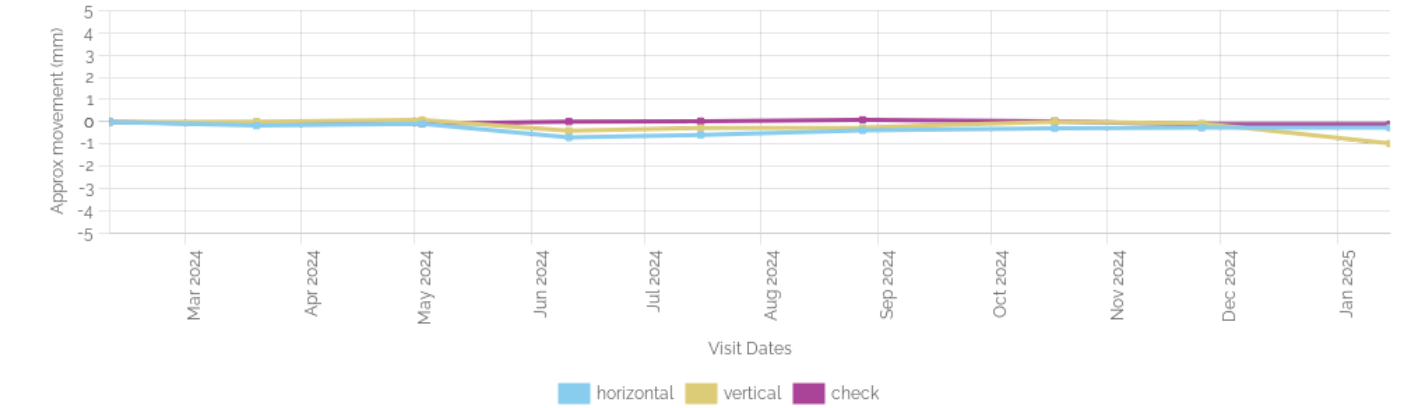

Internal RHS of hallway, bottom of stairs - Visit #1



Internal RHS of hallway, bottom of stairs - Visit #9

