

Appendix B: Additional PIA Location Details and Data

To Hampshire County Council (HCC); Eastleigh
Borough Council (EBC)

From Steer

Date 29 October 2025

Project Navigator Quarter, Southampton

Technical Memo

Project No. 24733101

Additional Personal Injury Collision (PIC) Analysis

Introduction

1. This Technical Memo has been prepared in response to HCC comments received regarding the Navigator Quarter planning application, specifically regarding the Personal Injury Collision (PIC) data presented within the submitted Transport Assessment for planning (June 2025).

Additional geographical detail on PIC locations summarised in the TA

2. HCC requested further detail to be provided on the exact locations of PICs described within the TA (June 2025) for extra clarity. This is summarised in the following section.

Key:

- As originally described within the Steer TA
- New description to provide further clarity on location

Eastleigh Area

A335

- Between Wide Lane and Stoneham Interchange.

A335 / Wide Lane Roundabout

- On the A335/ Wide Lane Roundabout

Bishopstoke Road

- Bishopstoke Road between the A335/ Twyford Road/ Station Hill Roundabout and the Esso Garage on Bishopstoke Road

Bishopstoke Road / Station Hill

- Station Hill at the Bishopstoke Road south-west slip junction

Chestnut Avenue

- Chestnut Avenue/ Doncaster Road junction

Derby Road / High Street

- At Derby Road / High Street junction

Doncaster Road

- A335 between Derby Road and Cherbourg Road

Leigh Road / Upper Market Street

- At Leigh Road / Upper Market junction

Market Street

- Market Street circa. 75m north of the junction with Wells Place

Market Street / Grantham Road

- At Market Street / Grantham Road junction

Romsey Road

- Romsey Road circa. 50m east of A335/ Twyford Road/ Station Hill Roundabout

A335 Southampton Road

- Southampton Road between Leigh Road and Cherbourg Road

Southampton Road / Blenheim Road

- Southampton Road/ Blenheim Road Roundabout

Southampton Road / Chestnut Avenue

- At Southampton Road / Chestnut Avenue junction

Southampton Road / Derby Road

- At the Southampton Road / Derby Road junction

Southampton Road / Derby Road

- Southampton Road circa. 35m north of the junction with Derby Road

Spitfire Roundabout

- Spitfire Roundabout

Station Hill

- Station Hill, circa 55m to the south of the Station Hill / A335 / Twyford Road Roundabout.

Station Hill / Leigh Road

- At Station Hill / Leigh Road junction

Stoneham Lane

- Stoneham Lane, circa. 170m south of Silverlake Stadium access

Stoneham Way A335

- Stoneham Way A335 circa. 80m south of Stoneham Interchange

Twyford Road / Romsey Road Roundabout

- Station Hill / A335 / Twyford Road Roundabout

Twyford Road / The Crescent

- At Twyford Road / The Crescent junction

Wells Place / Market Street

- At Wells Place / Market Street junction

Wells Place / Mitchell Road

- At Wells Place / Mitchell Road junction

Wide Lane

- Wide Lane between Doncaster Grove and Spitfire Road

Wide Lane / South Street

- At Wide Lane / South Street junction

M27

- M27 between circa. 170m west of Junction 5 and circa 250m east of the junction. This includes both on-slips, off-slips and the mainline in both directions.

Stoneham Interchange

Stoneham Interchange – Roundabout

- Stoneham Interchange circulation

Stoneham Interchange (Stoneham Lane Arm)

- Junction of Stoneham Interchange circulation and Stoneham Lane (southbound)

Stoneham Interchange (Stoneham Way Arm)

- Junction of Stoneham Interchange circulation and Stoneham Way (in both directions)

Stoneham Interchange (M27 WB On Slip)

- M27 westbound on slip

Stoneham Interchange (M27 WB Off Slip)

- M27 westbound off-slip

Southampton Area

Stoneham Way / Wide Lane

- At Stoneham Way / Wide Lane junction

Wide Lane / Mansbridge Road

- Within circa. 100m of Wide Lane / Mansbridge Road Roundabout

Wide Lane / Wessex Lane

- At Wide Lane / Wessex Lane junction

M27 J5 / Stoneham Way Interchange

- Stoneham Interchange between the M27 EB off slip, circa 125m south of the Stoneham Interchange on the A335 Stoneham Way and the M27 EB on slip

Wide Lane

- Wide Lane between Spitfire Roundabout and Mardon Close

Further road safety analysis of specific highway sections


3. A further assessment of the collisions recorded along the following three specific links has been undertaken to ascertain whether there are any notable clusters of incidents with similar causes:

- Northbound A335 at M27 Junction 5;
- Station Hill / Twyford Road/ Romsey Road Roundabout; and
- A335 between A27 and Eastleigh Station.

M27 Junction 5

4. The initial analysis showed a cluster of incidents at the junction between the A335 Northbound and the roundabout forming the M27 Junction 5. These incidents, alongside a summary of their causes (extracted from Hampshire Constabulary data) is shown in **Figure 1**.

Figure 1: M27 Junction 5 PIC Analysis

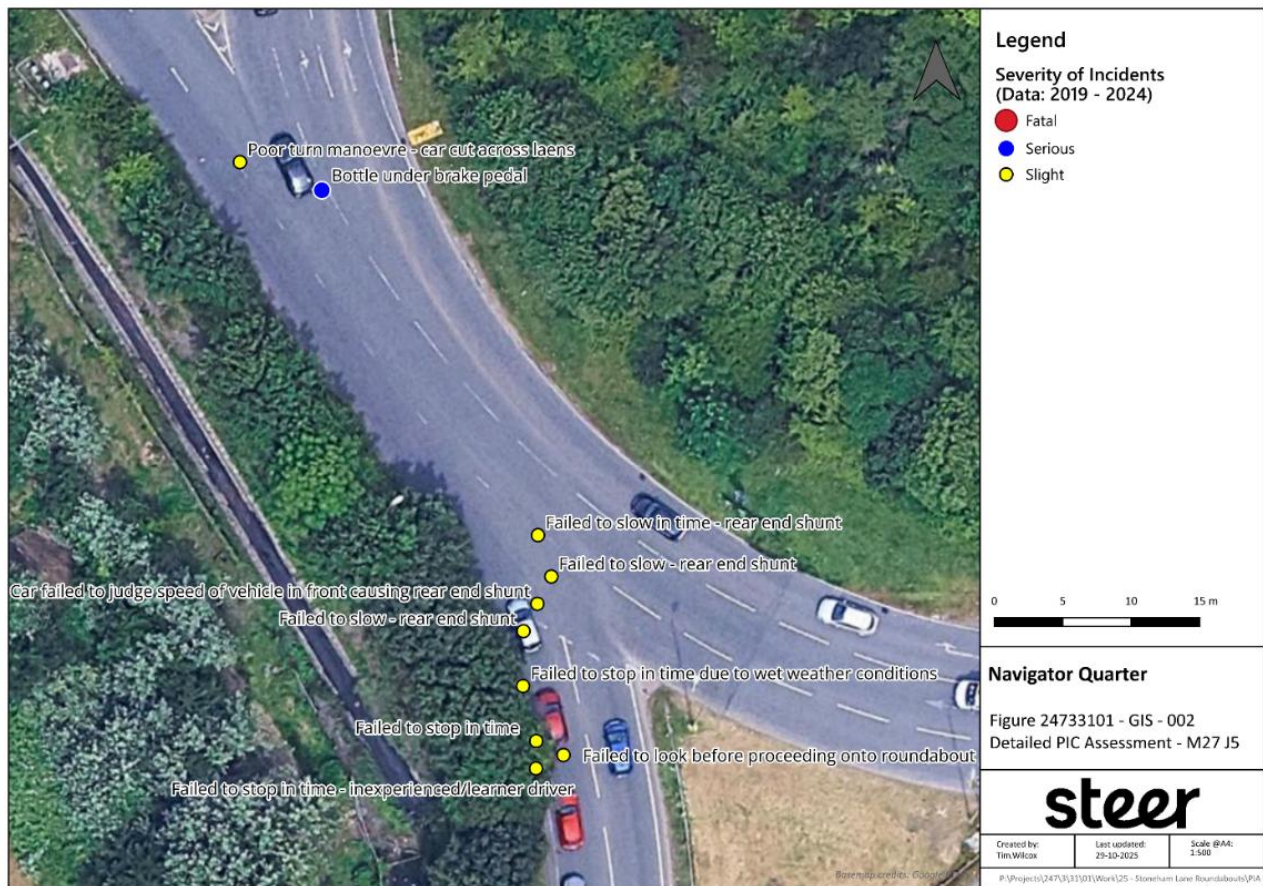

5. As can be seen in the above, there is a cluster of eight incidents which were all recorded as 'slight'. Whilst one of these is attributed to poor road conditions, the other incidents are all related to vehicles failing to slow and stop in time, and resultant rear end shunting cars in front.

Station Hill / Twyford Road/ Romsey Road Roundabout

6. Whilst a cluster was not identified at this roundabout at the northern extent of the study area, two incidents in particular warranted additional analysis; one classified as 'serious', and one classified as 'fatal'. These are shown in relation to the roundabout in **Figure 2**.

Legend

Severity of Incidents (Data: 2019 - 2024)

- Fatal
- Serious
- Slight

0 10 20 30 m

Navigator Quarter

Figure 24733101 - GIS - 003
Detailed PIC Assessment - A335 RBT

steer

Created by: Tim Wilcox
Last updated: 29-10-2025
Scale @A4: 1:1,000


P:\Projects\2473\31\01\Work\25 - Stoneham Lane Roundabouts

- ### A335 between A27 and Eastleigh Station

- 5 of 9
www.steergroup.com

A335 / Leigh Road Junction

Figure 3: A335 / Leigh Road Junction PIC Analysis

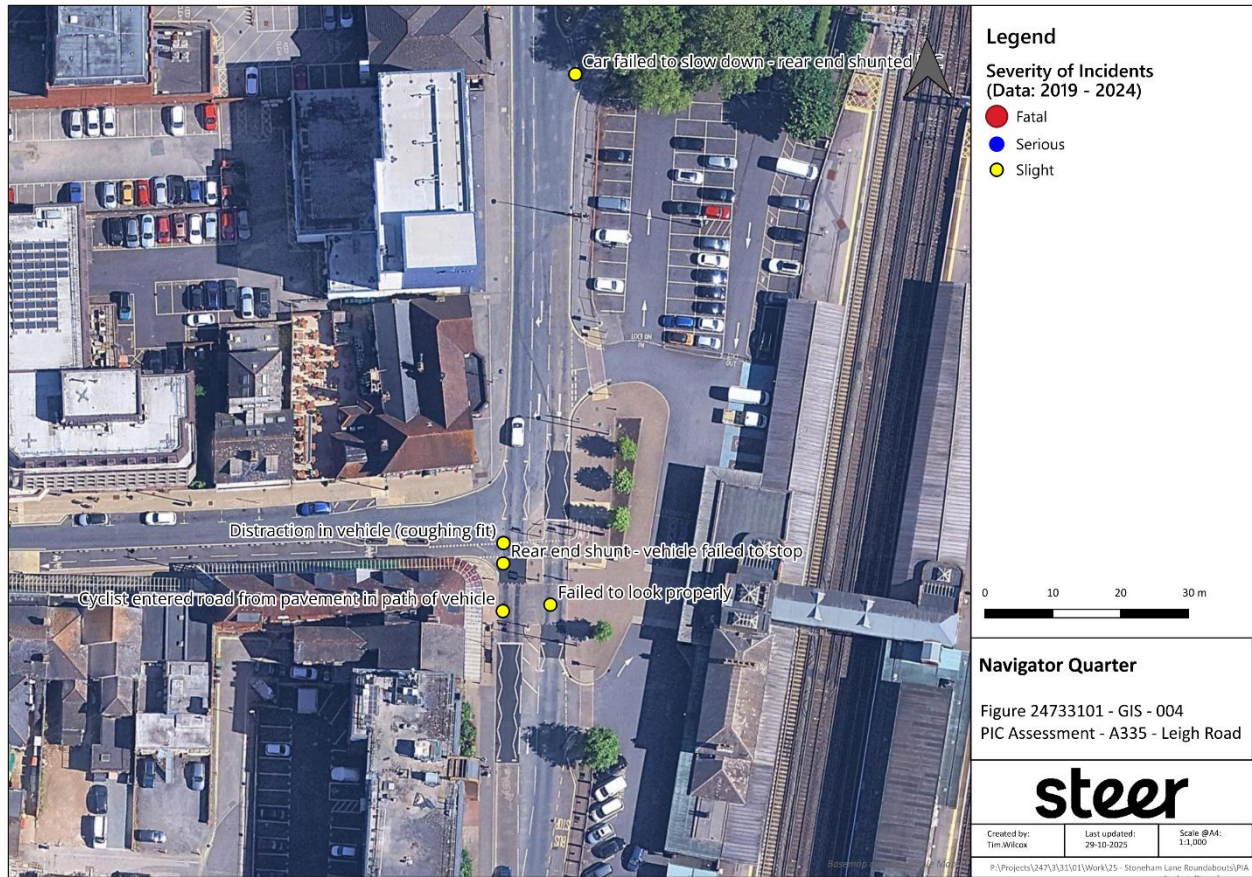

13. The Leigh Road Junction, immediately outside Eastleigh Station, had four incidents (all classified as 'slight') recorded near to it in the study period as shown in **Figure 3**. Each of these had different contributing factors, and therefore it is not believed that there is a tangible link between these incidents representative of a wider highway safety concern.

A335 / Blenheim Road Junction


Figure 4: A335 / Blenheim Road Junction PIC Analysis



14. The Blenheim Road Junction had three incidents (all classified as 'slight') recorded near to or immediately on the roundabout in the study period as shown in **Figure 4**. Each of these had different contributing factors, and therefore it is not believed that there is a tangible link between these incidents representative of a wider highway safety concern.

A335 / Derby Road Junction


Figure 5: A335 / Derby Road Junction PIC Analysis

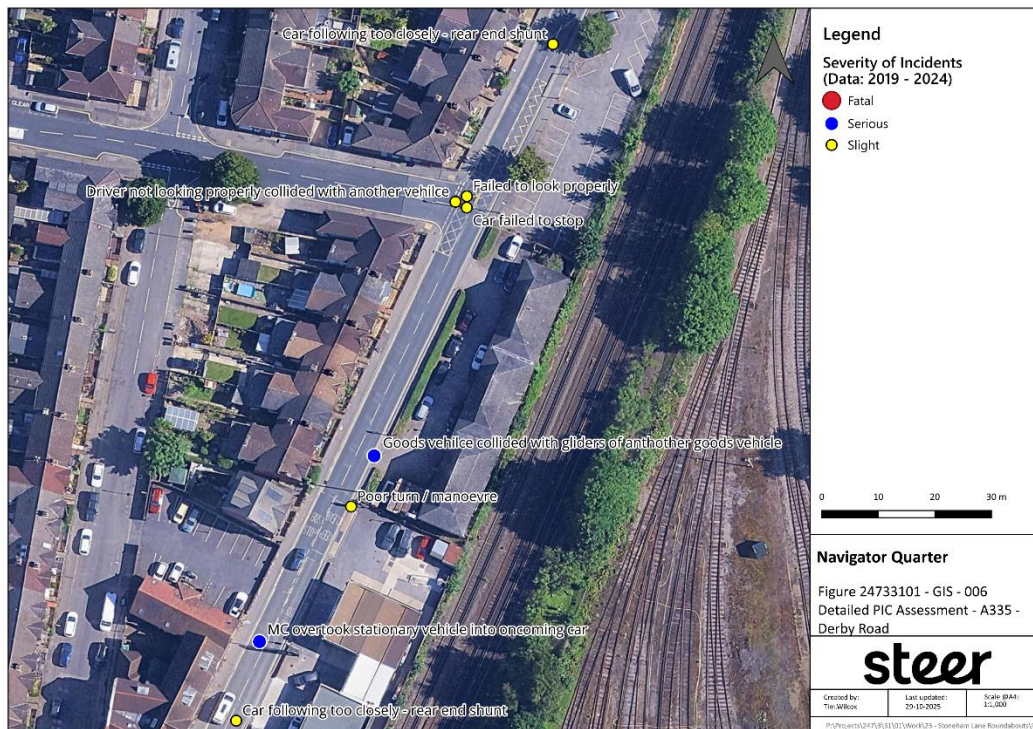

15. The Derby Road Junction and the surrounding elements of the A335 had eight incidents recorded near to it in the study period as shown in **Figure 5**.
16. Three of these occurred at the junction itself, all of which were classified as 'slight', with human error the primary factor identified in each of these incidents.
17. Two incidents near to the junction resulted in incidents were injuries were classified as 'serious'. The first of these occurred at approximately 07:54 in the morning in fine conditions, and involved a southbound HGV impacting the gliders of a parked vehicle. The impact shunted the parked vehicle onto the footway, seriously injuring a pedestrian on the footway.
18. The second incident occurred at approximately 08:02 in the morning in fine but damp conditions, and involved a car waiting to turn right into the service station. A motorcycle attempted to pass the waiting vehicle, and the car did not see the motorcycle and turned into it resulting in the front of the motorcycle colliding with the nearside of the turning car. This resulted in injuries classified as 'serious' to the rider of the motorcycle.
19. Each of these incidents had different contributing factors, and therefore it is not believed that there is a tangible link between these incidents representative of a wider highway safety concern.

A335 Airport Roundabout Junction

Figure 6: A335 Airport Roundabout PIC Analysis

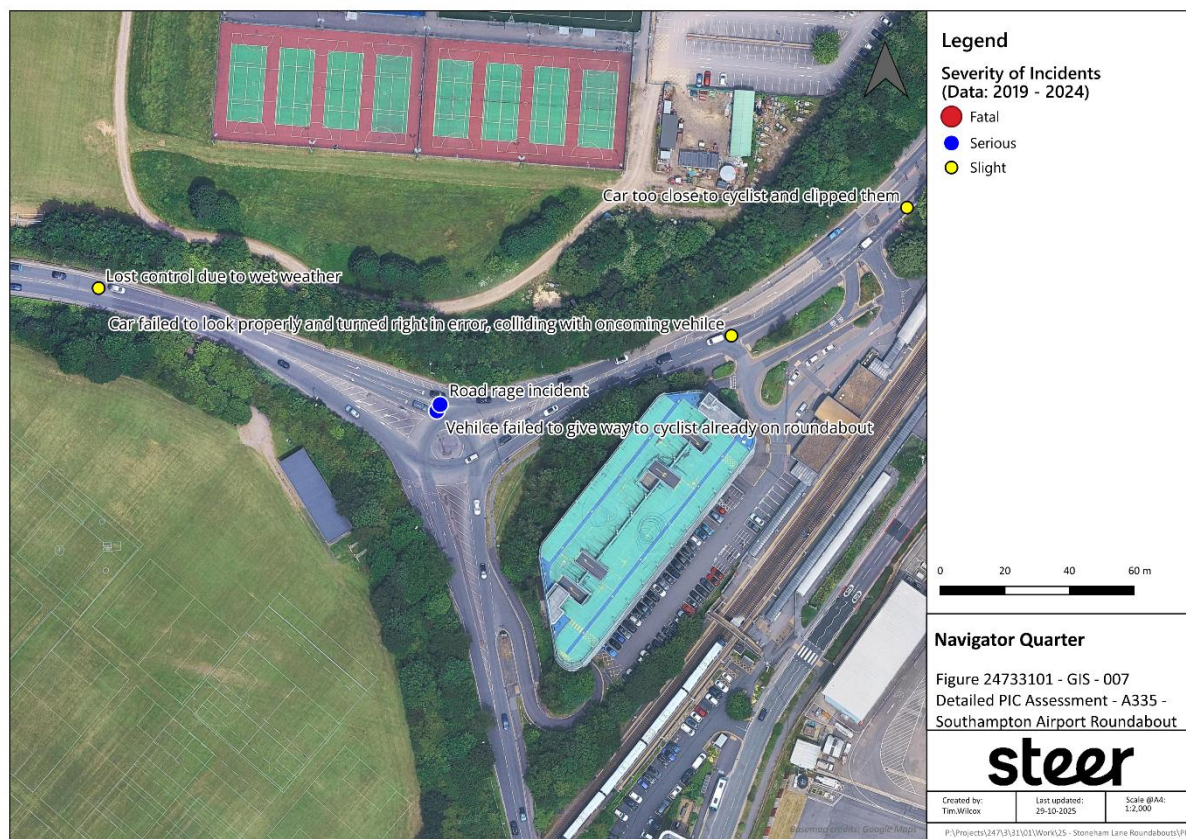


20. The Southampton Airport Roundabout and the immediate surroundings had five incidents recorded near to it in the study period, of which two occurred at the roundabout itself, as shown in **Figure 3**.
21. The two incidents classified as 'serious' both occurred at the entrance point of the western arm onto the roundabout. The first of these was attributed to 'road rage' by the constabulary, and occurred at 11:55 in the morning in fine conditions. A car was waiting in traffic to head to the south-east, when it pulled out around a stationary vehicle to enter the roundabout and collided with a vehicle already on the roundabout. The driver of the second vehicle received injuries classified as 'serious'.

22. The second incident occurred at the same arm but involved a car travelling to the south-east pulling out onto the roundabout in front of a bicycle which was already on the roundabout. The cyclist was unable to stop and impacted the side of the exiting vehicle, resulting in injuries classified as 'serious' to the rider of the bicycle.
23. Whilst both incidents occurred at the same arm of the same roundabout, each incident had vastly different contributing factors, and therefore it is not believed that there is a tangible link between these incidents representative of a wider highway safety concern.

Conclusion

24. Steer has undertaken an assessment of a number of links and junctions near to the Navigator Quarter development which were deemed appropriate due to the presence of either clusters of incidents or incidents resulting in fatalities or injuries classified as 'serious'.
25. The assessment has shown that there are no clusters of incidents where there is currently a highway deficiency causing a notable number of collisions.
26. The Applicant will be providing a contribution towards Sustainable transport improvements/ scheme mitigation, which seeks to address and facilitate north / south movements.
27. The Proposed Development is furthermore making a considerable contribution towards improving conditions for pedestrians and cyclists, including facilitating the Wide Lane Bridge improvements which addresses historic issues associated with the bridge. It is not the role of development to fix and improve all aspects of the local highway, pedestrian and cycle network. Should the identified scheme not be deliverable, then the sustainable transport contribution could be used to deliver wider improvements, such as those identified. However, EBC, HCC and the Applicant will need to agree on reasonable/ balanced contributions and which schemes are prioritised within the Applicant's contribution ceiling and ensure that any contributions are consistent with National Policy.

id	Severity	E	N	Veh	Location	Cause
1	Slight	444208	115944	Car	Mansbridge Road / Wide Lane	Failed to stop in time
2	Slight	444142	115975	Car	Mansbridge Road / Wide Lane	Following too closely and failure to brake in time
3	Slight	444105	116010	Car	Mansbridge Road / Wide Lane	Failed to look properly
4	Serious	444129	116013	Cycle	Mansbridge Road / Wide Lane	Failure to give way
5	Slight	443934	116027	MC	Wide Lane / Stoneham Way	Loss of control
6	Slight	444028	116038	MC	Wide Lane / Wessex Lane	Car ran a red light and went into MC
7	Slight	443956	116066	MC	Wide Lane / Stoneham Way	Slippery Road (due to weather)
8	Slight	443940	116067	Car	Wide Lane / Stoneham Way	Car ran a red light
9	Slight	444211	116104	MC	Wide Lane	Poor turn/manoeuvre and failure to look properly
10	Slight	444244	116156	Cycle	Wide Lane	Failed to look properly
11	Slight	444278	116192	Car	Wide Lane	Failed to look properly
12	Slight	444737	116439	Car	M27 WB	Driver failed to look properly and undertook as poor turn/manoeuvre
13	Serious	444503	116483	MC	Wide Lane	Loss of control (wet road)
14	Serious	444537	116549	Car	Wide Lane	Inexperience with type of vehicle
15	Slight	444670	116550	Car	M27 WB Off-slip	Failed to slow at junction resultin g/r ear end shunt
16	Slight	444596	116637	Car	M27 WB	Failed to look properly when changing lanes
17	Slight	444583	116648	Car	M27 WB	Loss of control
18	Slight	444212	116658	MC	M25 J5 / Stoneham Way	Following too closely
19	Slight	444580	116660	Car	M27 WB	Loss of control
20	Slight	444603	116672	Car	M27 EB On-slip	Car travelling too fast fails to stop - rear end shunt
21	Slight	444708	116708	Cycle	Spitfire roundabout	Car failed to give way
22	Slight	444224	116720	Car	M25 J5 / Stoneham Way	Following too close
23	Slight	444525	116734	Car	M27 EB	Failed to look properly when changing lanes
24	Serious	444261	116762	Car	Stoneham Interchange (Stoneham Way arm)	Poor turn or manoevre / sudden braking / failed to look properly & failed to judge other person speed or path
25	Slight	444268	116767	Car	Stoneham Interchange (Stoneham Way arm)	Car changed lane and collided with rear of vehicle in front (rear end shunt)
26	Slight	444229	116775	Car	Stoneham Interchange (Stoneham Way arm)	Failed to stop in time - inexperienced/learner driver
27	Slight	444231	116776	Car	Stoneham Interchange (Stoneham Way arm)	Driver failed to look before proceeding onto roundabout and pulled out into read of vehicle infront
28	Slight	444229	116777	Car	M25 J5 / Stoneham Way	Failed to stop in time
29	Slight	444228	116781	Car	Stoneham Interchange (Stoneham Way arm)	Failed to stop in time due to failure to judge speed/path and wet weather conditions
30	Slight	444228	116785	Car	Stoneham Interchange (Stoneham Way arm)	Failed to slow - rear end shunt
31	Slight	444415	116786	Car	M27 WB	Goods vehicle changed lane and collided with vehicle in blind spot
32	Slight	444229	116787	Car	Stoneham Interchange (Stoneham Way arm)	Car failed to judge speed of vehicle in front causing rear end shunt
33	Serious	444724	116787	Cycle	Wide Lane	Cyclist clipped railings and went over handlebars
34	Slight	444230	116789	Car	Stoneham Interchange (Stoneham Way arm)	Failed to slow - rear end shunt
35	Slight	444322	116791	Car	M25 J5 / Stoneham Way	Distraction outside vehicle, failed to look properly, failure to judge other persons path/speed and sudden braking
36	Slight	444329	116792	Car	Stoneham Interchange (Stoneham Way arm)	Car failed to slow in time - rear end shunt
37	Slight	444326	116794	Car	Stoneham Interchange (M27 WB Offslip)	Drivers foot slipped off clutch
38	Slight	444316	116795	Car	M25 J5 / Stoneham Way	Car ran a red light
39	Slight	444326	116797	Car	Stoneham Interchange (M27 WB Offslip)	Building, road signs, street furniture, clipped kerb and flipped onto side
40	Slight	444725	116799	Car	Wide Lane	Fatigue / loss on control due to wet weather
41	Serious	444213	116817	Car	Stoneham Interchange (M27 WB Onslip)	Bottle under brake pedal
42	Slight	444207	116819	MC	Stoneham Interchange (M27 WB Onslip)	Poor turn manoevre - car cut across lanes
43	Slight	444278	116846	Car	M27 WB	Vehicles following too closely and sudden braking - rear end shunt
44	Slight	444358	116884	Car	Stoneham Interchange	Learner drive - changed lanes without looking properly
45	Serious	443799	116888	Car	M27 WB	loss on control doe to medical episode
46	Slight	443749	116905	Car	M27 EB off-slip	Failed to slow - rear end shunt
47	Serious	443797	116912	Car	M27 EB off-slip	Loss of control due to substance
48	Slight	444236	116940	MC	Stoneham Interchange	Car failed to slow/stop and went into MC
49	Slight	443931	116941	Ped	M27 EB off-slip	careless/reckless/in a hurry
50	Slight	444377	116942	Car	Stoneham Interchange	Vehicle in wrong lane cut across and collided with adjacent vehicle
51	Slight	444330	117002	Car	Stoneham Interchange (Stoneham Lane arm)	Vehicle failed to give way and sudden braking
52	Serious	444714	117010	Cycle	A335 / Wide Lane roundabout	Vehicle failed to give way to cyclist already on roundabout
53	Serious	444715	117012	Car	A335 / Wide Lane roundabout	Road race incident
54	Slight	444805	117034	Car	Wide Lane	Car failed to look properly and turned right in error, colliding with oncoming vehiclle
55	Slight	444609	117047	Car	A335	Lost control due to wet weather
56	Slight	444096	117059	Cycle	Stoneham Lane	Cycle impaired by alcohol fell off bike
57	Slight	444859	117074	Cycle	Wide Lane	Car too close to cyclist and clipped them
58	Slight	444918	117172	Car	Wide Lane	Car failed to slow - read end shunt
59	Slight	444934	117213	Car	Wide Lane	Failed to look properly / failed to judge other persons path or speed
60	Serious	444976	117287	Cycle	Wide Lane	Car overtook cyclist too closely and knocked cyclist off bike
61	Slight	445071	117472	Cycle	Wide Lane	Cyclist entered the junction from pavement into the path of oncoming vehicle
62	Slight	445207	117707	MC	Wide Lane / South Street	Failed to look properly / slow down
63	Slight	445218	117722	MC	Wide Lane / South Street	MC failed to slow in time
64	Slight	445184	117846	Car	Doncaster Road	Failure to look properly
65	Slight	445409	118077	Ped	Southampton Road / Chestnut Avenue	Car turned into pedestrian crossing road
66	Slight	445330	118105	MC	Chestnut Avenue	Inexperience/learner driver and wet weather conditions
67	Slight	445523	118282	Car	Southampton Road	Car following too closely - rear end shunt
68	Serious	445527	118296	MC	Southampton Road	MC overtook stationary vehicle into oncoming car
69	Slight	445543	118320	Car	Southampton Road	Poor turn / manoevre
70	Serious	445547	118329	Ped	Southampton Road	Goods vehicle collided with eliders of another goods vehicle, knocking them onto pedestrians ankll
71	Slight	445563	118373	MC	Southampton Road / Derby Road	Car failed to stop
72	Slight	445561	118374	Car	Southampton Road / Derby Road	Driver not looking properly collided with another vehicle
73	Slight	445563	118375	Car	Southampton Road / Derby Road	Failed to look properly
74	Serious	445416	118394	Ped	Derby Road / High Street	Pedestrian crossing road failed to look properly / judge vehicles path or speed
75	Slight	445578	118402	Car	Southampton Road	Car following too closely - rear end shunt
76	Slight	445541	118550	Car	Market Street / Grantham Road	Failed to give-way
77	Slight	445654	118614	Cycle	Southampton Road	Cyclist (no lights/darkclothing/headphones) veered into path of vehicle
78	Slight	445662	118704	Car	Southampton Road / Blenheim Road	Sudden braking and failure to slow in time
79	Slight	445655	118718	Cycle	Southampton Road / Blenheim Road	Car collided with cyclist - unable to see due to bright sun
80	Slight	445672	118743	Car	Southampton Road	Impaired by alcohol / travelling too fast
81	Slight	445675	118816	Car	Southampton Road / Wells Place	Following too closely
82	Slight	445630	118849	Bus	Wells Place / Mitchell Road	Person tripped up entering stationary bus
83	Slight	445616	118852	Car	Wells Place / Mitchell Road	Failed to look properly undertaking a poor turn
84	Serious	445625	118852	Ped	Wells Place / Mitchell Road	Ped struck by vehicle reversing round corner - poor turn / manoevre
85	Serious	445592	118854	Ped	Wells Place / Market Street	Mobility scooter failed to stop in time and collided with pedestrian
86	Slight	445588	118857	Ped	Wells Place / Market Street	Pedestrian crossed the road in vehicle blind spot
87	Slight	445596	118934	MC	Market Street	Defective brakes
88	Serious	445694	118940	Cycle	Southampton Road	Electric cyclist failed to stop and collided with vehicle
89	Slight	445699	118951	Ped	Southampton Road	Pedestrian deliberately stepped into path of vehicle
90	Slight	445698	119066	Cycle	Station Hill / Leigh Road	Cyclist entered road from pavement in path of vehicle
91	Slight	445705	119067	Car	Station Hill / Leigh Road	Failed to look properly
92	Slight	445617	119071	Ped	Leigh Road / Upper Market Street	Car turned into pedestrian crossing road
93	Slight	445698	119073	Car	Station Hill / Leigh Road	Rear end shunt - vehicle failed to stop
94	Slight	445620	119075	Ped	Leigh Road / Upper Market Street	Cyclist (no lights) collided with pedestrian crossing the road
95	Slight	445698	119076	MC	Station Hill / Leigh Road	Distraction in vehicle (coughing fit)
96	Slight	445708	119145	MC	Bishopstoke Road / Station Hill	Car failed to slow down - rear end shunted MC
97	Serious	445932	119166	Cycle	Bishopstoke Road	MC failed to give way, crossed cycle path and collided with a cyclist on the cycle path, resulted in further casualties as other drivers distracted by first collision
98	Serious	445731	119170	MC	Bishopstoke Road	MC lost control - suspected defective steering/suspension and/or slippery inspection cover or road marking
99	Slight	446095	119177	Cycle	Bishopstoke Road	Car failed to give way to cyclist
100	Fatal	445693	119213	Car	Station Hill	Vehicle travelling at excess speed lost control and spun into path of oncoming goods vehicle
101	Slight	445634	119259	Car	Romsey Road	Distraction outside of vehicle (friend) and failed to stop at red light
102	Slight	445616	119260	Ped	Romsey Road	Pedestrian was walking through stationary traffic - failed to look properly - likely due to disability or illness
103	Slight	445697	119262	Cycle	Twyford Road / Romsey Road roundabout	Vehicle failed to give way and collided with cyclist
104	Serious	445710	119272	MC	Twyford Road / Romsey Road roundabout	MC driver lost control on roundabout
105	Slight	445670	119376	Car	Twyford Road / The Crescent	Misleading signal resulted in vehicle pulling out into junction
106	Slight	445423	118681	Car	Southampton Road / Chestnut Avenue	Failure to give way
107	Serious	445563	118374	Cycle	Southampton Road / Derby Road	Car turned into path of cyclist (failure to give way)
108	Slight	445660	118649	Cycle	Southampton Road	Car disobeyed road signs and collided with cyclist

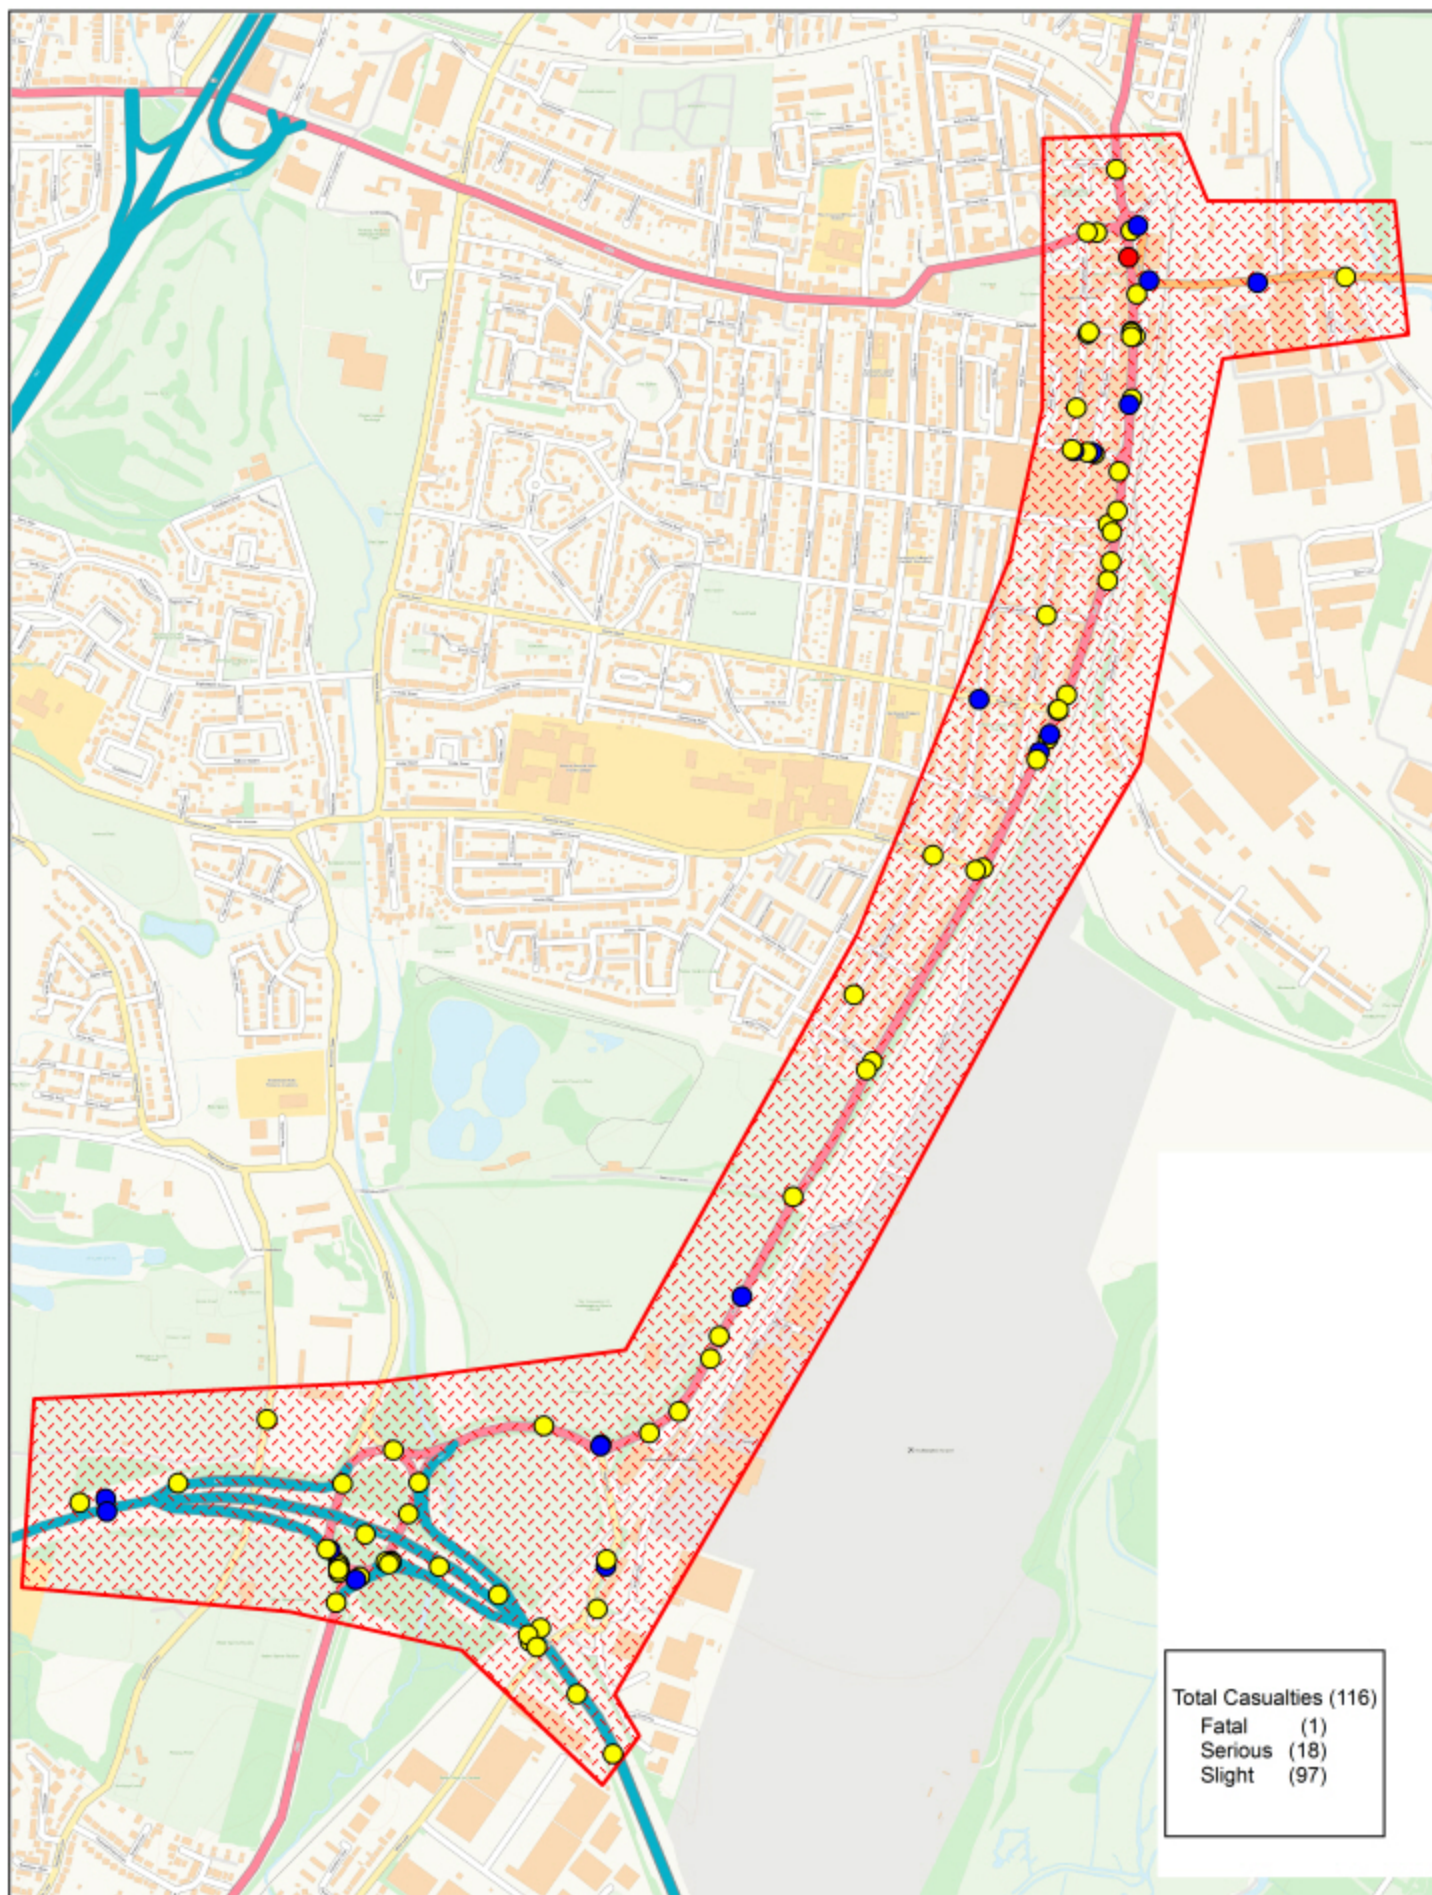

A335 Eastleigh

SCALE	1 : 14000
DATE	27/11/2024
DRAWING No.	
DRAWN BY	

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

Selected Polygon:AW A335 EASTLEIGH BACS/SR/1124/183

44190156289 07/05/2019 Time 0815 Vehicles 2 Casualties 1 Slight
E:444228 N: 116785 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Motorway 37
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING N ALONG A335 STONEHAM LANE FAILED TO SLOW IN TIME ON APPROACH TO THE ROUNDABOUT AND COLLIDED WITH THE REAR OF VEH1 (CAR) IN FRONT, WAITING TO ENTER RBT. Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 28 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 28 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190167332 15/05/2019 Time 1400 Vehicles 2 Casualties 3 Slight
E:445670 N: 119376 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: Central reservation Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to signal/Misleading signal	Vehicle 2	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SE ALONG THE CRESCENT STOPPED WAITING TO ENTER A335 TWYFORD ROAD. VEH2 (CAR) TRAVELLING N ALONG A335 TWYFORD ROAD HAD LEFT INDICATOR ON. VEH1 PULLS OUT ASSUMING VEH2 WILL TURN. VEH2 DOES NOT TURN AND THEY COLLIDE.
Occurred on A335 TWYFORD ROAD AT JUNCTION WITH THE CRESCENT, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Starting
Vehicle movement from NW to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 33 Female
Not hit and run Breath test Not requested Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 33 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 36 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Casualty Reference: 3 Vehicle: 1 Age: 12 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Back seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference2CarGoing ahead other

Vehicle movement fromS to NNo tow / articulationLeaving the main road

On main carriagewayNo skidding, jack-knifing or overturning

Location at impactMid Junction - on roundabout or rFirst impactFrontHit vehicle:

Hit object in roadNoneOff road:None

Did not leave carrAge of Driver37Male

Not hit and runBreath testNot requested

Left hand drive: No

4419018084326/05/2019Time1422Vehicles1Casualties1Slight

E:444326N:116797First Road:M27Road TypeDual carriageway

Speed limit:70Junction Detail:Slip RoadGive way or controlledA335

Crossing: ControlNoneFacilities:None within 50mRoad surfaceWet/Damp

DaylightFine without high winds

Special Conditions at SiteNoneCarriageway Hazards:None

Place accident reported:At sceneDfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:	Buildings, road signs, street furniture	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING W ALONG M27 WESTBOUND OFF SLIP CLIPPED THE KERB AND WENT ONTO THE ROAD SIDE FURNITURE AND FLIPPED ONTO ITS SIDE.

Occurred on M27 WESTBOUND JUNCTION 5 OFF SLIP AT JUNCTION WITH A 335 STONEHAM WAY, EASTLEIGH, HAMPSHIRE

Vehicle Reference1CarGoing ahead other

Vehicle movement fromE to WNo tow / articulationLeaving the main road

On main carriagewayOverturned

Location at impactJct ApproachFirst impactFrontHit vehicle:

Hit object in roadKerbOff road:None

Did not leave carrAge of Driver35Female

Not hit and runBreath testNegative

Left hand drive: No

Casualty Reference:1Vehicle:1Age:35FemaleDriver/riderSeverity: Slight

Not a pupil

SeatbeltNot ApplicableCycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44190189679 03/06/2019 Time 0423 Vehicles 1 Casualties 1 Serious
E:443797 N: 116912 First Road: M 27 Road Type Single carriageway
Speed limit: 50 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Loss of control	Vehicle 1	Very Likely
2nd:	Impaired by drugs (illicit or medicinal)	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING E ALONG THE M27 LOST CONTROL AND COLLIDED WITH THE NEARSIDE
CRASH BARRIER BEFORE REBOUNDED INTO TEH CARRIAGEWAY.
Occurred on M27 EASTBOUND AT MARKER POST 18.5, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: Near / off crash barrier
Nearside & rebounded Age of Driver 18 Female
Not hit and run Breath test Not requested Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 18 Female Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190194727 06/06/2019 Time 1559 Vehicles 2 Casualties 1 Slight
E:445423 N: 118081 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Stop sign Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Disobeyed Give Way or Stop sign or markings Failed to look properly	Vehicle 1	Possible
2nd:		Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING E ALONG CHESTNUT AVENUE PULLED OUT ONTO A335 SOUTHAMPTON ROAD WITHOUT GIVING WAY TO VEH2 (CAR) TRAVELLING NE ALONG A335 SOUTHAMPTON ROAD.
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH CHESTNUT AVENUE, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Turning right
Vehicle movement from W to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or i First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 81 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or i First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 40 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 48 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44190195316 07/06/2019 Time 0640 Vehicles 2 Casualties 1 Slight
E:444609 N: 117047 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Slippery road (due to weather)	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING E ALONG A335 WIDE LANE LOST CONTROL ON THE BEND, SPUN 180 DEGREES
INTO TEHE PATH OF VEH2 (CAR) TRAVELLING W ALONG A335 WIDE LANE.
Occurred on A335 WIDE LANE, 275 METERS E OF JUNCTION WITH M27 SLIP ROADS, EASTLEIGH,
HAMPSHIRE.

Vehicle Reference 1 Car Going ahead left bend
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 61 Male
Not hit and run Breath test Not requested
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 37 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 37 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190207275 16/06/2019 Time 2000 Vehicles 1 Casualties 1 Slight
E:445330 N: 118105 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Inexperienced or learner driver/rider	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (M/CYCLE) TRAVELLING NW ALONG CHESTNUT AVENUE SLIPPED ON A DRAIN COVER AND RIDER FELL FROM VEHICLE.
Occurred on CHESTNUT AVENUE AT JUNCTION WITH DONCASTER ROAD, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 18 Male
Not hit and run Breath test Not requested Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 18 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Notes:

44190236286 08/07/2019 Time 0630 Vehicles 3 Casualties 1 Slight
E:444278 N: 116846 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st: Following too close	Vehicle 3	Very Likely	
2nd: Following too close	Vehicle 2	Very Likely	
3rd: Sudden braking	Vehicle 1		
4th:			
5th:			
6th:			

VEH3 (VAN) TRAVELLING NW ALONG M27 FAILED TO SLOW IN TIME FOR TRAFFIC AHEAD AND
COLLIDED WITH THE REAR OF VEH2 (CAR) PUSHING IT INTO THE REAR OF VEH1 (GOODS VEH)
STATIONARY IN TRAFFIC AHEAD.

Occurred on M27 NORTHBOUND AT MARKER POST 19.0, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 45 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Stopping
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 48 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 48 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference 3 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 24 Male
Not hit and run Breath test Negative
Left hand drive: No

44190237286 08/07/2019 Time 1700 Vehicles 1 Casualties 1 Slight
E:445543 N: 118320 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Pri Drive Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING NE ALONG A335 SOUTHAMPTON ROAD GOES TO TURN RIGHT INTO THE
PETROL STATION BUT MISJUDGES THE TURN AND COLLIDES WITH A WALL.

Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH ENTRANCE TO PETROL STATION,
EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Turning right
Vehicle movement from SW to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: Wall or fence
O/S Age of Driver 83 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 83 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Notes:

44190270232 01/08/2019 Time 0901 Vehicles 2 Casualties 1 Slight
E:444236 N: 116940 First Road: A 335 Road Type 1
Speed limit: 40 Junction Detail: Roundabout Automatic traffic signal Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING N ALONG A335 STONEHAM WAY RBT COLLIDES WITH REAR OF VEH 2 (M/CYCLE) SLOWING FOR AMBER ATS. VEH 1 FAILED TO STOP. RIDER OF VEH 2 MANAGED TO STAY ON VEH AND WAS NOT KNOCKED OFF.

Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27 EASTBOUND JUNCTION 5 OFFSLIP, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Motor Cycle over 50 cc and up to 125cc Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 32 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 32 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190279366 07/08/2019 Time 2250 Vehicles 2 Casualties 1 Serious
E:444976 N: 117287 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (P/CYCLE) TRAVELLING SW ALONG A335. VEH 2 (CAR) ALSO TRAVELLING SW ALONG A335 OVERTAKES VEH 1 TOO CLOSE AND COLLIDES.
Occurred on A335 WIDE LANE, 203 METERS S OF JUNCTION WITH DONCASTER DROVE, EASTLEIGH HAMPSHIRE

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 48 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 48 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Vehicle Reference 2 Car Overtaking moving vehicle O/S
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Notes:

44190291035 16/08/2019 Time 1805 Vehicles 2 Casualties 1 Slight
E:445071 N: 117472 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st: Cyclist entering road from pavement	Vehicle 2	Very Likely	
2nd: Failed to look properly	Vehicle 2	Very Likely	
3rd:			
4th:			
5th:			
6th:			

VEH 2 (P/CYCLE) TRAVELLING SW ALONG A335 WIDE LANE ON THE PAVEMENT ENTERS THE JUNCTION
ACROSS THE PATH OF VEH 1 (CAR) TRAVELLING E ALONG DONCASTER DROVE, TURNING LEFT ONTO
A335 WIDE LANE AND COLLIDES, CAUSING THE RIDER TO FALL OFF.

Occurred on A335 WIDE LANE AT JUNCTION WITH DONCASTER DROVE, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Turning left
Vehicle movement from W to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 32 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 20 Female
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 20 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190300817 24/08/2019 Time 1259 Vehicles 1 Casualties 1 Slight
E:444096 N: 117059 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Impaired by alcohol	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (P/CYCLE) TRAVELLING S ALONG STONEHAM LANE WITH INTOXICATED RIDER, COLLIDES WITH KERB AND RIDER FALLS OFF.
Occurred on STONEHAM LANE 51 METRES NORTH OF BANNISTER PARK BOWLING CLUB, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road Kerb Off road: None
Did not leave carr Age of Driver 53 Male
Not hit and run Breath test Not applicable Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 53 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190324360 11/09/2019 Time 1916 Vehicles 2 Casualties 1 Slight
E:445697 N: 119262 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: Central reservation Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (P/CYCLE) TRAVELLING S ALONG TWYFORD ROAD ENTERS THE RBT TO TURN RIGHT ON TO ROMSEY ROAD. VEH 2 (CAR) TRAVELLING N, ENTERS THE RBT FROM STATION HILL, FAILS TO GIVE WAY AND COLLIDES WITH VEH1.

Occurred on A335 TWYFORD ROAD, EASTLEIGH, HAMPSHIRE, ROUNDABOUT JUNCTION WITH STATION HILL AND ROMSEY ROAD.

Vehicle Reference 1 Pedal Cycle Going ahead right bend
Vehicle movement from N to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 34 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 34 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not known

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Starting
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Unknown
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190330088 16/09/2019 Time 0900 Vehicles 2 Casualties 1 Slight
E:445596 N: 118934 First Road: U Road Type Single carriageway
Speed limit: 20 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Defective brakes	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (M/CYCLE) TRAVELLING S ALONG MARKET STREET, BRAKES BUT BRAKES ARE DEFECTIVE AND LOSES CONTROL AND COLLIDES WITH THE REAR OF VEH 2 (CAR) SLOWING IN FRONT.
Occurred on MARKET STREET OUTSIDE NUMBER 33, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Stopping
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 17 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 17 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 87 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44190339361 23/09/2019 Time 0640 Vehicles 5 Casualties 2 Serious
E:445932 N: 119166 First Road: B 3037 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Vehicle travelling along pavement	Vehicle 1	Very Likely
2nd:	Failed to signal/Misleading signal	Vehicle 1	Very Likely
3rd:	Distraction outside vehicle	Vehicle 3	
4th:			
5th:			
6th:			

VEH1 (M/CYCLE) TRAV W ALONG B3037 BISHOPSTOKE RD CROSSES CYCLE PATH TO GO THROUGH GATE
INTO BUS DEPOT AND HITS VEH2 (P/CYCLE) TRAV E ALONG CYCLE PATH. MEANWHILE VEH3 (VAN)
VEH4 (M/CYCLE) & VEH5 (CAR) TRAV E COLLIDE WHILST DISTRACTED BY FIRST COLLISIO
Occurred on B3037 BISHOPSTOKE ROAD, OUTSIDE OF BUS DEPOT, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Turning left
Vehicle movement from E to S No tow / articulation Leaving the main road
Cycleway or shared use footway (not part of main car No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 61 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Going ahead other
Vehicle movement from W to E No tow / articulation Leaving the main road
Cycleway or shared use footway (not part of main car No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 23 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 23 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference 3 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 22 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 4 Motorcycle over 500cc Stopping
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 59 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 2 Vehicle: 4 Age: 59 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 5 Car Stopping
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 33 Female
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190351360 02/10/2019 Time 0815 Vehicles 2 Casualties 1 Slight
E:445698 N: 119076 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: Pelican, puffin, toucan etc. Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Distraction in vehicle	Vehicle 1	Possible
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING N ALONG A335 STATION HILL COLLIDED WITH REAR OF VEH 2 (M/CYCLE) TRAVELLING IN FRONT IN SLOW MOVING TRAFFIC. DRIVER OF VEH 1 STATES THEY HAD A COUGHING FIT WHICH CAUSED THE COLLISION.

Occurred on A335 STATION HILL AT JUNCTION WITH LEIGH ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 43 Female
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Motor Cycle over 125 cc and up to 500cc Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 49 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 49 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190354711 04/10/2019 Time 1230 Vehicles 2 Casualties 1 Slight
E:444330 N: 117002 First Road: A 335 Road Type Single carriageway
Speed limit: 60 Junction Detail: Roundabout Automatic traffic signal Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Sudden braking	Vehicle 2	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING E AROUND THE RBT IN LANE 2 MOVED INTO LANE 1 DIRECTLY INTO THE PATH OF VEH2 (CAR) TRAVELLING E AROUND THE RBT IN LANE 1. VEH2 BRAKED SHARPLY AND CAS1 (PASSENGER) HIT HIS HEAD ON THE SEAT IN FRONT.

Occurred on M27 EASTBOUND OFFSLIP AT JUNCTION WITH A335 STONEHAM LANE, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Changing lane to left
Vehicle movement from S to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Did not impact Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Non-stop, not hit Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Did not impact Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 56 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 54 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Back seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190400765 07/11/2019 Time 2159 Vehicles 2 Casualties 1 Slight
E:445660 N: 118649 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Wet/Damp
Darkness: street lights present and lit Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING N ALONG A335 TURNS RIGHT INTO CAMPBELL ROAD CONTRAVENING A NO RIGHT TURN SIGN AT ATS AND COLLIDES WITH VEH 2 (P/CYCLE) ALSO TRAVELLING N ALONG A335 FILTERING PAST SLOW MOVING TRAFFIC ON O/S.
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH CAMPBELL ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Turning right
Vehicle movement from S to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Overtaking moving vehicle O/S
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 41 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 41 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190407662 13/11/2019 Time 0802 Vehicles 2 Casualties 1 Serious
E:445527 N: 118296 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 2	Very Likely
2nd:	Poor turn or manoeuvre	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (M/CYCLE) TRAVELLING N ALONG A335 SOUTHAMPTON RD, OVERTAKING STATIONARY TRAFFICE HAS FAILED TO NOTICE VEH 2 (CAR) TRAVELLING N ALONG A335 MAKING A RIGHT TURN INTO A PETROL GARAGE. VEH 1 HAS COLLIDED WITH VEH 2.

Occurred on A335 SOUTHAMPTON RD, 89 METRES S OF JCT WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Motorcycle over 500cc Overtaking moving vehicle O/S
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 52 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 52 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Turning right
Vehicle movement from S to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 26 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190410598 14/11/2019 Time 1715 Vehicles 2 Casualties 1 Slight
E:443749 N: 116905 First Road: M 27 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site Road works Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING E ALONG THE M27 IN SLOW MOVING TRAFFIC COLLIDED WITH THE REAR OF VEH1 (CAR) TRAVELLING E IN FRONT.
Occurred on M27 EASTBOUND AT MARKER POST 18.5, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Stopping
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 36 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 36 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 24 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44190409277 14/11/2019 Time 0715 Vehicles 2 Casualties 1 Slight
E:444859 N: 117074 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (P/CYCLE) TRAVELLING S ALONG A334 WIDE LANE STOPPED FOR RED ATS. VEH2 (CAR)
TRAVELLING S ALONG A334 WIDE LANE STOPPED ALONGSIDE VEH1. WHEN THE LIGHTS CHANGED BOTH
VEHS MOVED OFF AND VEH2 CLIPPED VEH1 CAUSING THE RIDER TO FALL.
Occurred on A335 WIDE LANE, OUTSIDE SOUTHAMPTON PARKWAY TRAIN STATION, EASTLEIGH,
HAMPSHIRE.

Vehicle Reference 1 Pedal Cycle Starting
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 56 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 56 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Vehicle Reference 2 Car Starting
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44190430012 29/11/2019 Time 1506 Vehicles 1 Casualties 1 Slight
E:445705 N: 119067 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Casualty 1	Very Likely
2nd:	Failed to look properly	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING S ALONG A335 STATION HILL WHEN CAS1 (PEDESTRIAN) STARTS TO CROSS
THE ROAD TRAVELLING W ON THE CROSSING INTO THE PATH OF VEH1.
Occurred on A335 STATION HILL AT JUNCTION WITH LEIGH ROAD, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 40 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 77 Male Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

On Ped Crossing W bound
Driver's nearside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Notes:

44190443448 06/12/2019 Time 1630 Vehicles 2 Casualties 1 Slight
E:446095 N: 119177 First Road: B 3035 Road Type Single carriageway
Speed limit: 30 Junction Detail: Pri Drive Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING E ALONG B3035 BISHOPSTOKE ROAD TURNED RIGHT INTO ESSO FILLING
STATION ACROSS PATH OF VEH 2 (P/CYCLE) TRAVELLING W ALONG SOUTH PAVEMENT OF B3035
BISHOPSTOKE ROAD. VEH 2 COLLIDES WITH NEARSIDE VEH 1.

Occurred on B3035 BISHOPSTOKE ROAD AT JUNCTION WITH ESSO FILLING STATION, EASTLEIGH,
HAMPSHIRE

Vehicle Reference 1 Car Turning right
Vehicle movement from W to S No tow / articulation Leaving the main road
Cycleway or shared use footway (not part of main car No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 34 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
Cycleway or shared use footway (not part of main car No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 39 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190438647 06/12/2019 Time 1155 Vehicles 2 Casualties 1 Serious
E:444715 N: 117012 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: Pelican, puffin, toucan etc. Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING E ALONG A335 WIDE LANE IS INVOLVED IN A ROAD RAGE INCIDENT WITH VEH 2 (CAR) TRAVELLING IN FRONT. VEH 1 OVERTAKES VEH 2 AND THE WING MIRROR OF VEH 1 CLIPS THE HAND OF VEH 2'S DRIVER AS IT HANGS OUT THE WINDOW.
Occurred on A335 WIDE LANE AT JUNCTION WITH WIDE LANE, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Overtaking moving vehicle O/S
Vehicle movement from W to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from W to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 31 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 31 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44190446321 12/12/2019 Time 1101 Vehicles 1 Casualties 1 Slight
E:445617 N: 119071 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Rain, sleet, snow, or fog	Vehicle 1	Possible
2nd:	Failed to look properly	Casualty 1	Possible
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING W ALONG LEIGH ROAD GOES TO TURN LEFT INTO MARKET STREET AS CAS1 (PEDESTRIAN) STEPS OUT FROM NEARSIDE CROSSING LEIGH ROAD TRAVELLING N.
Occurred on MARKET STREET AT JUNCTION WITH LEIGH ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Turning left
Vehicle movement from E to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 24 Male
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 59 Female Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

In carr elsewhere N bound

Driver's nearside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44190453127 17/12/2019 Time 1800 Vehicles 1 Casualties 1 Slight
E:445409 N: 118077 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled A 335
Crossing: Control None Facilities: Central reservation Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG A335 SOUTHAMPTON ROAD TURNED RIGHT INTO CHESTNUT AVENUE COLLIDING WITH CAS 1 (PEDESTRIAN) TRAVELLING N ACROSS CHESTNUT AVENUE.
Occurred on CHESTNUT AVENUE AT JUNCTION WITH A335 SOUTHAMPTON ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Turning right
Vehicle movement from NE to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or T-junction First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 30 Female Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
In carr elsewhere N bound
Driver's nearside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44200002796 02/01/2020 Time 1700 Vehicles 1 Casualties 1 Slight
E:445620 N: 119075 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (P/CYCLE) TRAVELLING W ALONG LEIGH ROAD WITH NO LIGHTS SHOWING COLLIDES WITH CAS1
(PEDESTRIAN) CROSSING LEIGH ROAD TRAVELLING N.
Occurred on LEIGH ROAD AT JUNCTION WITH MARKET STREET, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 19 Male
Not hit and run Breath test Not applicable Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 67 Male Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

In carr elsewhere N bound

Driver's nearside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200016900 14/01/2020 Time 1944 Vehicles 2 Casualties 1 Serious
E:445563 N: 118374 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Raining with high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 2 (CAR) TRAVELLING E ALONG DERBY ROAD HAS ATTEMPTED TO TURN LEFT ON TO SOUTHAMPTON ROAD BUT FAILED TO GIVE WAY TO VEH 1 (P/CYCLE) TRAVELLING N ALONG A335 SOUTHAMPTON ROAD. RIDER OFF VEH 1 WAS KNOCKED TO THE GROUND.
Occurred on A335 SOUTHAMPTON ROAD AT THE JUNCTION WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 45 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 45 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Vehicle Reference 2 Car Turning left
Vehicle movement from W to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering main road First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44200022017 18/01/2020 Time 1710 Vehicles 4 Casualties 1 Slight
E:444268 N: 116767 First Road: A 35 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG A35 STONEHAM WAY CHANGED LANE AND COLLIDED WITH REAR OF VEH 2 (CAR). VEH 2 HAS COLLIDED WITH VEH 3 (CAR) IN FRONT AND ALSO VEH 4 (CAR).
Occurred on A35 STONEHAM WAY AT JUNCTION WITH M27 WESTBOUND JUNCTION 5 OFFSLIP, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Changing lane to left
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 45 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 45 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 42 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference	3	Car	Going ahead but held up
Vehicle movement from	NE to SW	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Cleared junction or waiting/park	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	57
Not hit and run	Breath test	Not requested	Male
		Left hand drive:	No

Vehicle Reference	4	Car	Going ahead but held up
Vehicle movement from	NE to SW	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Cleared junction or waiting/park	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	52
Not hit and run	Breath test	Not requested	Male
		Left hand drive:	No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Notes:

44200061937 18/02/2020 Time 0620 Vehicles 2 Casualties 1 Slight
E:444316 N: 116795 First Road: A 335 Road Type Single carriageway
Speed limit: 50 Junction Detail: Roundabout Automatic traffic signal Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lighting unknown Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SW AROUND A335 STONEHAM WAY RBT WHEN VEH2 (CAR) TRAVELLING NW
ALONG M27 J5 OFFSLIP ALLEGEDLY GOES THROUGH RED LIGHT AND COLLIDES INTO VEH1. VEH2 DOES
NOT STOP.

Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27 JUNCTION 5 W/B OFF-SLIP, EASTLEIGH,
HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 22 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 22 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200088779 09/03/2020 Time 0753 Vehicles 2 Casualties 1 Slight
E:445655 N: 118718 First Road: A 335 Road Type 1
Speed limit: 30 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Dazzling sun	Vehicle 1	Very Likely
2nd:	Failed to look properly	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING E ALONG BLENHEIM ROAD PULLED ONTO RBT COLLIDING WITH VEH 2 (P/CYCLE) TRAVELLING N ALONG A335 SOUTHAMPTON ROAD AND AROUND RBT. VEH 1 UNABLE TO SEE VEH 2 DUE TO SUN IN EYES.

Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH BLENHEIM ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Starting
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 51 Male
Not hit and run Breath test Not requested
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 23 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 23 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

4420019319630/05/2020Time 1730Vehicles 2Casualties 1Slight

E:445708N: 119145First Road: B 3037Road TypeSingle carriageway

Speed limit: 30Junction Detail: T & Stag JctGive way or controlledA 335

Crossing: ControlNoneFacilities: None within 50mRoad surfaceDry

DaylightFine without high winds

Special Conditions at SiteNoneCarriageway Hazards: None

Place accident reported: At sceneDfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Road layout (eg bend, hill etc.) Failed to look properly	Vehicle 1	Possible
2nd:		Vehicle 2	Possible
3rd:			
4th:			
5th:			
6th:			

VEH 1 (M/CYCLE) TRAVELLING SW ALONG B3037 BISHOPSTOKE ROAD WAS STOPPED AT THE JUNCTION TO GIVE WAY TO TRAFFIC. VEH 2 (CAR) TRAVELLING SW BEHIND VEH 1 HAS FAILED TO NOTICE VEH 1 HAS STOPPED AND COLLIDED WITH THEIR REAR.

Occurred on B3037 BISHOPSTOKE ROAD AT THE JUNCTION WITH A335 STATION HILL, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1Motorcycle over 500ccWaiting to turn left

Vehicle movement from NE to SWNo tow / articulationLeaving the main road

On main carriagewayNo skidding, jack-knifing or overturning

Location at impactJct ApproachFirst impact BackHit vehicle:

Hit object in roadNoneOff road: None

Did not leave carrAge of Driver 61Male

Not hit and runBreath testNot requested

Left hand drive: No

Casualty Reference: 1Vehicle: 1Age: 61MaleDriver/riderSeverity: Slight

Not a pupil

Seatbelt Not ApplicableCycle helmet: Not a cyclist

Vehicle Reference 2CarStopping

Vehicle movement from NE to SWNo tow / articulationLeaving the main road

On main carriagewayNo skidding, jack-knifing or overturning

Location at impactJct ApproachFirst impact FrontHit vehicle:

Hit object in roadNoneOff road: None

Did not leave carrAge of Driver 30Male

Not hit and runBreath testNot requested

Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200212136 12/06/2020 Time 1606 Vehicles 2 Casualties 1 Slight
E:444670 N: 116550 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 2 (VAN) TRAVELLING NW ALONG M27 FAILS TO REACT IN TIME TO SLOWING TRAFFIC AHEAD AND COLLIDES WITH REAR OF VEH 1 (VAN) THAT HAD SLOWED IN A QUEUE FOR A BROKEN DOWN VEHICLE AHEAD.,
Occurred on M27 MARKER POST 19.5 WESTBOUND, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Van or Goods 3.5 tonnes mgw and under Stopping
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 63 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 63 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200327125 25/08/2020 Time 1730 Vehicles 2 Casualties 2 Slight
E:445634 N: 119259 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Footbridge or subway Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Distraction outside vehicle	Vehicle 1	Very Likely
2nd:	Failed to look properly	Vehicle 1	Very Likely
3rd:	Following too close	Vehicle 1	
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING W ALONG A335 LEIGH NOTICE WHEN DRIVER SAW HIS FRIEND OUTSIDE AND BECAME DISTRACTED. VEH1 FAILED TO NOTICE THE LIGHTS TURN RED AND COLLIDED WITH THE REAR OF VEH2 (CAR) TRAVELLING W IN FRONT, STOPPING FOR THE RED ATS.
Occurred on A335 LEIGH ROAD AT JUNCTION WITH UPPER MARKET STREET, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 18 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Stopping
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 37 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 37 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 2 Age: 40 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200336134 01/09/2020 Time 1205 Vehicles 1 Casualties 1 Serious
E:445416 N: 118394 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to judge vehicles path or speed	Casualty 1	Very Likely
2nd:	Failed to look properly	Casualty 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

CAS1 (PEDESTRIAN) CROSSES DERBY ROAD TRAVELLING N INTO THE PATH OF VEH1 (CAR) TRAVELLING W ALONG DERBY ROAD.
Occurred on DERBY ROAD, 90 METERS E OF JUNCTION WITH DESBOROUGH ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 48 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 19 Female Pedestrian Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

In carr elsewhere N bound
Driver's nearside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200422700 31/10/2020 Time 1505 Vehicles 2 Casualties 1 Slight
E:445675 N: 118816 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING N ALONG SOUTHAMPTON ROAD FAILED TO SLOW IN TIME ON APPROACH TO THE JUNCTION AND COLLIDED WITH THE REAR OF VEH2 (CAR) TRAVELLING N IN FRONT, SLOWING ON APPROACH TO THE ROUNDABOUT.

Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH WELLS PLACE, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 39 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44200437902 11/11/2020 Time 1655 Vehicles 2 Casualties 1 Slight
E:444326 N: 116794 First Road: M 27 Road Type Slip road
Speed limit: 70 Junction Detail: Roundabout Automatic traffic signal Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (VAN) TRAVELLING W ALONG M27 OFF SLIP WHEN DRIVERS FOOT SLIPPED OFF THE CLUTCH, CAUSING IT TO COLLIDED WITH THE REAR OF VEH1 (CAR) TRAVELLIGN W ALONG M27 OFF SLIP IN FRONT, STATIONARY AT RED ATS.
Occurred on M27 WESTBOUND OFF SLIP, AT JUNCTION WITH STONEHAM WAY, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 30 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 30 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Starting
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44200476207 10/12/2020 Time 1107 Vehicles 3 Casualties 2 Slight
E:444603 N: 116672 First Road: M 27 Road Type Slip road
Speed limit: 50 Junction Detail: Slip Road Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site Road works Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:	Travelling too fast for conditions	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SE ALONG M27 ONSLIP DRIVER LOOKS BEHIND TO JOIN CARRIAGEWAY AND FAILS TO NOTICE STOPPED TRAFFIC AND COLLIDES WITH THE REAR OF VEH 2 (CAR) STATIONARY, SHUNTING VEH 2 INTO THE REAR OF VEH 3 (CAR) STATIONARY.

Occurred on M27 EASTBOUND AT JUNCTION WITH M27 EASTBOUND JUNCTION 5 ONSLIP, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or i First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 17 Male
Not hit and run Breath test Negative
Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 17 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead but held up
Vehicle movement from NW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or i First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 46 Male
Not hit and run Breath test Negative
Left hand drive: No
Casualty Reference: 2 Vehicle: 2 Age: 46 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference	3	Car	Going ahead but held up
Vehicle movement from	NW to NE	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Mid Junction - on roundabout or i	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	27
Not hit and run	Breath test	Negative	Male
		Left hand drive:	No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210115995 28/03/2021 Time 1619 Vehicles 2 Casualties 1 Slight
E:444231 N: 116776 First Road: A 335 Road Type Single carriageway
Speed limit: 60 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING NE ALONG A335 STONEHAM WAY CHECKED TO HIS RIGHT THAT THE RBT WAS CLEAR AND THOUGH THAT VEH2 (CAR) TRAVELLING IN FRONT, HAD MOVED ONTO TEH ROUNDABOUT . VEH2 BRAKED ADN VEH1 COLLIDED WITH ITS REAR.
Occurred on A336 STONEHAM WAY AT JUNCTION WITH M27 SLIP ROADS, STONEHAM, HAMPSHIRE.

Vehicle Reference 1 Car Starting
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 42 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 9 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Back seat
Vehicle Reference 2 Car Stopping
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 23 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210133648 09/04/2021 Time 1341 Vehicles 2 Casualties 1 Serious
E:444714 N: 117010 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SE ALONG A335 WIDE LANE ENTERED ROUNDABOUT WITHOUT GIVING WAY TO VEH2 (P/CYCLE) ALREADY ON THE ROUNDABOUT TRAVELLING NE. VEH2 WENT INTO THE OFFSIDE OF VEH1, AND RIDER FELL OFF.
Occurred on A335 WIDE LANE AT JUNCTION WITH WIDE LANE, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NW to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 56 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Going ahead other
Vehicle movement from S to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 54 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 54 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210135749 10/04/2021 Time 2224 Vehicles 1 Casualties 1 Slight
E:445699 N: 118951 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Disability or illness, mental or physical	Casualty 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

CAS1 (PEDESTRIAN) HAS DELIBERATELY STEPPED INTO A335 STATION ROAD TRAVELLING E INTO THE
PATH OF VEH1 (CAR) TRAVELLING S ALONG A335 STATION ROAD.
Occurred on A335 STATION HILL OUTSIDE EASTLEIGH RAILWAY STATION, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 23 Male
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 24 Female Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

In carr elsewhere E bound
Driver's offside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210141111 14/04/2021 Time 1710 Vehicles 2 Casualties 1 Slight
E:445698 N: 119073 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 2	Very Likely
2nd:	Failed to judge other persons path or speed	Vehicle 2	Possible
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING N ALONG LEIGH ROAD MOVED OFF FROM TRAFFIC LIGHTS AND WAS HIT FROM BEHIND BY VEH2 (CAR) TRAVELLING N ALONG LEIGH ROAD.
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WIHT LEIGH ROAD, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Starting
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 35 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 35 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Starting
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Female
Hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210165203 30/04/2021 Time 1633 Vehicles 3 Casualties 1 Slight
E:444918 N: 117172 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 3	Possible
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH3 (CAR) TRAVELLING SW ALONG A335 WIDE LANE FAILS TO SLOW FOR TRAFFIC AHEAD AND COLLIDED WITH THE REAR OF VEH2 (CAR) TRAVELLING IN FRONT, SHUNTING IT INTO THE REAR OF VEH1 (CAR) TRAVELLING SW AHEAD.

Occurred on A335 WIDE LANE, OUTSIDE WIDE LANE SPORTS GORUND, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Stopping
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 49 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Car Stopping
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 47 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 51 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference	3	Car	Going ahead other
Vehicle movement from	NE	to SW	No tow / articulation
On main carriageway			Leaving the main road
Location at impact	Not at, or within 20M of Jct	No skidding, jack-knifing or overturning	
Hit object in road	None	First impact	Front
Did not leave carr		Off road:	None
Not hit and run	Breath test	Not requested	
		Age of Driver	56
			Male
		Left hand drive:	No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210188397 15/05/2021 Time 2305 Vehicles 2 Casualties 1 Slight
E:445654 N: 118614 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Careless/Reckless/In a hurry	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (P/CYCLE) TRAVELLING S ALONG A335 SOUTHAMPTON ROAD HAS NO LIGHTS AND IS WEARING DARK CLOTHING AND HEADPHONES. VEH 1 VEERS TO THE MIDDLE OF THE CARRIAGEWAY, INTO THE PATH OF VEH 2 (CAR) TRAVELLING S ALONG A335. A COLLISION OCCURS.
Occurred on A335 SOUTHAMPTON ROAD, OUTSIDE NUMBER 156, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 19 Male
Not hit and run Breath test Not applicable
Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 19 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 28 Female
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210217215 04/06/2021 Time 0751 Vehicles 1 Casualties 1 Serious
E:444724 N: 116787 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Loss of control	Vehicle 1	Very Likely
2nd:	Careless/Reckless/In a hurry	Vehicle 1	Possible
3rd:			
4th:			
5th:			
6th:			

VEH1 (P/CYCLE) TRAVELLING S ALONG WIDE LANE HAS CLIPPED THE RAILINGS TO THE NEARSIDE,
CAUSING THE RIDER TO GO OVER THE HANDLEBARS.
Occurred on WIDE LANE, 77 METERS NW OF JUNCTION WITH MITCHELL WAY, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
Cycleway or shared use footway (not part of main car No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: Wall or fence
Nearside Age of Driver 33 Male
Not hit and run Breath test Not applicable Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 33 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210219028 04/06/2021 Time 1500 Vehicles 2 Casualties 1 Slight
E:445561 N: 118374 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING E ALONG DERBY ROAD WITHOUT LOOKING PROPERLY AND HAS COLLIDED WITH VEH1 (CAR) TRAVELLING NE ALONG A335 SOUTHAMPTON ROAD.
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from S to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 52 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 52 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Turning right
Vehicle movement from W to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 27 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210244644 22/06/2021 Time 0754 Vehicles 2 Casualties 1 Serious
E:445547 N: 118329 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (GOODS VEH) PARKED ON THE FORECOURT OF UNIT 1 OFFLOADING METAL STEEL GLIDERS. VEH2 (GOODS VEH) TRAVELLING SW ALONG A335 SOUTHAMPTON ROAD MADE CONTACT WITH THE GLIDERS, KNOCKING THEM OFF. THEY HIT THE ANKLE OF CAS1 (PEDESTRIAN) STANDING NEARBY.

Occurred on A335 SOUTHAMPTON ROAD, OUTSIDE UNIT 1, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Goods over 3.5 tonnes and under 7.5 to Parked
Vehicle movement from Park to Parked No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 54 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 48 Male Pedestrian Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Location U/K Standing still

Movement U/K

Vehicle Reference 2 Goods 7.5 tonnes mgw and over Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 72 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210261568 02/07/2021 Time 1253 Vehicles 2 Casualties 1 Slight
E:444377 N: 116942 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Automatic traffic signal Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG A335 IS STOPPED IN LANE 1 OF 2 ON A RED LIGHT AT THE RBT. AS VEH 1 MOVED OFF, THEY WERE STRUCK TO OFFSIDE BY VEH 2 (CAR) TRAVELLING SW ALONG THE A335 AND CUTTING ACROSS THE PATH OF VEH 1. VEH 2 FAILED TO STOP AT THE SCENE.

Occurred on A335 AT THE ROUNDABOUT JUNCTION WITH M27 (JUNCTION 5), STONEHAM, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 49 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 49 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Turning left
Vehicle movement from NE to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 73 Female
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210315956 09/08/2021 Time 1056 Vehicles 2 Casualties 1 Slight
E:444805 N: 117034 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Casualty 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING W TO N ON A335 TURNS RIGHT IN ERROR AND COLLIDES WITH VEH 2 (VAN) TRAVELLING N ON A335
Occurred on JUNCTION WITH SOUTHAMPTON PARKWAY TRAIN STATION ON A335

Vehicle Reference 1 Car Turning right
Vehicle movement from W to N No tow / articulation Leaving the main road
On main carriageway Skidded
Location at impact Leaving main road First impact Front Hit vehicle:
Hit object in road Kerb Off road: None
Did not leave carr Age of Driver 76 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 76 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn and ind Cycle helmet: Not a cyclist

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from N to Parked No tow / articulation Leaving the main road
On main carriageway Skidded
Location at impact Cleared junction or waiting/park First impact Did not impact Hit vehicle:
Hit object in road Kerb Off road: None
Did not leave carr Age of Driver 52 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210330250 19/08/2021 Time 0640 Vehicles 2 Casualties 1 Serious
E:445694 N: 118940 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (ELECTRIC P/CYCLE) TRAVELLING S TO N ON SOUTHAMPTON ROAD FAILS TO NOTICE VEH 2 (VAN) IN FRONT TRAVELLING S TO N HAS STOPPED AND COLLIDES WITH REAR OF VEH 2
Occurred on SOUTHAMPTON ROAD EASTLEIGH

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 46 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 46 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 32 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

4421038343623/09/2021Time1956Vehicles2Casualties1Slight

E:444230N:116789First Road: A 335Road TypeDual carriageway

Speed limit: 50Junction Detail: RoundaboutGive way or controlledA 335

Crossing: Control NoneFacilities: None within 50mRoad surfaceDry

Darkness: street lights present and litFine without high winds

Special Conditions at Site NoneCarriageway Hazards: None

Place accident reported: At sceneDfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 001	Possible
2nd:	Poor turn or manoeuvre	Vehicle 001	Possible
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING N ON STONEHAM WAY TOWARDS JUNCTION 5 RBT FAILS TO SEE VEH 2 (CAR) TRAVELLING N ON SAME ROAD AND WAITING AT JUNCTION AND COLLIDES WITH REAR OF VEH 2
Occurred on A335 STONEHAM WAY NEAR JUNCTION 5 OF M27

Vehicle Reference1Car

Vehicle movement from S to N

On main carriageway

Location at impactJct Approach

Hit object in roadNone

Did not leave carr

Not hit and run

Going ahead other

No tow / articulation

No skidding, jack-knifing or overturning

First impactFront

Off road:None

Age of Driver50

Male

Breath testNegative

Left hand drive: No

Vehicle Reference2Taxi/Private hire car

Vehicle movement from S to N

On main carriageway

Location at impactMid Junction - on roundabout or r

Hit object in roadNone

Did not leave carr

Not hit and run

Going ahead but held up

No tow / articulation

No skidding, jack-knifing or overturning

First impactBack

Off road:None

Age of Driver48

Male

Breath testNegative

Left hand drive: No

Casualty Reference:1

Vehicle:2

Age:48

Male

Driver/rider

Severity: Slight

Not a pupil

SeatbeltNot Applicable

Cycle helmet:Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210432805 28/10/2021 Time 1452 Vehicles 2 Casualties 1 Slight
E:444358 N: 116884 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Automatic traffic signal Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:	Inexperienced or learner driver/rider	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SW AROUND THE RBT HAS CHANGED FROM THE CENTRE LANE TO THE LEFT LANE AND COLLIDED WITH THE NEARSIDE OF VEH2 (CAR) TRAVELLING SW AROUND THE RBT IN THE LEFT LANE.

Occurred on A335 STONEHAM WAY AT THE ROUNDABOUT JUNCTION WITH M27 JCT 5, EASLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Changing lane to left
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 22 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 62 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 35 Female
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44210489099 06/12/2021 Time 1342 Vehicles 2 Casualties 1 Slight
E:444708 N: 116708 First Road: U Road Type 1
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG WIDE LANE FAILS TO GIVE WAY AT RBT AND COLLIDES WITH VEH 2 (P/CYCLE) TRAVELLING W TO SE ON RBT
Occurred on ROUNDABOUT AT JUNCTION OF WIDE LANE BY ENTRANCE TO PREMIER INN

Vehicle Reference 1 Pedal Cycle Turning right
Vehicle movement from W to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 72 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 72 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Vehicle Reference 2 Car Turning right
Vehicle movement from NE to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 26 Female
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210508954 20/12/2021 Time 1832 Vehicles 2 Casualties 3 Slight
E:445672 N: 118743 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Impaired by alcohol	Vehicle 1	Very Likely
2nd:	Travelling too fast for conditions	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) HAD TURNED LEFT FROM BLENHEIM ROAD AT SPEED ONTO A335 SOUTHAMPTON ROAD TRAV NORTH, VEH 1 RAN WIDE AND COLLIDED HEAD ON WITH VEH 2 (PICK-UP) TRAV S ALONG SOUTHAMPTON ROAD.

Occurred on A335 SOUTHAMPTON ROAD APPROX 30 METRES FROM BLENHEIM ROAD, EASTLEIGH

Vehicle Reference 1 Car Going ahead left bend
Vehicle movement from W to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 26 Male
Not hit and run Breath test Positive
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 26 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Notes:

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44210513274 23/12/2021 Time 1400 Vehicles 2 Casualties 1 Slight
E:444229 N: 116792 First Road: A 335 Road Type 1
Speed limit: 50 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING GENERALLY N ALONG STONEHAM WY ENTERS RBT AND IS STRUCK FROM
BEHIND BY VEH 2 (CAR) WHICH HAS FAILED TO SLOW IN TIME
Occurred on ROUNDABOUT AT JUNCTION OF STONEHAM WAY/M27 BY MONKS BROOK PLAYING FIELDS

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 36 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 36 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 58 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44220046625 03/02/2022 Time 1104 Vehicles 1 Casualties 1 Slight
E:444583 N: 116648 First Road: M 27 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Loss of control	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SE TO NW ALONG THE M27 MOVES FROM LANE 1 TO 2 THEN LOSES CONTROL
AND COLLIDES WITH CENTRAL CRASH BARRIER
Occurred on M27 WESTBOUND APPROX 293 METRES SE OF JUNCTION 5

Vehicle Reference 1 Car Changing lane to right
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Did not impact Hit vehicle:
Hit object in road None Off road: Cent crash barrier
O/S onto cent res Age of Driver 50 Male
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 50 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220096347 10/03/2022 Time 1042 Vehicles 2 Casualties 1 Slight
E:444415 N: 116786 First Road: M 27 Road Type Dual carriageway
Speed limit: 60 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Vehicle blind spot	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (GOODS VEHICLE) TRAVELLING NW ALONG M27 IN LANE 1 CHANGES LANES AND CLIPS VEH 2 (CAR) TRAVELLING NW CAUSING IT TO SPIN AND COLLIDE WITH TRAILER
Occurred on M27 JUNCTION 5 STONEHAM BY MONKS BROOK

Vehicle Reference 1 Goods 7.5 tonnes mgw and over Changing lane to left
Vehicle movement from SE to NW Articulated Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 54 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway Skidded
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 40 Female
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 40 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Notes:

44220132519 04/04/2022 Time 1605 Vehicles 2 Casualties 1 Slight
E:445218 N: 117722 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Sudden braking	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 2 (M/CYCLE) TRAVELLING NE ON A335 SOUTHAMPTON ROAD FAILED TO STOP WHEN VEH 1 (CAR) IN
FRONT ALSO TRAVELLING NE ON A335 SOUTHAMPTON ROAD BRAKED FOR UNKNOWN VEHICLE
TURNING LEFT INTO SOUTH STREET, CAUSING VEH 2 TO COLLIDE WITH VEH 1.

Occurred on A335 SOUTHAMPTON ROAD, AT JUNCTION WITH SOUTH STREET, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Stopping
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 44 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Motor Cycle over 50 cc and up to 125cc Stopping
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 17 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 17 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220225028 07/06/2022 Time 1213 Vehicles 2 Casualties 1 Fatal
E:445693 N: 119213 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Loss of control	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING S ALONG A335 STATION HILL AT EXCESS SPEED, HAS LOST CONTROL, SWERVED INTO THE OPPOSITE SIDE OF THE CARRAIGEWAY AND SPUN INTO THE PATH OF VEH2 (GOODS VEH) TRAVELLING N ALONG A335 STATION HILL.

Occurred on A335 STATION HILL, APPROX 55 METERS S OF JUNCTION WITH ROMSEY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 26 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 26 Male Driver/rider Severity: Fatal
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Vehicle Reference 2 Goods 7.5 tonnes mgw and over Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 47 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44220251585 24/06/2022 Time 1242 Vehicles 1 Casualties 1 Serious
E:445731 N: 119170 First Road: B 3037 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled B 3037
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Defective steering or suspension	Vehicle 1	Very Likely
2nd:	Slippery inspection cover or road marking	Vehicle 1	Possible
3rd:			
4th:			
5th:			
6th:			

VEH 1 (M/CYCLE) LOST CONTROL TRAV E ON BISHOPSTOKE RD ROUNDING A LEFT HAND BEND CAUSING
VEH TO EXIT OFFSIDE INTO BARRIERS CAUSING INJURY TO CAS 1 (RIDER).
Occurred on B3037 BISHOPSTOKE RD, AT JCT WITH B3037, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Motorcycle over 500cc Going ahead left bend
Vehicle movement from N to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: Oth perm objects
O/S & rebounded Age of Driver 35 Female
Not hit and run Breath test Not applicable Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 35 Female Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220254230 25/06/2022 Time 1800 Vehicles 1 Casualties 1 Slight
E:445630 N: 118849 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

CAS1 TRIPPED UP WHEN ENTERING VEH1 (BUS) WHICH WAS STATIONARY ALONG WELLS PLACE
Occurred on WELLS PLACE AT JUNCTION WITH MITCHELL ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Bus or coach Parked
Vehicle movement from Park to Parked No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Did not impact Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 47 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 51 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Not car passenger Alighting

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220275089 09/07/2022 Time 2115 Vehicles 2 Casualties 2 Slight
E:445563 N: 118373 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (M/CYCLE) TRAVELLING E ALONG DERBY ROAD PULLS OUT ONTO A335 SOUTHAMPTON ROAD AND COLLIDES INTO OFFSIDE OF VEH1 (CAR) TRAVELLING S ALONG A335 SOUTHAMPTON ROAD. VEH2 FAILS TO STOP
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 18 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 18 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 17 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Motorcycle - unknown cc Turning right
Vehicle movement from W to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220318571 07/08/2022 Time 1014 Vehicles 2 Casualties 1 Slight
E:444229 N: 116787 First Road: A 335 Road Type Slip road
Speed limit: 40 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to judge other persons path or speed	Vehicle 2	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAV NE ALONG STONEHAM WAY, ENTERING RBT IS STUCK FROM BEHIND BY VEH2 (CAR) TRAV NE ALONG STONEHAM WAY, WHICH HAS FAILED TO JUDGE VEH1 MOVING OFF, CAUSING MINOR INJURY TO CAS1 (VEH1 PASSENGER).

Occurred on STONEHAM WAY A335 SLIP RD, AT JCT WITH A335 STONEHAM INTERCHANGE RBT, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 38 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 4 Male Passenger Severity: Slight
Not a pupil
Seatbelt Unknown Cycle helmet: Not a cyclist

Back seat

Vehicle Reference 2 Car Starting
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220342386 22/08/2022 Time 1230 Vehicles 2 Casualties 1 Slight
E:444737 N: 116439 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 2	Possible
2nd:	Failed to look properly	Vehicle 2	Possible
3rd:			
4th:			
5th:			
6th:			

VEH2 (LORRY) TRAV NW ALONG M27 IN LANE 1, CHANGED LANE TO THE RIGHT AND COLLIDED WITH VEH1 (CAR) TRAV NW ALONG M27 IN LANE 2, CAUSING MINOR INJURY TO CAS1 (DRIVER VEH1).
Occurred on M27 W/BOUND, 320 M SE OF JCT 5 SLIP RD, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 31 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 31 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Unknown Cycle helmet: Not a cyclist

Vehicle Reference 2 Goods vehicle - unknown weight Changing lane to right
Vehicle movement from SE to NW Articulated Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220344763 24/08/2022 Time 1723 Vehicles 2 Casualties 1 Serious
E:444213 N: 116817 First Road: M 27 Road Type Slip road
Speed limit: 70 Junction Detail: Slip Road Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Other	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

BOTTLE UNDER BRAKE PEDAL
VEH 1 (CAR) TRAVELLING N TO S ALONG M27 OFFSLIP COLLIDES WITH REAR OF VEH 2 (CAR) ALSO TRAVELLING N TO S ALONG M37 OFFSLIP
Occurred on JUNCTION 7 WESTBOUND M27 OFFSLIP, STONEHAM

Vehicle Reference 1 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 51 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 32 Male Passenger Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 38 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220359186 03/09/2022 Time 1137 Vehicles 1 Casualties 1 Serious
E:445710 N: 119272 First Road: A 335 Road Type 1
Speed limit: 30 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Loss of control	Vehicle 1	Very Likely
2nd:	Other	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

NEW TYRES
VEH1 (M/CYCLE) TRAVELLING AROUND THE ROUNDABOUT, LOST CONTROL CAUSING THE RIDER TO FALL
Occurred on A335 ROMSEY ROAD AT ROUNDABOUT WITH A335 STATION HILL, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Motorcycle over 500cc Turning right
Vehicle movement from W to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Did not impact Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 59 Male
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 59 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220394062 27/09/2022 Time 2123 Vehicles 3 Casualties 4 Slight
E:445578 N: 118402 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG A335 FAILS TO SLOW, COLLIDING WITH VEH 2 (CAR) ALSO TRAV SW WHICH THEN COLLIDES WITH VEH 3 (CAR) ALSO TRAV SW ALONG A335
Occurred on CAR PARK OPPOSITE 234 SOUTHAMPTON ROAD, 30 METRES NE OF JUNCTION WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 34 Female
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 2 Vehicle: 1 Age: 13 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Back seat

Casualty Reference: 3 Vehicle: 1 Age: 13 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Front seat

Casualty Reference: 4 Vehicle: 1 Age: 13 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Back seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference	2	Car	Going ahead but held up
Vehicle movement from	NE to SW	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Not at, or within 20M of Jct	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	18
Not hit and run	Breath test	Negative	Male
		Left hand drive:	No

Casualty Reference:	1	Vehicle:	2	Age:	18	Male	Driver/rider	Severity:	Slight
Not a pupil									
Seatbelt Not Applicable									
Cycle helmet: Not a cyclist									

Vehicle Reference	3	Car	Going ahead but held up
Vehicle movement from	NE to SW	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Not at, or within 20M of Jct	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	43
Not hit and run	Breath test	Negative	Male
		Left hand drive:	No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44220392891 27/09/2022 Time 0848 Vehicles 2 Casualties 1 Slight
E:445523 N: 118282 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SW ALONG SOUTHAMPTON ROAD FAILED TO STOP IN TIME AND COLLIDED WITH VEH2 (CAR) TRAVELLING SW ALONG SOUTHAMPTON ROAD, SLOWING FOR TRAFFIC AHEAD
Occurred on A335 SOUTHAMPTON ROAD, 94 METERS SW OF JUNCTION WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 19 Female
Not hit and run Breath test Not requested Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 19 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 55 Female
Not hit and run Breath test Not requested Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44220493942 06/12/2022 Time 1623 Vehicles 2 Casualties 1 Slight
E:445698 N: 119066 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st: Cyclist entering road from pavement	Vehicle 1	Very Likely	
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (VAN) TRAVELLING N ALONG A335 STATION HILL COLLIDED WITH VEH1 (P/CYCLE) WHO CROSSED
A335 STATION HILL TRAVELLING W.
Occurred on A335 STATION HILL AT JUNCTION WITH LEIGH ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 14 Male
Not hit and run Breath test Not applicable
Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 14 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 37 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230031918 24/01/2023 Time 1426 Vehicles 1 Casualties 1 Serious
E:445625 N: 118852 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

CAS 1 (PEDESTRIAN) CROSSING WELLS PLACE NORTHWARD IS STRUCK BY VEH 1 (CAR) REVERSING AROUND CORNER N TO E FROM MITCHELL ROAD TO WELLS PLACE
Occurred on JUNCTION OF MITCHELL ROAD/WELLS PLACE, SWAN CENTRE,EASTLEIGH

Vehicle Reference 1 Taxi/Private hire car Reversing
Vehicle movement from N to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering main road First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 54 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 81 Male Pedestrian Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

In carr elsewhere N bound

Driver's nearside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230097134 10/03/2023 Time 1535 Vehicles 2 Casualties 2 Slight
E:445662 N: 118704 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: Mini roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Sudden braking	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING N ALONG A335 SOUTHAMPTON ROAD SLOWED FOR THE MINI RBT AT
BLENHEIM ROAD. VEH 2 (CAR) FAILED TO REACT IN TIME AND COLLIDED WITH THE REAR OF VEH 1.
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH BLENHEIM ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 40 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 40 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 9 Female Passenger Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Back seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 24 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230142896 03/04/2023 Time 1624 Vehicles 1 Casualties 1 Slight
E:445184 N: 117846 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Casualty 1	Very Likely
2nd:	Failed to look properly	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG DONCASTER ROAD DROVE OVER THE FOOT OF CAS 1
(PEDESTRIAN) WHO WAS A POSTMAN WALKING AROUND TO THE DRIVER'S DOOR OF HIS VAN.
Occurred on DONCASTER ROAD OUTSIDE NUMBER 103, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 85 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 70 Male Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

In carr not crossing NW bound

Movement U/K

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230135509 06/04/2023 Time 0854 Vehicles 2 Casualties 1 Slight
E:445541 N: 118550 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Crossroads Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Disobeyed Give Way or Stop sign or markings	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (VAN) TRAVELLING E ALONG GRANTHAM ROAD FAILED TO GIVE WAY AT THE JUNCTION AND PULLED OUT INTO THE PATH OF VEH2 (CAR) TRAVELLING S ALONG MARKET STREET CAUSING A COLLISION

Occurred on MARKET STREET AT JUNCTION WITH GRANTHAM ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 59 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 58 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 58 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230190893 15/05/2023 Time 1325 Vehicles 1 Casualties 1 Slight
E:444580 N: 116660 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Loss of control	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING NW ALONG M27 LOST CONTROL AND COLLIDED WITH THE CENTRAL
RESERVATION CAUSING VEH1 TO OVERTURN
Occurred on M27 WESTBOUND, 355 METERS SE OF MARKER POST 19. EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway Overturned
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: Cent crash barrier
O/S onto cent res & rebounded Age of Driver 32 Female
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 32 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230204672 23/05/2023 Time 1825 Vehicles 2 Casualties 1 Slight
E:444229 N: 116777 First Road: A 335 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING N ALONG STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED WITH
VEH1 (CAR) TRAVELLING N ALONG STONEHAM WAY, WAITING TO ENTER THE ROUNDABOUT
Occurred on A335 STONEHAM WAY AT ROUNDABOUT WITH M27, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 53 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 53 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230219978 03/06/2023 Time 1819 Vehicles 2 Casualties 1 Serious
E:444261 N: 116762 First Road: A 335 Road Type Dual carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 1	Possible
2nd:	Sudden braking	Vehicle 1	Possible
3rd:	Failed to judge other persons path or speed	Vehicle 1	Possible
4th:	Failed to look properly	Vehicle 2	Possible
5th:			
6th:			

VEH2 (CAR) TRAVELLING S ALONG STONEHAM WAY STOPPED FOR VEHICLE AHEAD AND WAS STRUCK ON THE NEARSIDE BY VEH1 (CAR) TRAVELLING S ALONG STONEHAM WAY CHANGING LANES
Occurred on A335 STONEHAM WAY AT ROUNDABOUT WITH M27, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Changing lane to right
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 39 Female Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230229973 10/06/2023 Time 1355 Vehicles 3 Casualties 2 Slight
E:444224 N: 116720 First Road: A 335 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 3	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 3 (CAR) TRAVELLING N ALONG A335 STONEHAM WAY FAILED TO SLOW IN TIME FOR TRAFFIC
APPROACHING THE M27 JUNCTION 5 RBT AND COLLIDED WITH THE REAR OF VEH 1 (CAR), PUSHING VEH
1 INTO THE REAR OF VEH 2 (CAR).

Occurred on A335 STONEHAM WAY 62 METRES SOUTH OF M27 JUNCTION 5 ROUNDABOUT, NORTH
STONEHAM, HAMPSHIRE

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 24 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 24 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 63 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference	3	Car	Going ahead other
Vehicle movement from	S	to N	No tow / articulation
On main carriageway			Leaving the main road
Location at impact	Not at, or within 20M of Jct	First impact	No skidding, jack-knifing or overturning
Hit object in road	None	Off road:	Front
Did not leave carr		Age of Driver	Hit vehicle:
Not hit and run	Breath test	Driver not contacted	25
		Left hand drive:	Male
			No
Casualty Reference:	2	Vehicle: 3	Age: 51
Not a pupil			Male
Seatbelt	Worn but not i	Cycle helmet:	Passenger
			Severity: Slight
Front seat			

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230240583 17/06/2023 Time 1150 Vehicles 1 Casualties 1 Slight
E:443931 N: 116941 First Road: M 27 Road Type Slip road A 335
Speed limit: 70 Junction Detail: Slip Road Give way or controlled
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Careless/Reckless/In a hurry	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING E ON M27 JUNCTION 5 OFFSLIP STOPPED AFTER A PREVIOUS RTI AND MOVED
OFF BEFORE EXCHANGING DETAILS WITH CAS 1 (PEDESTRIAN), COLLIDING WITH CAS 1'S LEG IN THE
PROCESS.

Occurred on M27 EASTBOUND AT JUNCTION 5 OFFSLIP, NORTH STONEHAM, HAMPSHIRE

Vehicle Reference 1 Car Starting
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 25 Female Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
In carr not crossing Standing still
In carr not crossing

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230295301 22/07/2023 Time 1630 Vehicles 2 Casualties 3 Slight
E:445563 N: 118375 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING E ALONG DERBY ROAD TURNED LEFT ONTO SOUTHAMPTON ROAD INFRONT
OF VEH2 (CAR) TRAVELLING NE ALONG SOUTHAMPTON ROAD CAUSING A COLLISION
Occurred on A335 SOUTHAMPTON ROAD AT JUNCTION WITH DERBY ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Turning left
Vehicle movement from W to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering main road First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 7 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Back seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference2CarGoing ahead but held up

Vehicle movement fromSW to NENo tow / articulationLeaving the main road

On main carriagewayNo skidding, jack-knifing or overturning

Location at impactJct ApproachFirst impactNearsideHit vehicle:

Hit object in roadNoneOff road: None

Did not leave carrAge of Driver59Female

Not hit and runBreath testNegative

Left hand drive: No

Casualty Reference: 2Vehicle: 2Age: 59FemaleDriver/riderSeverity: Slight

Not a pupil

Seatbelt Not ApplicableCycle helmet: Not a cyclist

Casualty Reference: 3Vehicle: 2Age: 61FemalePassengerSeverity: Slight

Not a pupil

Seatbelt Not ApplicableCycle helmet: Not a cyclist

Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230321107 09/08/2023 Time 1642 Vehicles 1 Casualties 1 Slight
E:445616 N: 118852 First Road: U Road Type Single carriageway
Speed limit: 20 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING W ALONG WELLS PLACE STOPPED IN THE ROAD AND THEN REVERSED, COLLIDING AT LOW SPEED WITH CAS 1 (PEDESTRIAN) WHO WAS CROSSING S BEHIND VEH 1.
Occurred on WELLS PLACE AT JUNCTION WITH MITCHELL ROAD, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Reversing
Vehicle movement from W to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 57 Male
Not hit and run Breath test Not requested Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 71 Female Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
In carr elsewhere S bound
Driver's offside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230357004 03/09/2023 Time 1611 Vehicles 4 Casualties 4 Slight
E:445207 N: 117707 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 4 (CAR) TRAV NE A335 WIDE LANE STOPPED BEHIND U/K VEHICLE WHICH STOPPED AT GREEN LIGHTS TO ALLOW PEDESTRIANS TO CROSS. VEH 3 (M/CYCLE) STOPPED BEHIND FOLLOWED BY VEH 2 (CAR). VEH 1 (CAR) COLLIDED WITH VEH 2 PUSHING IT INTO VEH 3 AND VEH 3 INTO VEH 4.
Occurred on A335 WIDE LANE AT JUNCTION WITH SOUTH STREET, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 44 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 44 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead but held up
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference	3	Motorcycle over 500cc	Going ahead but held up
Vehicle movement from	SW to NE	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Jct Approach	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	56
Not hit and run	Breath test	Negative	Male
		Left hand drive:	No

Casualty Reference:	4	Vehicle:	3	Age:	56	Male	Driver/rider	Severity:	Slight
Not a pupil									
Seatbelt	Unknown	Cycle helmet:	Not a cyclist						

Vehicle Reference	4	Car	Going ahead but held up
Vehicle movement from	SW to NE	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Jct Approach	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	44
Not hit and run	Breath test	Negative	Female
		Left hand drive:	No

Casualty Reference:	2	Vehicle:	4	Age:	44	Female	Driver/rider	Severity:	Slight
Not a pupil									
Seatbelt	Worn but not i	Cycle helmet:	Not a cyclist						

Casualty Reference:	3	Vehicle:	4	Age:	44	Male	Passenger	Severity:	Slight
Not a pupil									
Seatbelt	Worn but not i	Cycle helmet:	Not a cyclist						
Front seat									

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230368810 10/09/2023 Time 1432 Vehicles 2 Casualties 4 Slight
E:444934 N: 117213 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Pri Drive Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:	Failed to judge other persons path or speed	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SW ALONG WIDE LANE TURNED RIGHT INTO THE SPORTS GROUND ACROSS
THE PATH OF VEH2 (CAR) TRAVELLING NE ALONG WIDE LANE, CAUSING A COLLISION
Occurred on A335 WIDE LANE AT JUNCTION WITH ENTRANCE TO SPORTS GROUND, EASTLEIGH,
HAMPSHIRE

Vehicle Reference 1 Car Turning right
Vehicle movement from NE to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or i First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 52 Female
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 3 Vehicle: 1 Age: 52 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 4 Vehicle: 1 Age: 13 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 80 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 80 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 2 Age: 79 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230388489 23/09/2023 Time 0940 Vehicles 2 Casualties 1 Slight
E:444207 N: 116819 First Road: M 27 Road Type 1
Speed limit: 70 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING AROUND THE M27 JUNCTION 5 ROUNDABOUT CUT ACROSS THE LANES TO ENTER THE M27 WESTBOUND AND CUT ACROSS THE PATH OF VEH2 (M/CYCLE) TRAVELLING AROUND THE ROUNDABOUT INTENDING TO TRAVEL N ALONG STONEHAM LANE, CAUSING A COLLISION.
Occurred on M27 JUNCTION 5 ROUNDAOUT WITH A335 STONEHAM WAY, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Changing lane to left
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Nearside Age of Driver 74 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Motorcycle over 500cc Going ahead right bend
Vehicle movement from E to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 37 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 37 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44230401958 30/09/2023 Time 1300 Vehicles 1 Casualties 1 Serious
E:445592 N: 118854 First Road: U Road Type Single carriageway
Speed limit: 20 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (MOBILITY SCOOTER) TRAVELLING E ALONG THE PAVEMENT OF WELLS PLACE FAILED TO STOP IN TIME AND COLLIDED WITH CAS1 (PEDESTRIAN) TRAVELLING E ALONG THE PAVEMENT OF WELLS PLACE, STOPPING TO ASK FOR DIRECTIONS
Occurred on WELLS PLACE AT JUNCTION WITH MARKET STREET, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Mobility Scooter Going ahead other
Vehicle movement from W to E No tow / articulation Leaving the main road
9 No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 79 Female Pedestrian Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist
On footpath / verge E bound
Movement U/K

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230416999 11/10/2023 Time 1920 Vehicles 2 Casualties 2 Slight
E:444229 N: 116775 First Road: A 335 Road Type Dual carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Inexperienced or learner driver/rider	Vehicle 2	Very Likely
2nd:	Failed to judge other persons path or speed	Vehicle 2	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING NE ALONG STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED WITH
VEH1 (CAR) ALSO TRAVELLING NE ALONG STONEHAM WAY, WAITING TO ENTER THE ROUNDABOUT
Occurred on A335 STONEHAM WAY AT ROUNDABOUT WITH M27, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 29 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 33 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44230520823 21/12/2023 Time 1630 Vehicles 1 Casualties 1 Serious
E:443799 N: 116888 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Fine with high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Illness or disability, mental or physical	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

CAS1 (DRIVER) OF VEH1 (CAR) TRAVELLING W ALONG THE M27 SUFFERED A MEDICAL EPISODE AND LOST CONTROL BEFORE COLLIDING WITH THE CENTRAL RESERVATION AND REBOUNDED ACROSS THE CARRIAGEWAY, COLLIDING WITH THE NEARSIDE CRASH BARRIER
Occurred on M27 WESTBOUND, 519 METERS NE OF MARKER POST 18, NORTH STONEHAM, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: Cent crash barrier
O/S onto cent res & rebounded Age of Driver 42 Male
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 42 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44240021676 16/01/2024 Time 0542 Vehicles 1 Casualties 1 Slight
E:444725 N: 116799 First Road: U Road Type Single carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Frost/Ice
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Fatigue	Vehicle 1	Very Likely
2nd:	Slippery road (due to weather)	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING SW ALONG WIDE LANE LOST CONTROL AND LEFT THE CARRIAGEWAY TO THE OFFSIDE BEFORE COLLIDING WITH A FENCE
Occurred on WIDE LANE , 97 METERS NE OF ROUNDABOUT WITH MITCHELL WAY, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: Wall or fence
O/S Age of Driver 56 Male
Not hit and run Breath test Negative Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 56 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44240046252 01/02/2024 Time 0910 Vehicles 2 Casualties 1 Slight
E:444596 N: 116637 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Slip Road Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:	Careless/Reckless/In a hurry	Vehicle 1	Possible
3rd:			
4th:			
5th:			
6th:			

VEH 1 (LORRY) TRAVELLING NW ALONG M27 IN LANE 1 LEADING TO JUNCTION 5 OFFSLIP WANTED TO CONTINUE ON M27. VEH 1 CHANGED LANES TO RIGHT AND COLLIDED WITH THE NEARSIDE OF VEH 2 (CAR) IN LANE 2.

Occurred on M27 WESTBOUND AT JUNCTION 5 OFFSLIP, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Goods 7.5 tonnes mgw and over Changing lane to right
Vehicle movement from SE to NW Articulated Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 28 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 46 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 46 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("AW
A335 EASTLEIGH BACS/SR/1124/183")

44240056267 07/02/2024 Time 1511 Vehicles 1 Casualties 1 Slight
E:445616 N: 119260 First Road: A 335 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: Footbridge or subway Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Casualty 1	Very Likely
2nd:	Disability or illness, mental or physical	Casualty 1	Possible
3rd:			
4th:			
5th:			
6th:			

CAS1 (PEDESTRIAN) TRAVELLING SE ACROSS ROMSEY ROAD ENTERED THE CARRIAGEWAY FROM
BETWEEN STATIONARY TRAFFIC INTO THE PATH OF VEH1 (CAR) TRAVELLING NE ALONG ROMSEY
ROAD, CAUSING A COLLISION.

Occurred on A335 ROMSEY ROAD AT JUNCTION WITH UPPER MARKET STREET, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 84 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 15 Male Pedestrian Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Within 50m ped crossing SE bound
Driver's nearside masked

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44240095045 04/03/2024 Time 1950 Vehicles 2 Casualties 1 Slight
E:444228 N: 116781 First Road: A 335 Road Type Single carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Slippery road (due to weather)	Vehicle 1	Possible
2nd:	Failed to judge other persons path or speed	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAV N ALONG A335 STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED WITH THE REAR OF VEH 2 (CAR) WHICH WAS STATIONARY AND WAITING TO ENTER THE STONEHAM INTERCHANGE RBT AT M27 JUNCTION 5. THE IMPACT PUSHED VEH 2 ONTO THE RBT.

Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27 JUNCTION 5 STONEHAM INTERCHANGE, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 21 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 29 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn and ind Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

4424010407110/03/2024Time1528Vehicles1Casualties1Slight

E:445588N:118857First Road: URoad TypeSingle carriageway

Speed limit: 30Junction Detail: T & Stag JctGive way or controlledUnclassified

Crossing: Control NoneFacilities: None within 50mRoad surfaceWet/Damp

DaylightFine without high winds

Special Conditions at Site NoneCarriageway Hazards: None

Place accident reported: At sceneDfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Vehicle blind spot	Vehicle 1	Possible
2nd:	Careless/Reckless/In a hurry	Vehicle 1	Possible
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) WAS TRAVELLING E ALONG WELLS PLACE. CAS 1 (PEDESTRIAN) CROSSED FROM THE OFFSIDE, INITIALLY STOPPING BELIEVING VEH 1 WAS GOING TO WAIT. VEH 1 THEN MOVED OFF AND COLLIDED WITH CAS 1 AND THEN CONTINUED AHEAD, RUNNING OVER CAS 1'S ANKLE.
Occurred on WELLS PLACE AT JUNCTION WITH MARKET STREET, EASTLEIGH, HAMPSHIRE

Vehicle Reference1CarStarting

Vehicle movement from W to ENo tow / articulationLeaving the main road

On main carriagewayNo skidding, jack-knifing or overturning

Location at impactJct ApproachFirst impactFrontHit vehicle:

Hit object in roadNoneOff road: None

Did not leave carrAge of Driver70Male

Hit and runBreath testDriver not contacted

Left hand drive: No

Casualty Reference: 1Vehicle: 1Age: 19MalePedestrianSeverity: Slight

Not a pupil

Seatbelt Not ApplicableCycle helmet: Not a cyclist

In carr elsewhereN bound

Driver's offside

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

4424012060521/03/2024Time 0639Vehicles 2Casualties 1Slight

E:444525N: 116734First Road: M 27Road Type Dual carriageway

Speed limit: 70Junction Detail: Slip RoadGive way or controlledA 335

Crossing: Control NoneFacilities: None within 50mRoad surface Dry

DaylightFine without high winds

Special Conditions at Site NoneCarriageway Hazards: None

Place accident reported: At sceneDfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (VAN) TRAVELLING SE ALONG M27 CHANGED LANES TO THE RIGHT AND COLLIDED WITH THE NEARSIDE OF VEH 2, CAUSING VEH 1 TO SPIN AND COLLIDE WITH THE NEARSIDE CRASH BARRIER BEFORE COMING TO REST IN THE CARRIAGEWAY.

Occurred on M27 EASTBOUND AT JUNCTION 5 ONSLIP FROM A335, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1Van or Goods 3.5 tonnes mgw and underChanging lane to right

Vehicle movement from NW to SENo tow / articulationLeaving the main road

On main carriagewaySkidded

Location at impactJct ApproachFirst impact OffsideHit vehicle:

Hit object in road NoneOff road: Cent crash barrier

O/S onto cent resAge of Driver 50Male

Not hit and runBreath test Not requested

Left hand drive: No

Casualty Reference: 1Vehicle: 1Age: 50MaleDriver/riderSeverity: Slight

Not a pupil

Seatbelt Worn but not iCycle helmet: Not a cyclist

Vehicle Reference 2CarGoing ahead other

Vehicle movement from NW to SENo tow / articulationLeaving the main road

On main carriagewayNo skidding, jack-knifing or overturning

Location at impactJct ApproachFirst impact NearsideHit vehicle:

Hit object in road NoneOff road: None

Did not leave carrAge of Driver 43Male

Not hit and runBreath test Not requested

Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

44240171177 24/04/2024 Time 1131 Vehicles 2 Casualties 1 Slight
E:444322 N: 116791 First Road: M 27 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Automatic traffic signal Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Distraction outside vehicle	Vehicle 2	Very Likely
2nd:	Failed to look properly	Vehicle 2	Very Likely
3rd:	Failed to judge other persons path or speed	Vehicle 2	Very Likely
4th:	Sudden braking	Vehicle 1	Very Likely
5th:			
6th:			

VEH 1 (CAR) TRAVELLING NW ALONG M27 WESTBOUND JUNCTION 5 OFFSLIP BRAKED SUDDENLY DUE TO A POLICE VEHICLE PASSING ON THE RBT RESPONDING TO AN EMERGENCY CALL. VEH 2 (LORRY) THEN COLLIDED WITH THE REAR OF VEH 1.

Occurred on M27 WESTBOUND JUNCTION 5 OFFSLIP AT JUNCTION WITH STONEHAM INTERCHANGE, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Stopping
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 30 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 30 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Unknown Cycle helmet: Not a cyclist

Vehicle Reference 2 Goods over 3.5 tonnes and under 7.5 to Starting
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 61 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("AW A335 EASTLEIGH BACS/SR/1124/183")

Accidents involving:


	Fatal	Serious	Slight	Total
Motor vehicles only (excluding 2-wheels)	1	8	55	64
2-wheeled motor vehicles	0	4	9	13
Pedal cycles	0	6	11	17
Horses & other	0	1	0	1
Total	1	18	75	94

Casualties:

	Fatal	Serious	Slight	Total
Vehicle driver	1	4	44	49
Passenger	0	1	24	25
Motorcycle rider	0	3	9	12
Cyclist	0	6	10	16
Pedestrian	0	4	10	14
Other	0	0	0	0
Total	1	18	97	116

E	N	Location	Veh	Severity	Cause
1	444228	116785 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Failed to slow - rear end shunt
2	445670	119376 Twyford Road / The Crescent	Car	Slight	Misleading signal resulted in vehicle pulling out into junction
3	444326	116797 Stoneham Interchange (M27 WB Offslip)	Car	Slight	Building, road signs, street furniture clipped kerb and flipped onto side
4	443797	116912 M27 EB off-slip	Car	Serious	Loss of control due to substance
5	445423	118081 Southampton Road / Chestnut Avenue	Car	Slight	Failure to give way
6	444609	117047 A335	Car	Slight	Lost control due to wet weather
7	445330	118105 Chestnut Avenue	MC	Slight	Inexperience/learner driver and wet weather conditions
8	444278	116846 M27 WB	Car	Slight	Vehicles following too closely and sudden braking - rear end shunt
9	445543	118320 Southampton Road	Car	Slight	Poor turn / manoeuvre
10	444236	116940 Stoneham Interchange	MC	Slight	Car failed to slow/stop and went into MC
11	444976	117287 Wide Lane	Cycle	Serious	Car overtook cyclist too closely and knocked cyclist off bike
12	445071	117472 Wide Lane	Cycle	Slight	Cyclist entered the junction from pavement into the path of oncoming vehicle
13	444096	117059 Stoneham Lane	Cycle	Slight	Cycle impaired by alcohol fell off bike
14	445697	119262 Twyford Road / Romsey Road roundabout	Cycle	Slight	Vehicle failed to give way and collided with cyclist
15	445596	118934 Market Street	MC	Slight	Defective brakes
16	445932	119166 Bishopstoke Road	Cycle	Serious	MC failed to give way, crossed cycle path and collided with a cyclist on the cycle path
17	445698	119076 Station Hill / Leigh Road	MC	Slight	Distraction in vehicle (coughing fit)
18	444330	117002 Stoneham Interchange (Stoneham Lane arm)	Car	Slight	Vehicle failed to give way and sudden braking
19	445660	118649 Southampton Road	Cycle	Slight	Car disobeyed road signs and collided with cyclist
20	445527	118296 Southampton Road	MC	Serious	MC overtook stationary vehicle into oncoming car
21	443749	116905 M27 EB off-slip	Car	Slight	Failed to slow - rear end shunt
22	444859	117074 Wide Lane	Cycle	Slight	Car too close to cyclist and clipped them
23	445705	119067 Station Hill / Leigh Road	Car	Slight	Failed to look properly
24	446095	119177 Bishopstoke Road	Cycle	Slight	Car failed to give way to cyclist
25	444715	117012 A335 / Wide Lane roundabout	Car	Serious	Road rage incident
26	445617	119071 Leigh Road / Upper Market Street	Ped	Slight	Car turned into pedestrian crossing road
27	445409	118077 Southampton Road / Chestnut Avenue	Ped	Slight	Car turned into pedestrian crossing road
28	445620	119075 Leigh Road / Upper Market Street	Ped	Slight	Cyclist (no lights) collided with pedestrian crossing the road
29	445563	118374 Southampton Road / Derby Road	Cycle	Serious	Car turned into path of cyclist (failure to give way)
30	444268	116767 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Car changed lane and collided with rear of vehicle in front (rear end shunt)
31	444316	116795 Stoneham Interchange (M27 WB Offslip)	Car	Slight	Car ran red light and collided with another vehicle
32	445655	118718 Southampton Road / Blenheim Road	Cycle	Slight	Car collided with cyclist - unable to see due to bright sun
33	445708	119145 Bishopstoke Road / Station Hill	MC	Slight	Car failed to slow down - rear end shunted MC
34	444670	116550 M27 WB Off-slip	Car	Slight	Failed to slow at junction resulting in rear end shunt
35	445634	119259 Romsey Road	Car	Slight	Distraction outside of vehicle (friend) and failed to stop at red light
36	445416	118394 Derby Road / High Street	Ped	Serious	Pedestrian crossing road failed to look properly / judge vehicles path or speed
37	445675	118816 Southampton Road / Wells Place	Car	Slight	Following too closely
38	444326	116794 Stoneham Interchange (M27 WB Offslip)	Car	Slight	Drivers foot slipped off clutch
39	444603	116672 M27 EB On-slip	Car	Slight	Car travelling too fast fails to stop - rear end shunt
40	444231	116776 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Driver failed to look before proceeding onto roundabout and pulled out into rear of vehicle in front
41	444714	117010 A335 / Wide Lane roundabout	Cycle	Serious	Vehicle failed to give way to cyclist already on roundabout
42	445699	118951 Southampton Road	Ped	Slight	Pedestrian deliberately stepped into path of vehicle
43	445698	119073 Station Hill / Leigh Road	Car	Slight	Rear end shunt - vehicle failed to stop
44	444918	117172 Wide Lane	Car	Slight	Car failed to slow - rear end shunt
45	445654	118614 Southampton Road	Cycle	Slight	Cyclist (no lights/darkclothing/headphones) veered into path of vehicle
46	444724	116787 Wide Lane	Cycle	Serious	Cyclist clipped railings and went over handlebars
47	445561	118374 Southampton Road / Derby Road	Car	Slight	Driver not looking properly collided with another vehicle
48	445547	118329 Southampton Road	Ped	Serious	Goods vehicle collided with gliders of another goods vehicle, knocking them onto pedestrians' ankle
49	444377	116942 Stoneham Interchange	Car	Slight	Vehicle in wrong lane cut across and collided with adjacent vehicle
50	444805	117034 Wide Lane	Car	Slight	Car failed to look properly and turned right in error, colliding with oncoming vehicle
51	445694	118940 Southampton Road	Cycle	Serious	Electric cyclist failed to stop and collided with vehicle
52	444230	116789 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Failed to slow - rear end shunt
53	444358	116884 Stoneham Interchange	Car	Slight	Learner driver - changed lanes without looking properly
54	444708	116708 Spitfire roundabout	Cycle	Slight	Car failed to give way
55	445672	118743 Southampton Road	Car	Slight	Impaired by alcohol / travelling too fast
56	444229	116792 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Car failed to slow in time - rear end shunt
57	444583	116648 M27 WB	Car	Slight	Loss of control
58	444415	116786 M27 WB	Car	Slight	Goods vehicle changed lane and collided with vehicle in blind spot
59	445218	117722 Wide Lane / South Street	MC	Slight	MC failed to slow in time
60	445693	119213 Station Hill	Car	Fatal	Vehicle travelling at excess speed lost control and spun into path of oncoming goods vehicle
61	445731	119170 Bishopstoke Road	MC	Serious	MC lost control - suspected defective steering/suspension and/or slippery inspection cover or road marking
62	445630	118849 Wells Place / Mitchell Road	Bus	Slight	Person tripped up entering stationary bus
63	445563	118373 Southampton Road / Derby Road	MC	Slight	Car failed to stop
64	444229	116787 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Car failed to judge speed of vehicle in front causing rear end shunt
65	444737	116439 M27 WB	Car	Slight	Driver failed to look properly and undertook as poor turn/manoeuvre
66	444213	116817 Stoneham Interchange (M27 WB Onslip)	Car	Serious	Bottle under brake pedal
67	445710	119272 Twyford Road / Romsey Road roundabout	MC	Serious	MC driver lost control on roundabout
68	445578	118402 Southampton Road	Car	Slight	Car following too closely - rear end shunt
69	445523	118282 Southampton Road	Car	Slight	Car following too closely - rear end shunt
70	445698	119066 Station Hill / Leigh Road	Cycle	Slight	Cyclist entered road from pavement in path of vehicle
71	445625	118852 Wells Place / Mitchell Road	Ped	Serious	Ped struck by vehicle reversing round corner - poor turn / manoeuvre
72	445662	118704 Southampton Road / Blenheim Road	Car	Slight	Sudden braking and failure to slow in time
73	445184	117846 Doncaster Road	Car	Slight	Failure to look properly
74	445541	118550 Market Street / Grantham Road	Car	Slight	Failed to give way
75	444580	116660 M27 WB	Car	Slight	Loss of control
76	444229	116777 Stoneham Interchange (Stoneham Way arm)	Car	Slight	Failed to stop in time - rear end shunt
77	444261	116762 Stoneham Interchange (Stoneham Way arm)	Car	Serious	Poor turn or manoeuvre / sudden braking / failed to look properly & failed to judge other person speed or path
78	444224	116720 Stoneham Way A335	Car	Slight	Following too closely
79	443931	116941 M27 EB off-slip	Ped	Slight	Careless/reckless/in a hurry
80	445563	118375 Southampton Road / Derby Road	Car	Slight	Failed to look properly
81	445616	118852 Wells Place / Mitchell Road	Car	Slight	Failed to look properly undertaking a poor turn


82	445207	117707	Wide Lane / South Street	MC	Slight	Failed to look properly / slow down
83	444934	117213	Wide Lane	Car	Slight	Failed to look properly / failed to judge other persons path or speed
84	444207	116819	Stoneham Interchange (M27 WB Onslip)	MC	Slight	Poor turn manoeuvre - car cut across laens
85	445592	118854	Wells Place / Market Street	Ped	Serious	Mobility scooter failed to stop in time and collided with pedestrian
86	444229	116775	Stoneham Interchange (Stoneham Way arm)	Car	Slight	Failed to stop in time - inexperienced/learner driver
87	443799	116888	M27 WB	Car	Serious	loss on control doe to medical episode
88	444725	116799	Wide Lane	Car	Slight	Fatigue / loss on control due to wet weather
89	444596	116637	M27 WB	Car	Slight	Failed to look properly when changing lanes
90	445616	119260	Romsey Road	Ped	Slight	Pedestrian was walking through stationary traffic - failed to look properly - likely due to disability or illness
91	444228	116781	Stoneham Interchange (Stoneham Way arm)	Car	Slight	Failed to stop in time due to failure to judge speed/path and wet weather conditions
92	445588	118857	Wells Place / Market Street	Ped	Slight	Pedestrian crossed the road in vehicle blind spot
93	444525	116734	M27 EB	Car	Slight	Failed to look properly when changing lanes
94	444322	116791	Stoneham Interchange (M27 WB Offslip)	Car	Slight	Failed to judge other persons path or speed / Failed to look properly / Distraction outside vehicle / Sudden braking

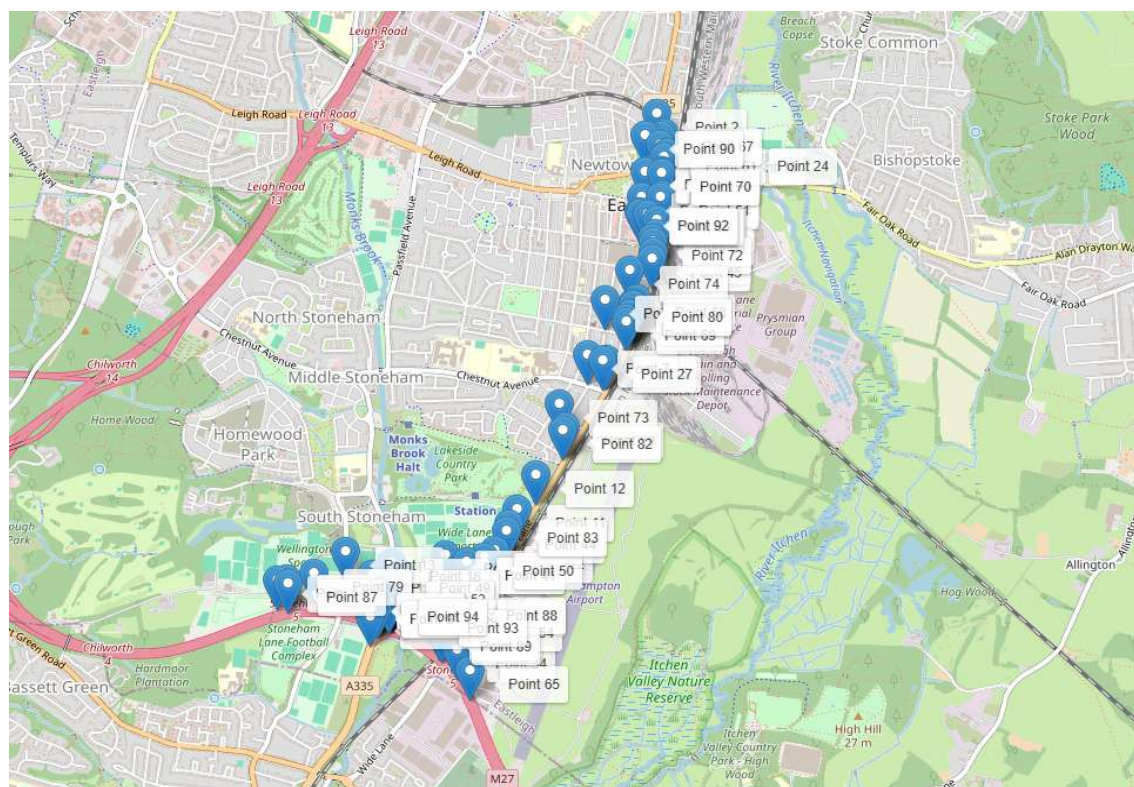

Colour-coding by SEVERITY

Total Accidents (31)

- Fatal (0)
- Serious (5)
- Slight (26)

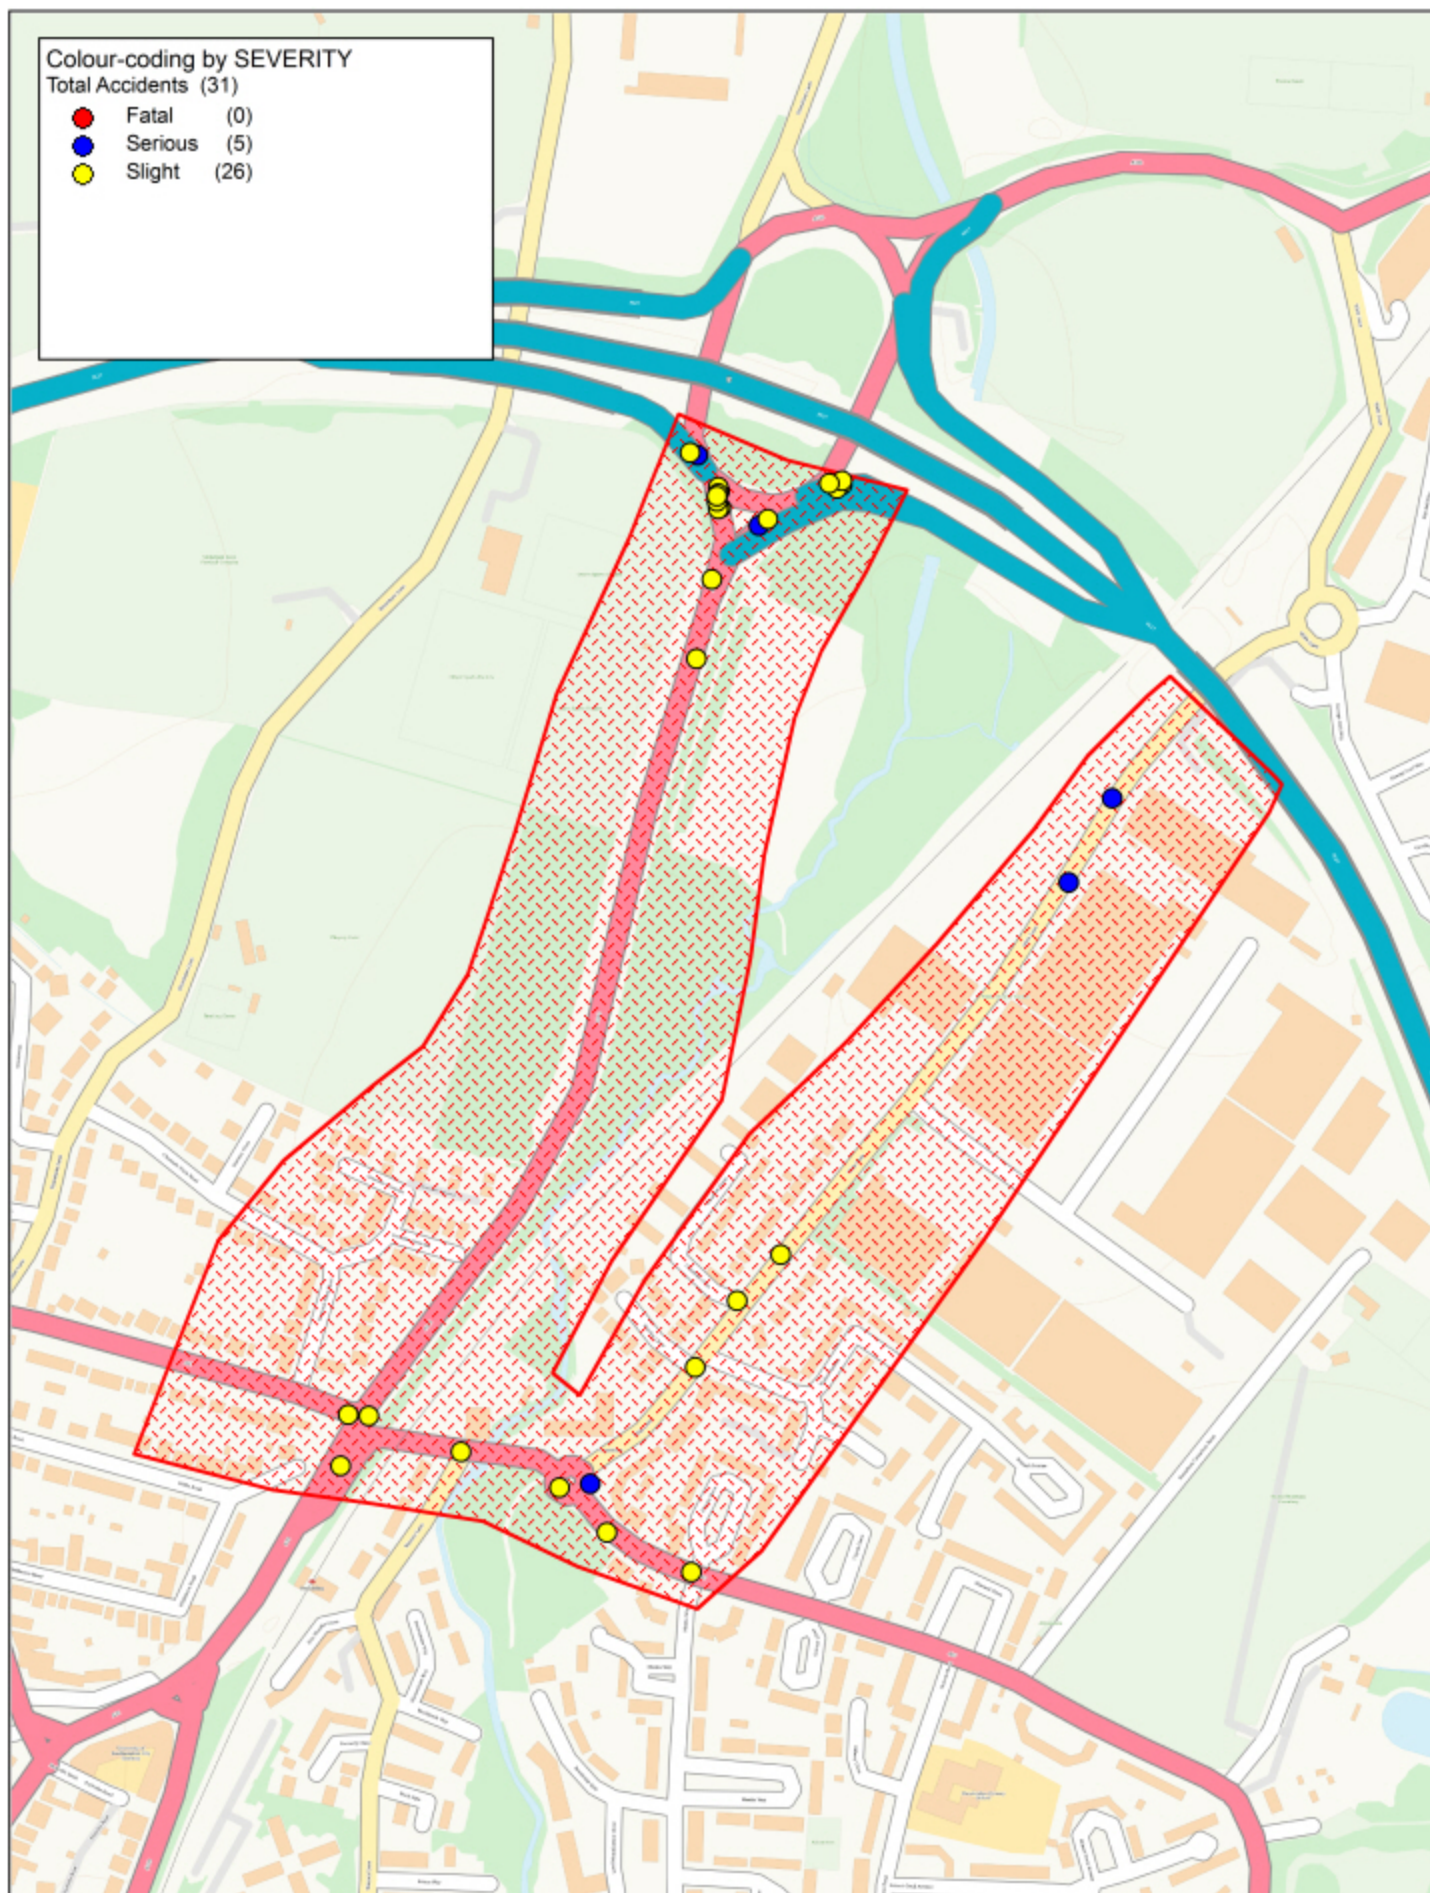

Stoneham Way / Wide Lane

© Crown copyright. All rights reserved
Hampshire Police
Licence No. 01021C 2025

SCALE

1 : 5900

DATE

23/01/2025

DRAWING No.

DRAWN BY

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("MC Stoneham way / Wide Lane")

Selected Polygon:MC Stoneham way / Wide Lane

44190149650 01/05/2019 Time 1358 Vehicles 2 Casualties 1 Slight
E:444278 N: 116192 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (MOBILITY SCOOTER) CROSSED WIDE LANE TRAVELLING SE AND WAS HIT BY VEH2 (CAR) TRAVELLING SW ALONG WIDE LANE.

Occurred on WIDE LANE, 45 METERS NE OF JUNCTION WITH CLAUDEEN CLOSE, SOUTHAMPTON, HAMPSHIRE.

Vehicle Reference 1 Mobility Scooter Starting
Vehicle movement from NW to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 97 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 97 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 47 Female
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44190156289 07/05/2019 Time 0815 Vehicles 2 Casualties 1 Slight
E:444228 N: 116785 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Motorway 37
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING N ALONG A335 STONEHAM LANE FAILED TO SLOW IN TIME ON APPROACH TO
THE ROUNDABOUT AND COLLIDED WITH THE REAR OF VEH1 (CAR) IN FRONT, WAITING TO ENTER RBT.
Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 28 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 28 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44190178130 24/05/2019 Time 0632 Vehicles 2 Casualties 1 Slight
E:444244 N: 116156 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 1	Very Likely
2nd:	Failed to look properly	Vehicle 2	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 2 (CAR) TRAVELLING SE ALONG CLAUDEEN CLOSE APPROACHING JUNCTION WITH WIDE LANE
WHEN VEH 2 (P/CYCLE) TRAVELLING NE ALONG WIDE LANE ON THE PAVEMENT ENTERED THE
JUNCTION AND COLLIDES.

Occurred on WIDE LANE AT JUNCTION WITH CLAUDEEN CLOSE, SOUTHAMPTON HAMPSHIRE.

Vehicle Reference 1 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from NW to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 31 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Pedal Cycle Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
9 No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 20 Male
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 20 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44190180843 26/05/2019 Time 1422 Vehicles 1 Casualties 1 Slight
E:444326 N: 116797 First Road: M 27 Road Type Dual carriageway
Speed limit: 70 Junction Detail: Slip Road Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Buildings, road signs, street furniture	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING W ALONG M27 WESTBOUND OFF SLIP CLIPPED THE KERB AND WENT ONTO THE ROAD SIDE FURNITURE AND FLIPPED ONTO ITS SIDE.

Occurred on M27 WESTBOUND JUNCTION 5 OFF SLIP AT JUNCTION WITH A 335 STONEHAM WAY, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway Overturned
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road Kerb Off road: None
Did not leave carr Age of Driver 35 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 35 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44190441808 08/12/2019 Time 0130 Vehicles 2 Casualties 1 Slight
E:444028 N: 116038 First Road: A 27 Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING N ALONG WESSEX LANE ALLEDGLY GOES THROUGH A RED LIGHT AND GOES TO TURN RIGHT ONTO A27 WIDE LANE AND COLLIDES WITH VEH1 (M/CYCLE) TRAVELLING W ALONG A27 WIDE LANE. VEH2 DOES NOT STOP.

Occurred on A27 WIDE LANE AT JUNCTION WITH WESSEX LANE, SOUTHAMPTON, HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Going ahead other
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 23 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 23 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Turning right
Vehicle movement from S to E No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44200022017 18/01/2020 Time 1710 Vehicles 4 Casualties 1 Slight
E:444268 N: 116767 First Road: A 35 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG A35 STONEHAM WAY CHANGED LANE AND COLLIDED WITH REAR
OF VEH 2 (CAR). VEH 2 HAS COLLIDED WITH VEH 3 (CAR) IN FRONT AND ALSO VEH 4 (CAR).

Occurred on A35 STONEHAM WAY AT JUNCTION WITH M27 WESTBOUND JUNCTION 5 OFFSLIP,
EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Changing lane to left
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 45 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 45 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 42 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates **01/05/2019 and 30/04/2024** (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
 within selected Polygons -HC - RPU Statistics Request ("MC
 Stoneham way / Wide Lane")

Vehicle Reference	3	Car	Going ahead but held up
Vehicle movement from	NE to SW	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Cleared junction or waiting/park	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	57
Not hit and run	Breath test	Not requested	Male
		Left hand drive:	No

Vehicle Reference	4	Car	Going ahead but held up
Vehicle movement from	NE to SW	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Cleared junction or waiting/park	First impact	Back
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	52
Not hit and run	Breath test	Not requested	Male
		Left hand drive:	No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44200022546 19/01/2020 Time 1045 Vehicles 1 Casualties 1 Slight
E:443956 N: 116066 First Road: A 35 Road Type Dual carriageway
Speed limit: 40 Junction Detail: Slip Road Automatic traffic signal A 35
Crossing: Control None Facilities: Ped. phase at traffic signal junction Road surface Frost/Ice
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Slippery road (due to weather)	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (M/CYCLE) TRAVELLING SW ALONG A35 STONEHAM WAY LOST CONTROL ON BLACK ICE
CAUSING VEH TO LOST CONTROL.

Occurred on A35 STONEHAM WAY AT JUNCTION WITH A35 BASSETT GREEN ROAD, SOUTHAMPTON,
HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway Skidded
Location at impact Mid Junction - on roundabout or T First impact Did not impact Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 33 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 33 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44200061937 18/02/2020 Time 0620 Vehicles 2 Casualties 1 Slight
E:444316 N: 116795 First Road: A 335 Road Type Single carriageway
Speed limit: 50 Junction Detail: Roundabout Automatic traffic signal Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lighting unknown Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

Factor:	Participant:	Confidence:
1st:		
2nd:		
3rd:		
4th:		
5th:		
6th:		

VEH1 (CAR) TRAVELLING SW AROUND A335 STONEHAM WAY RBT WHEN VEH2 (CAR) TRAVELLING NW
ALONG M27 J5 OFFSLIP ALLEGEDLY GOES THROUGH RED LIGHT AND COLLIDES INTO VEH1. VEH2 DOES
NOT STOP.

Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27 JUNCTION 5 W/B OFF-SLIP, EASTLEIGH,
HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 22 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 22 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

44200127895 10/04/2020 Time 1643 Vehicles 2 Casualties 3 Slight
E:443940 N: 116067 First Road: A 27 Road Type Dual carriageway
Speed limit: 40 Junction Detail: T & Stag Jct Automatic traffic signal A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st: Disobeyed automatic traffic signal	Vehicle 1	Possible	
2nd: Disobeyed automatic traffic signal	Vehicle 2	Possible	
3rd: Failed to look properly	Vehicle 1	Possible	
4th: Failed to look properly	Vehicle 2	Possible	
5th:			
6th:			

VEH 1 (CAR) TRAVELLING SW ALONG A335 STONEHAM LANE CROSSES JUNCTION AND TURNS RIGHT TOWARD A27 AS VEH 2 (CAR) IS TRAVELLING NE ALONG A335 AND COLLIDES. BOTH DRIVERS STATE ATS WAS ON GREEN FOR THEM.

Occurred on A27 BASSETT GREEN ROAD AT JUNCTION WITH A335 STONEHAM WAY, SOUTHAMPTON, HAMPSHIRE

Vehicle Reference 1 Car Turning right
Vehicle movement from SW to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 46 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 46 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 20 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Vehicle Reference	2	Car	Going ahead other
Vehicle movement from	SW to NE	No tow / articulation	Leaving the main road
On main carriageway		No skidding, jack-knifing or overturning	
Location at impact	Mid Junction - on roundabout or i	First impact	Front
Hit object in road	None	Off road:	None
Did not leave carr		Age of Driver	65
Not hit and run	Breath test	Negative	Male
		Left hand drive:	No

Casualty Reference:	3	Vehicle:	2	Age:	65	Male	Driver/rider	Severity:	Slight
Not a pupil									
Seatbelt	Not Applicable	Cycle helmet:	Not a cyclist						

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44200183719 21/05/2020 Time 1650 Vehicles 2 Casualties 1 Serious
E:444129 N: 116013 First Road: A 27 Road Type Single carriageway
Speed limit: 30 Junction Detail: Roundabout Give way or controlled A 27
Crossing: Control None Facilities: Zebra crossing Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Factor:	Causation	Participant:	Confidence:
1st:				
2nd:				
3rd:				
4th:				
5th:				
6th:				

VEH 2 (CAR) TRAVELLING SE ALONG A27 FAILS TO GIVE WAY TO VEH 1 (P/CYCLE) ALSO TRAVELLING SE
ALREADY ON RBT AND COLLIDES

Occurred on A27 WIDE LANE AT JUNCTION WITH MANSBRIDGE ROAD, SOUTHAMPTON, HAMPSHIRE.

Vehicle Reference 1 Pedal Cycle Going ahead other
Vehicle movement from NE to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 57 Male
Not hit and run Breath test Not applicable
Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 57 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Yes

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from W to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 27 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44200183253 23/05/2020 Time 1025 Vehicles 2 Casualties 2 Slight
E:444142 N: 115975 First Road: A 27 Road Type Single carriageway
Speed limit: 30 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: Zebra crossing Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 2	Very Likely
2nd:	Failed to look properly	Vehicle 1	Possible
3rd:	Sudden braking	Vehicle 1	
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING NW ALONG MANSBRIDGE ROAD WHEN PEDESTRIAN RUNNER ENTERED
ZEBRA CROSSING FROM OFFSIDE CAUSING VEH 1 TO BRAKE SUDDENLY. VEH 2 (CAR) TRAVELLING NW
ALONG A27 BEHIND VEH 1 FAILS TO BRAKE IN TIME AND COLLIDES WITH REAR OF VEH 1.

Occurred on A27 MANSBRIDGE ROAD, SOUTHAMPTON, HAMPSHIRE

Vehicle Reference 1 Car Stopping
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 53 Female
Not hit and run Breath test Not applicable
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 53 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 54 Male Passenger Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 38 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44200437902 11/11/2020 Time 1655 Vehicles 2 Casualties 1 Slight
E:444326 N: 116794 First Road: M 27 Road Type Slip road
Speed limit: 70 Junction Detail: Roundabout Automatic traffic signal Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lighting unknown Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (VAN) TRAVELLING W ALONG M27 OFF SLIP WHEN DRIVERS FOOT SLIPPED OFF THE CLUTCH,
CAUSING IT TO COLLIDED WITH THE REAR OF VEH1 (CAR) TRAVELLIGN W ALONG M27 OFF SLIP IN
FRONT, STATIONARY AT RED ATS.

Occurred on M27 WESTBOUND OFF SLIP, AT JUNCTION WITH STONEHAM WAY, EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 30 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 30 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Starting
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44210069291 24/02/2021 Time 0859 Vehicles 2 Casualties 1 Serious
E:444537 N: 116549 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: Pri Drive Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Inexperience with type of vehicle	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) ENTERING WIDE LANE (NE) FROM THE GARAGE FORECOURT HAS STOPPPED MID JUNCTION
DUE TO DRIVING AN UNFAMILIAR VEH. VEH 2 (CAR) TRAVELLING NE ALONG WIDE LANE HAS COLLIDED
WITH THE REAR OFFSIDE OF VEH 1 AS IT HAS EMERGED THEN STOPPPED IN THE MIDDLE
Occurred on WIDE LANE, OUTSIDE HENDY JAGUAR, SOUTHAMPTON, HAMPSHIRE.

Vehicle Reference 1 Car Turning left
Vehicle movement from NW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering main road First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 40 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
O/S Age of Driver 20 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 20 Female Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44210115995 28/03/2021 Time 1619 Vehicles 2 Casualties 1 Slight
E:444231 N: 116776 First Road: A 335 Road Type Single carriageway
Speed limit: 60 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Causation		
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING NE ALONG A335 STONEHAM WAY CHECKED TO HIS RIGHT THAT THE RBT WAS CLEAR AND THOUGH THAT VEH2 (CAR) TRAVELLING IN FRONT, HAD MOVED ONTO TEH ROUNDABOUT . VEH2 BRAKED ADN VEH1 COLLIDED WITH ITS REAR.

Occurred on A336 STONEHAM WAY AT JUNCTION WITH M27 SLIP ROADS, STONEHAM, HAMPSHIRE.

Vehicle Reference 1 Car Starting
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 42 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 9 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Back seat

Vehicle Reference 2 Car Stopping
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 23 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44210383436 23/09/2021 Time 1956 Vehicles 2 Casualties 1 Slight
E:444230 N: 116789 First Road: A 335 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Failed to look properly	Vehicle 001	Possible
2nd:	Poor turn or manoeuvre	Vehicle 001	Possible
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING N ON STONEHAM WAY TOWARDS JUNCTION 5 RBT FAILS TO SEE VEH 2 (CAR)
TRAVELLING N ON SAME ROAD AND WAITING AT JUNCTION AND COLLIDES WITH REAR OF VEH 2
Occurred on A335 STONEHAM WAY NEAR JUNCTION 5 OF M27

Vehicle Reference 1 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 50 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Taxi/Private hire car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 48 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 48 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44210513274 23/12/2021 Time 1400 Vehicles 2 Casualties 1 Slight
E:444229 N: 116792 First Road: A 335 Road Type 1
Speed limit: 50 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAVELLING GENERALLY N ALONG STONEHAM WY ENTERS RBT AND IS STRUCK FROM
BEHIND BY VEH 2 (CAR) WHICH HAS FAILED TO SLOW IN TIME
Occurred on ROUNDABOUT AT JUNCTION OF STONEHAM WAY/M27 BY MONKS BROOK PLAYING FIELDS

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 36 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 36 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 58 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44220318571 07/08/2022 Time 1014 Vehicles 2 Casualties 1 Slight
E:444229 N: 116787 First Road: A 335 Road Type Slip road
Speed limit: 40 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Failed to judge other persons path or speed	Vehicle 2	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAV NE ALONG STONEHAM WAY, ENTERING RBT IS STUCK FROM BEHIND BY VEH2 (CAR)
TRAV NE ALONG STONEHAM WAY, WHICH HAS FAILED TO JUDGE VEH1 MOVING OFF, CAUSING MINOR
INJURY TO CAS1 (VEH1 PASSENGER).

Occurred on STONEHAM WAY A335 SLIP RD, AT JCT WITH A335 STONEHAM INTERCHANGE RBT,
EASTLEIGH, HAMPSHIRE.

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Entering roundabout First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 38 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 4 Male Passenger Severity: Slight
Not a pupil
Seatbelt Unknown Cycle helmet: Not a cyclist

Back seat

Vehicle Reference 2 Car Starting
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44220344763 24/08/2022 Time 1723 Vehicles 2 Casualties 1 Serious
E:444213 N: 116817 First Road: M 27 Road Type Slip road
Speed limit: 70 Junction Detail: Slip Road Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Other	Vehicle 001	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

BOTTLE UNDER BRAKE PEDAL

VEH 1 (CAR) TRAVELLING N TO S ALONG M27 OFFSLIP COLLIDES WITH REAR OF VEH 2 (CAR) ALSO
TRAVELLING N TO S ALONG M37 OFFSLIP

Occurred on JUNCTION 7 WESTBOUND M27 OFFSLIP, STONEHAM

Vehicle Reference 1 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 51 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 32 Male Passenger Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 38 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44220456878 11/11/2022 Time 0937 Vehicles 2 Casualties 1 Slight
E:444105 N: 116010 First Road: A 27 Road Type 1
Speed limit: 30 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: Zebra crossing Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

	Factor:	Causation	Participant:	Confidence:
1st:				
2nd:				
3rd:				
4th:				
5th:				
6th:				

VEH 1 (CAR) TRAVELLING SE TO NE ALONG RBT ON A27 COLLIDES WITH UNKNOWN VEH 2 (VAN) ALSO TRAVELLING SE TO NE ALONG RBT ON A27

Occurred on RBT AT JUNCTION OF MANSBRIDGE ROAD/WIDE LANE, SWAYTHLING, SOUTHAMPTON

Vehicle Reference 1 Car Going ahead other
Vehicle movement from SE to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 74 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 74 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from SE to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Unknown
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

44230204672 23/05/2023 Time 1825 Vehicles 2 Casualties 1 Slight
E:444229 N: 116777 First Road: A 335 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING N ALONG STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED WITH
VEH1 (CAR) TRAVELLING N ALONG STONEHAM WAY, WAITING TO ENTER THE ROUNDABOUT
Occurred on A335 STONEHAM WAY AT ROUNDABOUT WITH M27, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 53 Female
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 53 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Stopping
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44230219978 03/06/2023 Time 1819 Vehicles 2 Casualties 1 Serious
E:444261 N: 116762 First Road: A 335 Road Type Dual carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 1	Possible
2nd:	Sudden braking	Vehicle 1	Possible
3rd:	Failed to judge other persons path or speed	Vehicle 1	Possible
4th:	Failed to look properly	Vehicle 2	Possible
5th:			
6th:			

VEH2 (CAR) TRAVELLING S ALONG STONEHAM WAY STOPPED FOR VEHICLE AHEAD AND WAS STRUCK
ON THE NEARSIDE BY VEH1 (CAR) TRAVELLING S ALONG STONEHAM WAY CHANGING LANES
Occurred on A335 STONEHAM WAY AT ROUNDABOUT WITH M27, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Changing lane to right
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Car Going ahead other
Vehicle movement from N to S No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 39 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 39 Female Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("MC Stoneham way / Wide Lane")

44230229973 10/06/2023 Time 1355 Vehicles 3 Casualties 2 Slight
E:444224 N: 116720 First Road: A 335 Road Type Dual carriageway
Speed limit: 50 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Following too close	Vehicle 3	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 3 (CAR) TRAVELLING N ALONG A335 STONEHAM WAY FAILED TO SLOW IN TIME FOR TRAFFIC APPROACHING THE M27 JUNCTION 5 RBT AND COLLIDED WITH THE REAR OF VEH 1 (CAR), PUSHING VEH 1 INTO THE REAR OF VEH 2 (CAR).

Occurred on A335 STONEHAM WAY 62 METRES SOUTH OF M27 JUNCTION 5 ROUNDABOUT, NORTH STONEHAM, HAMPSHIRE

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 24 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 24 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 63 Male
Not hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Vehicle Reference 3 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 25 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 2 Vehicle: 3 Age: 51 Male Passenger Severity: Slight
Not a pupil
Seatbelt Worn but not i Cycle helmet: Not a cyclist
Front seat

44230260795 29/06/2023 Time 2249 Vehicles 1 Casualties 1 Slight
E:443934 N: 116027 First Road: A 335 Road Type Single carriageway
Speed limit: 40 Junction Detail: T & Stag Jct Automatic traffic signal Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st: Loss of control	Vehicle 1	Very Likely	
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH 1 (M/CYCLE) TRAVELLING SW ALONG A335 STONEHAM WAY ACCELERATED AND LOST CONTROL,
COLLIDING WITH THE NEARSIDE KERB.

Occurred on A335 STONEHAM WAY AT JUNCTION WITH WIDE LANE, SWAYTHLING, HAMPSHIRE

Vehicle Reference 1 Motorcycle over 500cc Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Cleared junction or waiting/park First impact Front Hit vehicle:
Hit object in road Kerb Off road: None
Did not leave carr Age of Driver 33 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 33 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("MC Stoneham way / Wide Lane")

44230388489 23/09/2023 Time 0940 Vehicles 2 Casualties 1 Slight
E:444207 N: 116819 First Road: M 27 Road Type 1
Speed limit: 70 Junction Detail: Roundabout Give way or controlled A 335
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 1	Very Likely
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (CAR) TRAVELLING AROUND THE M27 JUNCTION 5 ROUNDABOUT CUT ACROSS THE LANES TO ENTER THE M27 WESTBOUND AND CUT ACROSS THE PATH OF VEH2 (M/CYCLE) TRAVELLING AROUND THE ROUNDABOUT INTENDING TO TRAVEL N ALONG STONEHAM LANE, CAUSING A COLLISION.
Occurred on M27 JUNCTION 5 ROUNDAOUT WITH A335 STONEHAM WAY, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Changing lane to left
Vehicle movement from E to W No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Leaving roundabout First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Nearside Age of Driver 74 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Vehicle Reference 2 Motorcycle over 500cc Going ahead right bend
Vehicle movement from E to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Offside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 37 Male
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 37 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44230416999 11/10/2023 Time 1920 Vehicles 2 Casualties 2 Slight
E:444229 N: 116775 First Road: A 335 Road Type Dual carriageway
Speed limit: 40 Junction Detail: Roundabout Give way or controlled Motorway 27
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Inexperienced or learner driver/rider	Vehicle 2	Very Likely
2nd:	Failed to judge other persons path or speed	Vehicle 2	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING NE ALONG STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED WITH
VEH1 (CAR) ALSO TRAVELLING NE ALONG STONEHAM WAY, WAITING TO ENTER THE ROUNDABOUT
Occurred on A335 STONEHAM WAY AT ROUNDABOUT WITH M27, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead but held up
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Female
Not hit and run Breath test Not requested
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 29 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 33 Male Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Car Going ahead other
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Not traced
Hit and run Breath test Not requested
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44230506294 12/12/2023 Time 0810 Vehicles 2 Casualties 1 Slight
E:444211 N: 116104 First Road: U Road Type Single carriageway
Speed limit: 30 Junction Detail: T & Stag Jct Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Poor turn or manoeuvre	Vehicle 1	Very Likely
2nd:	Failed to look properly	Vehicle 2	Possible
3rd:			
4th:			
5th:			
6th:			

VEH2 (CAR) TRAVELLING SE ALONG MARDON CLOSE TURNED RIGHT ONTO WIDE LANE AT THE SAME TIME AS VEH1 (M/CYCLE) TRAVELLING NE ALONG WIDE LANE WAS OVERTAKING STATIONARY TRAFFIC PAST THE JUNCTION, CAUSING A COLLISION.

Occurred on WIDE LANE AT JUNCTION WITH MARDON CLOSE, SOUTHAMPTON, HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Overtaking stat vehicle O/S
Vehicle movement from SW to NE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 31 Male
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 31 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Car Turning right
Vehicle movement from NW to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Mid Junction - on roundabout or r First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 34 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44240019238 14/01/2024 Time 1230 Vehicles 2 Casualties 2 Slight
E:444208 N: 115944 First Road: A 27 Road Type Single carriageway
Speed limit: 30 Junction Detail: Crossroads Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH2 (VAN) TRAVELLING SE ALONG MANSBRIDGE ROAD FAILED TO STOP IN TIME AND COLLIDED WITH THE REAR OF VEH1 (CAR) TRAVELLING E ALONG MANSBRIDGE ROAD, WAITING TO TURN INTO MONKS WAY

Occurred on A27 MANSBRIDGE ROAD AT JUNCTION WITH MONKS WAY, SOUTHAMPTON, HAMPSHIRE

Vehicle Reference 1 Car Waiting to turn right
Vehicle movement from NW to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 26 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 26 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Casualty Reference: 2 Vehicle: 1 Age: 24 Female Passenger Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Front seat

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead other
Vehicle movement from NW to SE No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44240027452 19/01/2024 Time 1618 Vehicles 2 Casualties 1 Slight
E:444212 N: 116658 First Road: A 335 Road Type Dual carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Dry
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st: Following too close	Vehicle 1	Very Likely	
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (M/CYCLE) TRAVELLING SW ALONG STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED
WITH VEH2 (VAN) TRAVELLING SW ALONG STONEHAM WAY, SLOWING FOR TRAFFIC AHEAD
Occurred on A335 STONEHAM WAY, 127 METERS SW OF JUNCTION 5 ROUNDABOUT WITH M27,
EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Going ahead other
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 17 Male
Not hit and run Breath test Not requested Left hand drive: No
Casualty Reference: 1 Vehicle: 1 Age: 17 Male Driver/rider Severity: Slight
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Vehicle Reference 2 Van or Goods 3.5 tonnes mgw and under Going ahead but held up
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 63 Female
Not hit and run Breath test Not requested Left hand drive: No

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

44240092091 01/03/2024 Time 1605 Vehicles 1 Casualties 1 Serious
E:444503 N: 116483 First Road: U Road Type Single carriageway
Speed limit: 40 Junction Detail: Not within 20m of junction
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Daylight Raining without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: Elsewhere DfT Special Projects:

Causation			
Factor:	Participant:	Confidence:	
1st:			
2nd:			
3rd:			
4th:			
5th:			
6th:			

VEH1 (M/CYCLE) TRAVELLING SW ALONG WIDE LANE LOST CONTROL ON THE WET ROAD SURFACE
WHEN BRAKING CAUSING CAS1 (RIDER) TO FALL
Occurred on WIDE LANE, 269 METERS SW OF ROUNDABOUT WITH MITCHELL WAY, SOUTHAMPTON,
HAMPSHIRE

Vehicle Reference 1 Motor Cycle over 50 cc and up to 125cc Stopping
Vehicle movement from NE to SW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Not at, or within 20M of Jct First impact Nearside Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 49 Male
Not hit and run Breath test Driver not contacted
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 49 Male Driver/rider Severity: Serious
Not a pupil
Seatbelt Not Applicable Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection: Notes:

Selected using Pre-defined Query : ; Refined using Accidents within selected Polygons -HC - RPU Statistics Request ("MC Stoneham way / Wide Lane")

44240095045 04/03/2024 Time 1950 Vehicles 2 Casualties 1 Slight
E:444228 N: 116781 First Road: A 335 Road Type Single carriageway
Speed limit: 50 Junction Detail: Roundabout Give way or controlled Unclassified
Crossing: Control None Facilities: None within 50m Road surface Wet/Damp
Darkness: street lights present and lit Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation			
	Factor:	Participant:	Confidence:
1st:	Slippery road (due to weather)	Vehicle 1	Possible
2nd:	Failed to judge other persons path or speed	Vehicle 1	Very Likely
3rd:			
4th:			
5th:			
6th:			

VEH 1 (CAR) TRAV N ALONG A335 STONEHAM WAY FAILED TO STOP IN TIME AND COLLIDED WITH THE REAR OF VEH 2 (CAR) WHICH WAS STATIONARY AND WAITING TO ENTER THE STONEHAM INTERCHANGE RBT AT M27 JUNCTION 5. THE IMPACT PUSHED VEH 2 ONTO THE RBT.

Occurred on A335 STONEHAM WAY AT JUNCTION WITH M27 JUNCTION 5 STONEHAM INTERCHANGE, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Going ahead other
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 21 Male
Not hit and run Breath test Negative
Left hand drive: No

Vehicle Reference 2 Car Going ahead but held up
Vehicle movement from S to N No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 29 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 2 Age: 29 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Worn and ind Cycle helmet: Not a cyclist

Accidents between dates 01/05/2019 and 30/04/2024 (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
within selected Polygons -HC - RPU Statistics Request ("MC
Stoneham way / Wide Lane")

Notes:

44240171177 24/04/2024 Time 1131 Vehicles 2 Casualties 1 Slight
E:444322 N: 116791 First Road: M 27 Road Type Single carriageway
Speed limit: 40 Junction Detail: Roundabout Automatic traffic signal Unclassified
Crossing: Control None Facilities: None within 50m Road surface Dry
Daylight Fine without high winds
Special Conditions at Site None Carriageway Hazards: None
Place accident reported: At scene DfT Special Projects:

Causation

	Factor:	Participant:	Confidence:
1st:	Distraction outside vehicle	Vehicle 2	Very Likely
2nd:	Failed to look properly	Vehicle 2	Very Likely
3rd:	Failed to judge other persons path or speed	Vehicle 2	Very Likely
4th:	Sudden braking	Vehicle 1	Very Likely
5th:			
6th:			

VEH 1 (CAR) TRAVELLING NW ALONG M27 WESTBOUND JUNCTION 5 OFFSLIP BRAKED SUDDENLY DUE TO A POLICE VEHICLE PASSING ON THE RBT RESPONDING TO AN EMERGENCY CALL. VEH 2 (LORRY) THEN COLLIDED WITH THE REAR OF VEH 1.

Occurred on M27 WESTBOUND JUNCTION 5 OFFSLIP AT JUNCTION WITH STONEHAM INTERCHANGE, EASTLEIGH, HAMPSHIRE

Vehicle Reference 1 Car Stopping
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Back Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 30 Female
Not hit and run Breath test Negative
Left hand drive: No

Casualty Reference: 1 Vehicle: 1 Age: 30 Female Driver/rider Severity: Slight
Not a pupil
Seatbelt Unknown Cycle helmet: Not a cyclist

Vehicle Reference 2 Goods over 3.5 tonnes and under 7.5 to Starting
Vehicle movement from SE to NW No tow / articulation Leaving the main road
On main carriageway No skidding, jack-knifing or overturning
Location at impact Jct Approach First impact Front Hit vehicle:
Hit object in road None Off road: None
Did not leave carr Age of Driver 61 Male
Not hit and run Breath test Negative
Left hand drive: No

Accidents between dates **01/05/2019 and 30/04/2024** (60) months

Selection:

Selected using Pre-defined Query : ; Refined using Accidents
 within selected Polygons -HC - RPU Statistics Request ("MC
 Stoneham way / Wide Lane")

Notes:

Accidents involving:

	Fatal	Serious	Slight	Total
Motor vehicles only (excluding 2-wheels)	0	3	18	21
2-wheeled motor vehicles	0	1	6	7
Pedal cycles	0	1	1	2
Horses & other	0	0	1	1
Total	0	5	26	31

Casualties:

	Fatal	Serious	Slight	Total
Vehicle driver	0	2	18	20
Passenger	0	1	7	8
Motorcycle rider	0	1	6	7
Cyclist	0	1	1	2
Pedestrian	0	0	0	0
Other	0	0	0	0
Total	0	5	32	37

