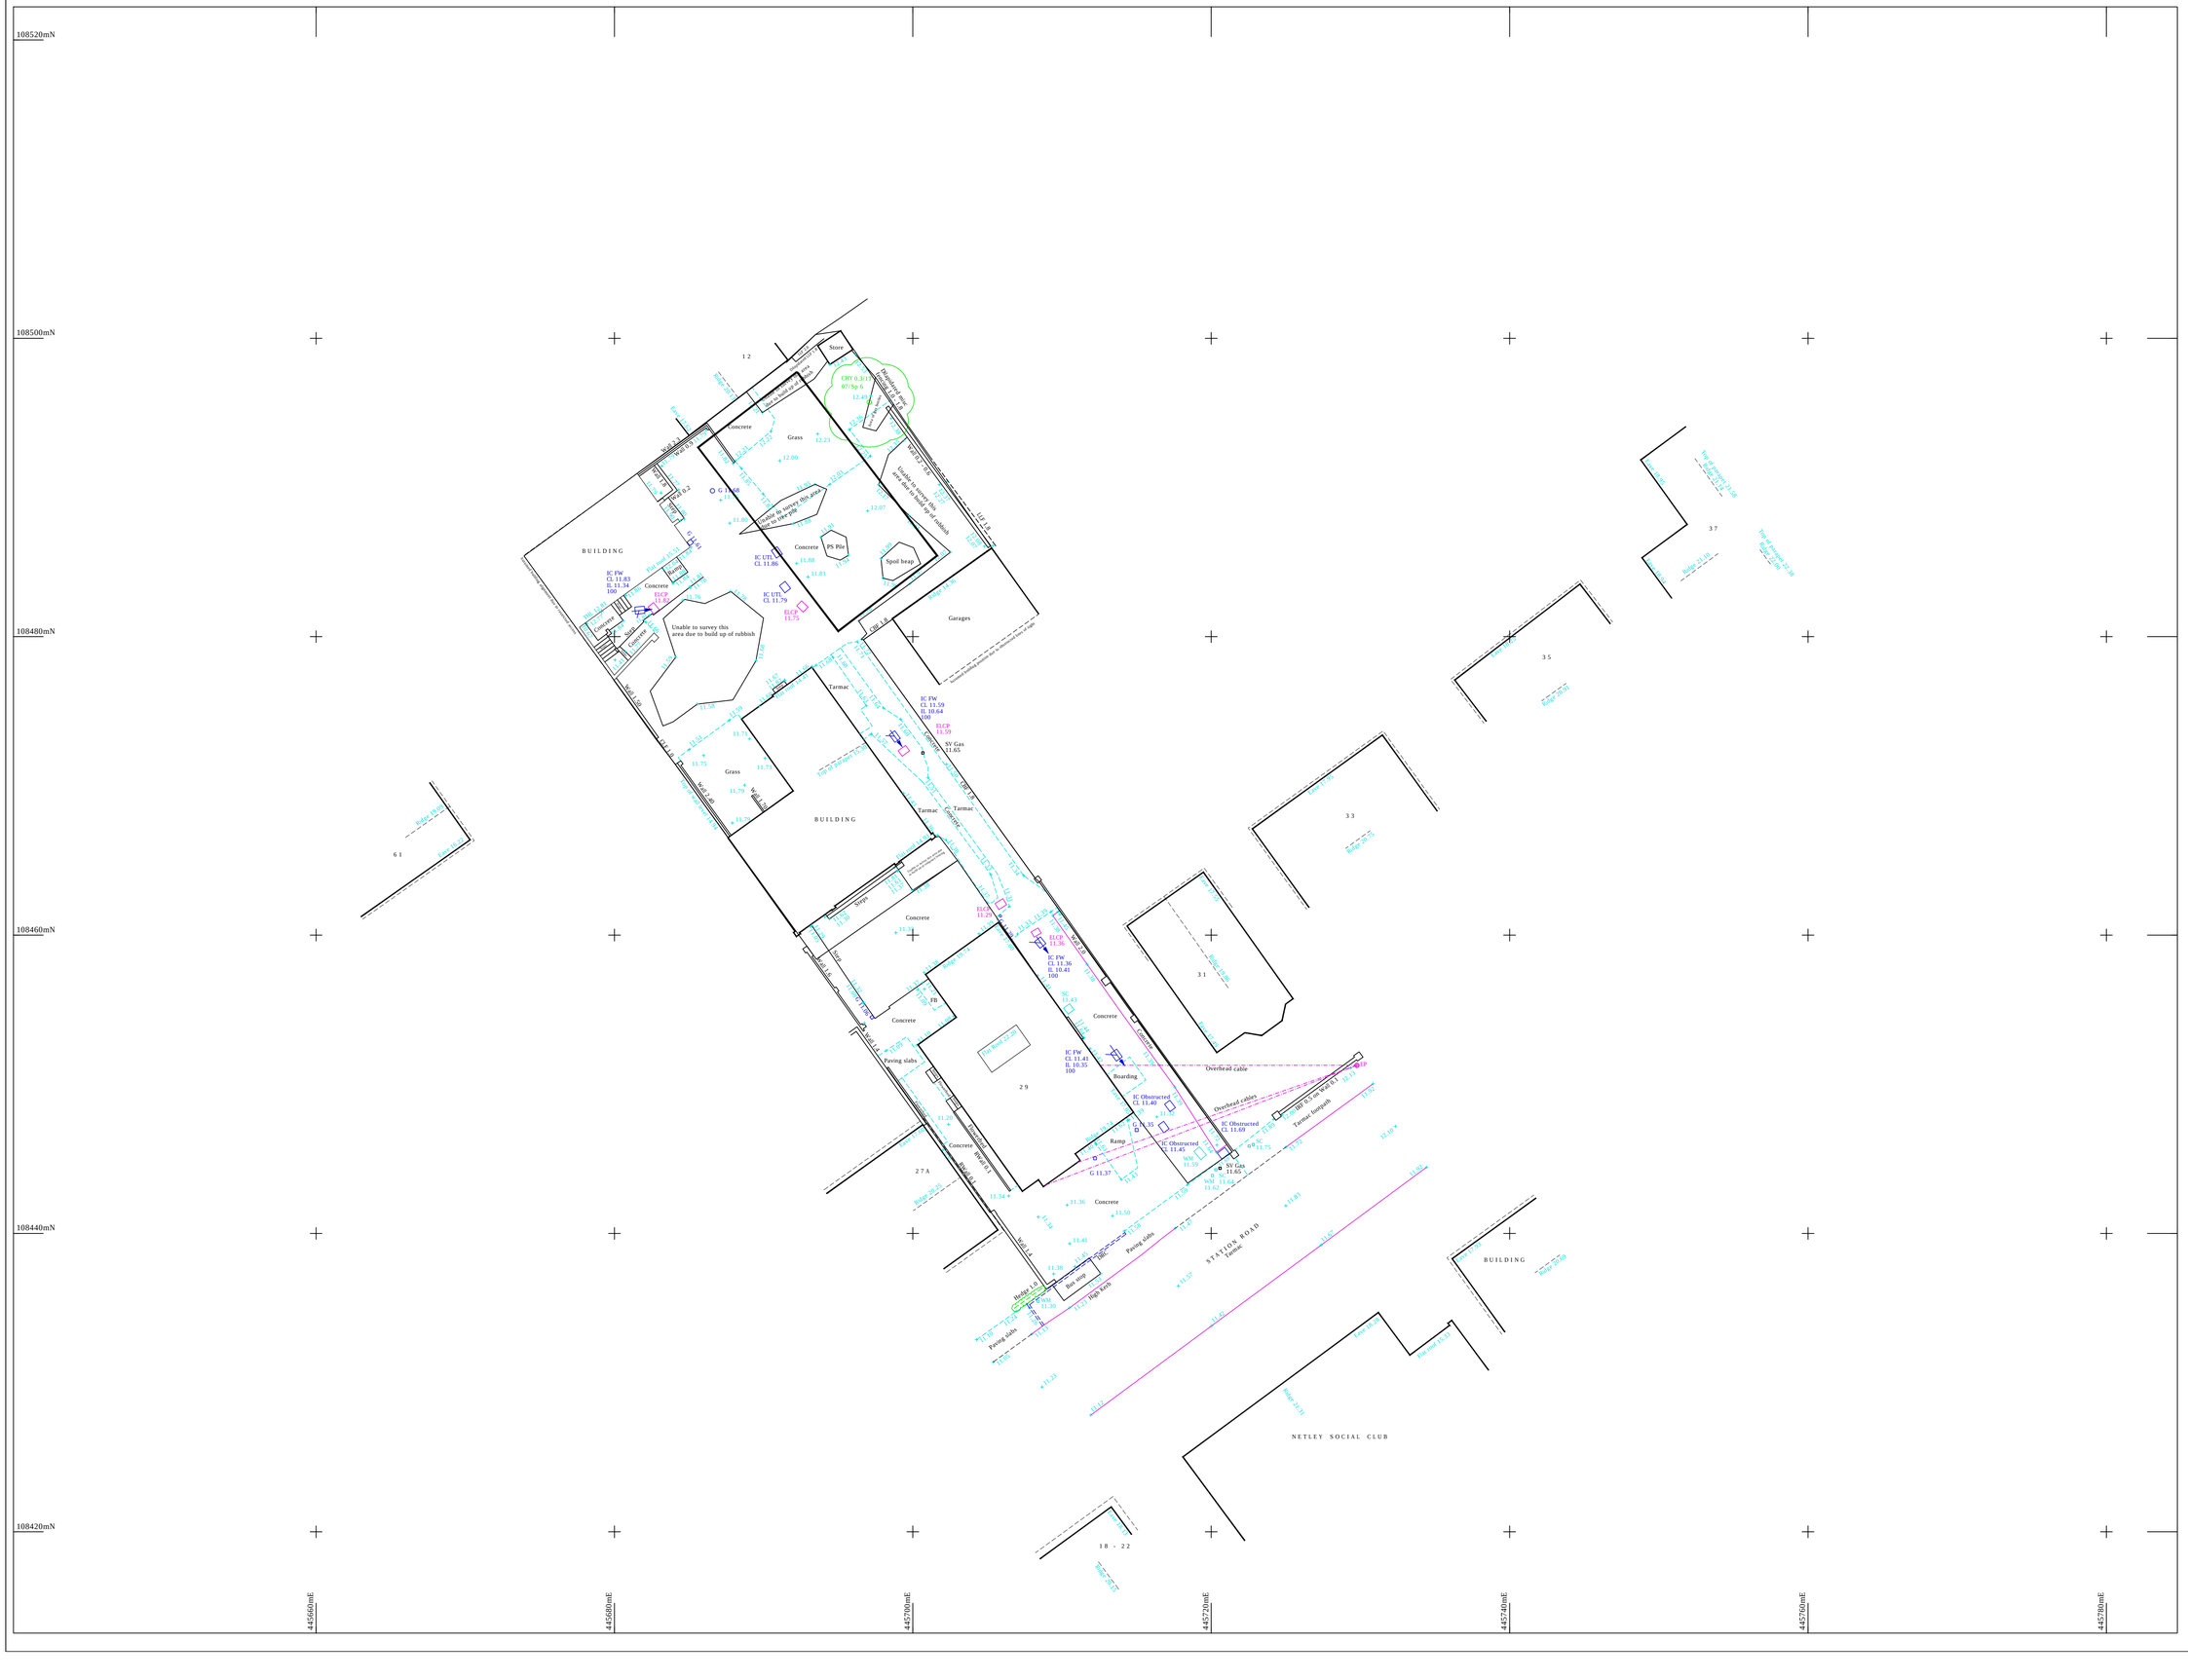
108520mN
108500mN
108480mN
108460mN
108440mN
108420mN
445660mE
445680mE
445700mE
445720mE
445740mE
445760mE
445780mE
BUILDING
Concrete
Grass
Tarmac
Garages
Store
Boarding
Ramp
Paving slabs
Spoil heap
PS Pillr
Soil Road 2.0m
Tarmac footpath
Overhead cables
Hedge 1.5
Wall 1.1
Wall 2.0
Wall 0.2
Wall 0.7
Fence 1.8
Fence 0.7
Unable to survey this area due to build up of rubbish
Unable to survey this area due to build up of rubbish and cars
Obstructed by trees
Ditch
Kerb
Gully
Manhole
Inspection Chamber
Telegraph Pole
Lamp Post
Sign
Bollard
Post
Gate
Steps
Ramp
Level Datum
Grid
Northpoint
IC FW CL 11.83 CL 11.34 1.03
IC UTL CL 11.86
IC UTL CL 11.79
IC FW CL 11.59 IL 10.64 100
IC FW CL 11.36 IL 10.41 100
IC FW CL 11.41 IL 10.35 100
IC Obstructed CL 11.40
IC Obstructed CL 11.09
IC Obstructed CL 11.43
ELCP 11.75
ELCP 11.59
ELCP 11.26
ELCP 11.36
SV Gas 11.65
SV Gas 11.65
G 11.37
G 11.35
G 11.41
CHY 0.3/11 07/Sep 6
12.49
Ridge 14.56
Ridge 14.54
Ridge 20.25
Ridge 21.10
Ridge 22.96
Ridge 20.51
Ridge 20.75
Ridge 22.96
Ridge 21.11
Ridge 20.16
Ridge 21.21
Ridge 20.21
Top of parapet 21.56
Top of parapet 21.39
Eaves 18.07
Eaves 18.07
Eaves 19.07
Eaves 19.07
Eaves 19