

LEVEL MONITORING

for SMS (ESU)

19 Beechwood Rise, Southampton, Hampshire, SO18 3PW

Client:	SMS (ESU)
Client Contact:	Richard Bryant
Claim Number:	4005487838
Client Reference:	IFS-ESU-SUB-22-0103393
Policy Holder:	Mrs Dawn Linington
Report Date:	21 November 2024
Our Ref:	M21957



Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9	10
06/09/2023	10.0000	10.6591	10.3599	10.3666	10.3571	10.3641		10.6657	10.6631	10.6574
31/10/2023	10.0000	10.6592	10.3600	10.3662	10.3575	10.3714	10.3772	10.6685	10.6675	10.6614
09/01/2024	10.0000	10.6605	10.3605	10.3693	10.3609	10.3742	10.3798	10.6700	10.6688	10.6630
06/03/2024	10.0000	10.6600	10.3610	10.3688	10.3608	10.3741	10.3793	10.6694	10.6681	10.6614
19/06/2024	10.0000	10.6589	10.3613	10.3685	10.3609	10.3735	10.3786	10.6697	10.6685	10.6622
07/08/2024	10.0000	10.6594	10.3605	10.3681	10.3594	10.3700	10.3765	10.6690	10.6668	10.6613
20/11/2024	10.0000	10.6596	10.3609	10.3688	10.3596	10.3735	10.3784	10.6692	10.6683	10.6619



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

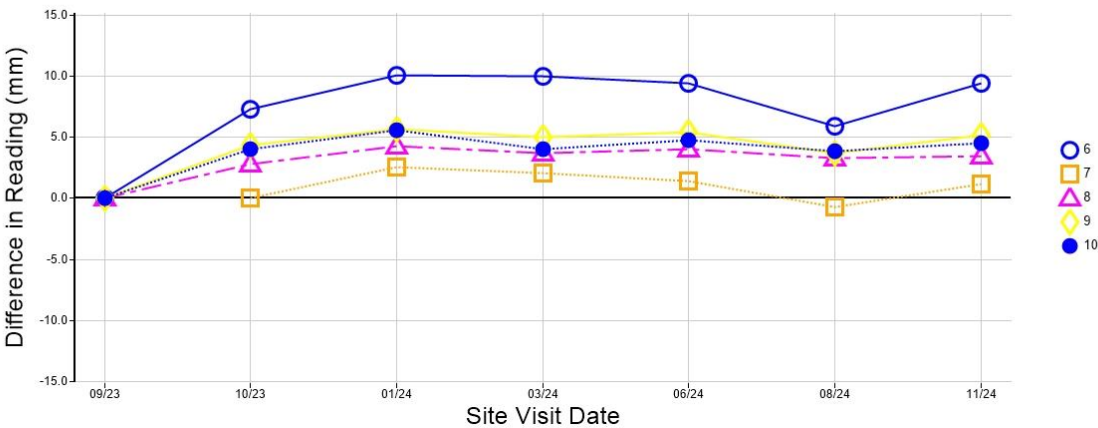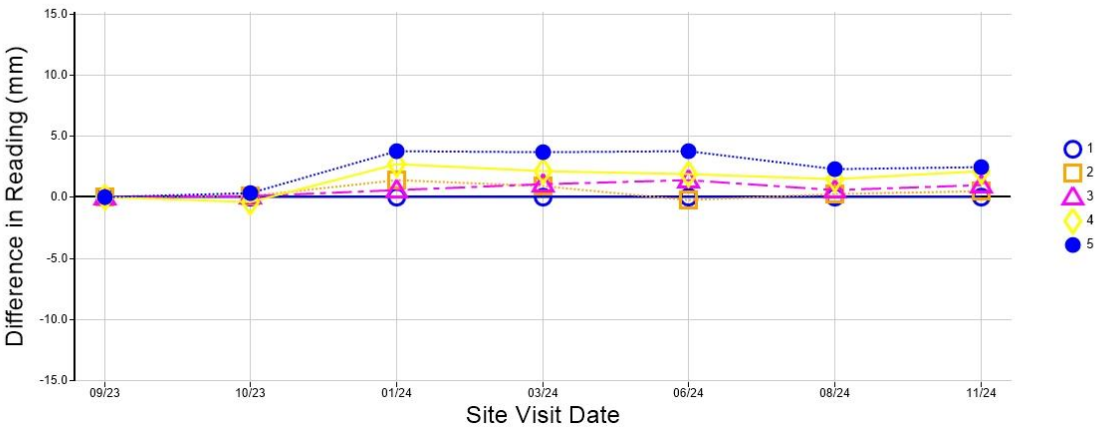

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

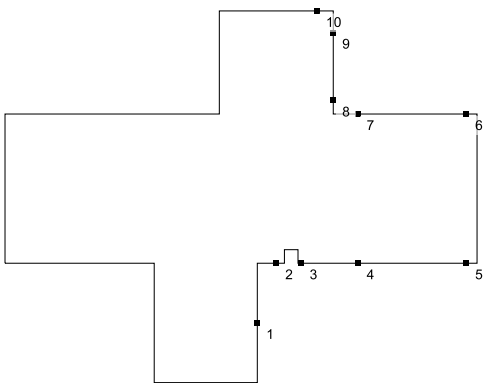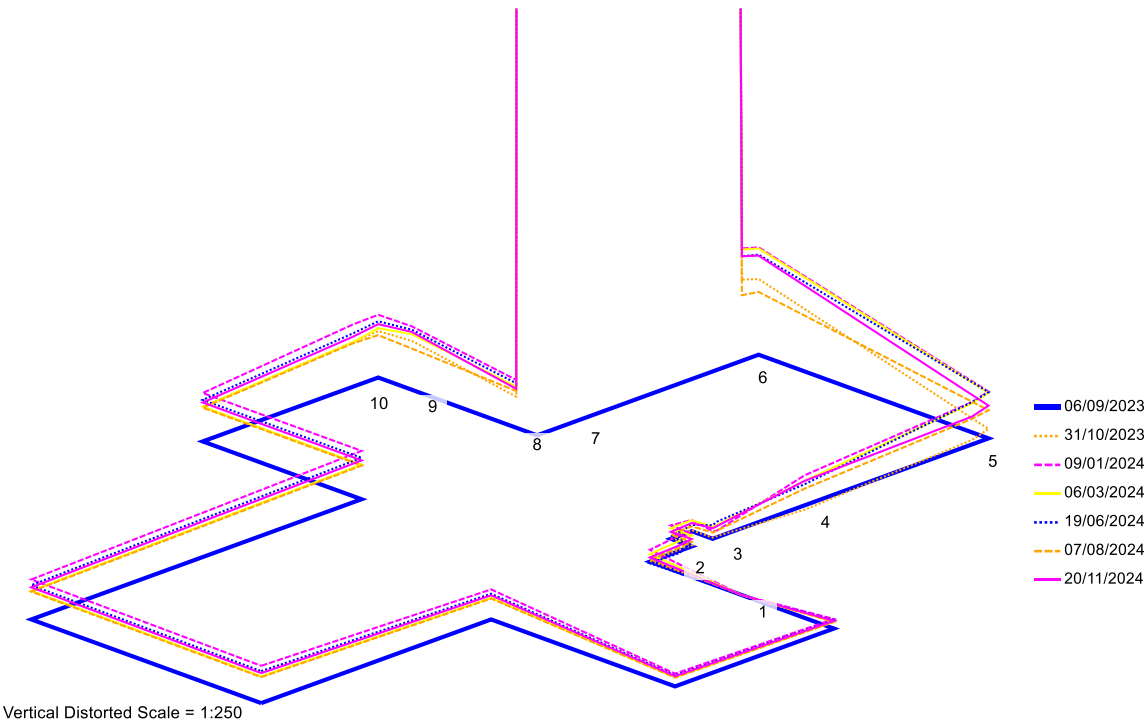

FRONT

Site Visit Notes

Datum is level station 1, it has an assumed value of 10,0000m. No suitable secondary datum available. If this is not suitable please advise if a deep datum is required. Relative Survey.